

**ENGINEERING CHANGE NOTICE**

Page 1 of 2

1 ECN **671039**

Proj  
ECN

2 ECN Category (mark one) Supplemental <input type="checkbox"/> Direct Revision <input checked="" type="checkbox"/> Change ECN <input type="checkbox"/> Temporary <input type="checkbox"/> Standby <input type="checkbox"/> Supersedure <input type="checkbox"/> Cancel/Void <input type="checkbox"/>	3 Originator's Name Organization MSIN and Telephone No B M Hanlon Inventory & Flowsheet Eng R3-72 373-2053		4 USQ Required? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	5 Date 11/30/01
	6 Project Title/No /Work Order No Waste Tank Summary Report for Month Ending October 31 2001		7 Bldg /Sys /Fac No N/A	8 Approval Designator N/A
	9 Document Numbers Changed by this ECN (includes sheet no and rev ) HNF-EP-0182 Rev 162		10 Related ECN No(s) N/A	11 Related PO No N/A
	12a Modification Work <input type="checkbox"/> Yes (fill out Blk 12b) <input checked="" type="checkbox"/> No (NA Blks 12b 12c 12d)	12b Work Package No N/A	12c Modification Work Completed N/A Design Authority/Cog Engineer Signature & Date	12d Restored to Original Condition (Temp or Standby ECNs only) N/A Design Authority/Cog Engineer Signature & Date

13a Description of Change

13b Design Baseline Document?  Yes  No

Complete revision

Computer generated

File \\AP001\CHG-DOC-TRANSFER-TEMP-HNF-EP-0182 1,581 KB

Size 154 MB (1,618,432 bytes)

Modified Wednesday, December 19, 2001, 3:42:24 pm

14a Justification (mark one) Criteria Change <input type="checkbox"/> Design Improvement <input type="checkbox"/> Environmental <input type="checkbox"/> Facility Deactivation <input type="checkbox"/> As-Found <input type="checkbox"/> Facilitate Const <input type="checkbox"/> Const Error/Omission <input type="checkbox"/> Design Error/Omission <input type="checkbox"/>	14b Justification Details This ECN is being generated to update waste tank farm summary information
--	---

15 Distribution (include name MSIN and no of copies)

Distribution list attached following document

Also Electronic copy to John Vann only

RELEASE STAMP

**DEC 20 2001**

DATE

STA. 4

HANFORD  
RELEASE

ID. 8

# ENGINEERING CHANGE NOTICE

Page 2 of 2

1 ECN (use no from pg 1)

671039

16 Design Verification Required

- Yes  
 No

17 Cost Impact

ENGINEERING

Additional  \$ \_\_\_\_\_  
Savings  \$ \_\_\_\_\_

CONSTRUCTION

Additional  \$ \_\_\_\_\_  
Savings  \$ \_\_\_\_\_

18 Schedule Impact (days)

Improvement  \_\_\_\_\_  
Delay  \_\_\_\_\_

19 Change Impact Review Indicate the related documents (other than the engineering documents identified on Side 1) that will be affected by the change described in Block 13. Enter the affected document number in Block 20.

- |   |   |   |
|---|---|---|
| <p>SDD/DD <input type="checkbox"/></p> <p>Functional Design Criteria <input type="checkbox"/></p> <p>Operating Specification <input type="checkbox"/></p> <p>Criticality Specification <input type="checkbox"/></p> <p>Conceptual Design Report <input type="checkbox"/></p> <p>Equipment Spec <input type="checkbox"/></p> <p>Const Spec <input type="checkbox"/></p> <p>Procurement Spec <input type="checkbox"/></p> <p>Vendor Information <input type="checkbox"/></p> <p>OM Manual <input type="checkbox"/></p> <p>FSAR/SAR <input type="checkbox"/></p> <p>Safety Equipment List <input type="checkbox"/></p> <p>Radiation Work Permit <input type="checkbox"/></p> <p>Environmental Impact Statement <input type="checkbox"/></p> <p>Environmental Report <input type="checkbox"/></p> <p>Environmental Permit <input checked="" type="checkbox"/></p> | <p>Seismic/Stress Analysis <input type="checkbox"/></p> <p>Stress/Design Report <input type="checkbox"/></p> <p>Interface Control Drawing <input type="checkbox"/></p> <p>Calibration Procedure <input type="checkbox"/></p> <p>Installation Procedure <input type="checkbox"/></p> <p>Maintenance Procedure <input type="checkbox"/></p> <p>Engineering Procedure <input type="checkbox"/></p> <p>Operating Instruction <input type="checkbox"/></p> <p>Operating Procedure <input type="checkbox"/></p> <p>Operational Safety Requirement <input type="checkbox"/></p> <p>IEFD Drawing <input type="checkbox"/></p> <p>Cell Arrangement Drawing <input type="checkbox"/></p> <p>Essential Material Specification <input type="checkbox"/></p> <p>Fac Proc Samp Schedule <input type="checkbox"/></p> <p>Inspection Plan <input type="checkbox"/></p> <p>Inventory Adjustment Request <input type="checkbox"/></p> | <p>Tank Calibration Manual <input type="checkbox"/></p> <p>Health Physics Procedure <input type="checkbox"/></p> <p>Spares Multiple Unit Listing <input type="checkbox"/></p> <p>Test Procedures/Specification <input type="checkbox"/></p> <p>Component Index <input type="checkbox"/></p> <p>ASME Coded Item <input type="checkbox"/></p> <p>Human Factor Consideration <input type="checkbox"/></p> <p>Computer Software <input type="checkbox"/></p> <p>Electric Circuit Schedule <input checked="" type="checkbox"/></p> <p>ICRS Procedure <input type="checkbox"/></p> <p>Process Control Manual/Plan <input type="checkbox"/></p> <p>Process Flow Chart <input type="checkbox"/></p> <p>Purchase Requisition <input type="checkbox"/></p> <p>Tickler File <input type="checkbox"/></p> <p>_____ <input type="checkbox"/></p> <p>_____ <input type="checkbox"/></p> |
|---|---|---|

20 Other Affected Documents (NOTE: Documents listed below will not be revised by this ECN) Signatures below indicate that the signing organization has been notified of other affected documents listed below

Document Number/Revision                      Document Number/Revision                      Document Number/Revision

N/A

21 Approvals

Signature	Date	Signature	Date
Design Authority _____	_____	Design Agent _____	_____
Cog Eng B M H nlon <i>B M H nlon</i>	11/30/01	PE _____	_____
Cog Mgr N W Kirch <i>N W Kirch</i>	12/19/01	QA _____	_____
QA _____	_____	Safety _____	_____
Safety _____	_____	Design _____	_____
Environ _____	_____	Environ _____	_____
Other _____	_____	Other _____	_____

**DEPARTMENT OF ENERGY**

Signature or a Control Number that tracks the Approval Signature

**ADDITIONAL**

# **Waste Tank Summary Report for Month Ending October 31, 2001**

**Prepared for the U S Department of Energy  
Assistant Secretary for Environmental Management**

**CH2MHILL**  
*Hanford Group, Inc*

Richland Washington

**Contractor for the U S Department of Energy  
Office of River Protection under Contract DE AC27 99RL14047**

**Approved for Public Release Further Dissemination Unlimited**

**LEGAL DISCLAIMER**

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

This report has been reproduced from the best available copy.  
Available in paper copy and microfiche.

Available electronically at

<http://www.doe.gov/bridge>. Available for a

processing fee to the U.S. Department of Energy and its contractors, in paper, from:

U.S. Department of Energy

Office of Scientific and Technical Information

P.O. Box 62

Oak Ridge, TN 37831-0062

phone: 865-576-8401

fax: 865-576-5728

email: [reports@adonis.osti.gov](mailto:reports@adonis.osti.gov)(423) 576-8401

Available for sale to the public, in paper, from:

U.S. Department of Commerce

National Technical Information Service

5285 Port Royal Road

Springfield, VA 22161

Phone: 800-553-6847

fax: 703-605-6900

email: [orders@ntis.fedworld.gov](mailto:orders@ntis.fedworld.gov)

online ordering:

<http://www.ntis.gov/ordering.htm>

Printed in the United States of America





# **Waste Tank Summary Report for Month Ending October 31, 2001**

**B M Hanlon**  
CH2M HILL Hanford Group Inc

Date Published  
December 2001

Prepared for the U S Department of Energy  
Assistant Secretary for Environmental Management

**CH2MHILL**  
*Hanford Group, Inc*

P O Box 1500  
Richland Washington

Contractor for the U S Department of Energy  
Office of River Protection under Contract DE AC27 99RL14047

Approved for Public Release, Further Dissemination Unlimited

**This page intentionally left blank**

## WASTE TANK SUMMARY REPORT

B M Hanlon

### ABSTRACT

*This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report provides data on each of the existing 177 large underground waste storage tanks and 63 smaller miscellaneous underground storage tanks and special surveillance facilities and supplemental information regarding tank surveillance anomalies and ongoing investigations. This report is intended to meet the requirement of U S Department of Energy-Richland Operations Office Order 435 1 (DOE-RL, July 1999 Radioactive Waste Management U S Department of Energy-Richland Operations Office Richland, Washington) requiring the reporting of waste inventories and space utilization for Hanford Tank Farm tanks.*

**This page intentionally left blank**

## TABLE OF CONTENTS

SUMMARY	1
I WASTE TANK STATUS	1
II WASTE TANK INVESTIGATIONS	1
III SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS	2
Appendixes	
A DOUBLE SHELL TANKS – MONTHLY SUMMARY TABLES	A 1
<u>Tables.</u>	
1 Inventory and Status by Tank Double-Shell Tanks	A 2
2 Summary of Waste Transactions in the Double-Shell Tank System	A-4
3 Double Shell Tank Space Usage and Inventory by Waste Type	A 5
4 Double-Shell Tank Monitoring Compliance Status	A-6
B SINGLE SHELL TANKS – MONTHLY SUMMARY TABLES	B 1
<u>Tables</u>	
1 Inventory and Status by Tank Single Shell Tanks	B 2
2 Single Shell Tanks Stabilization Status Summary	B 13
3 Single-Shell Tanks Interim Stabilization Status	B 14
4 Single Shell Tanks Interim Stabilization Milestones (Consent Decree)	B 17
5 Single Shell Tanks Leak Volume Estimates	B 19
6 Single-Shell Tanks Monitoring Compliance Status	B 25
C MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES	C 1
<u>Tables</u>	
1 Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (Active)	C 2
2 East Area Underground Storage Tanks and Special Surveillance Facilities (Inactive)	C 3
3 West Area Underground Storage Tanks and Special Surveillance Facilities (Inactive)	C-4
D GLOSSARY OF TERMS	D 1
<u>Tables</u>	
1 Glossary of Terms	D 2
E TANK CONFIGURATION AND FACILITIES CHARTS	E 1
<u>Figures.</u>	
1 High Level Waste Tank Configuration	E 2
2 Double Shell Tank Instrumentation Configuration	E 3
3 Single Shell Tank Instrumentation Configuration	E-4

METRIC CONVERSION CHART		
1 inch	=	2 54 centimeters
1 foot	=	30 48 centimeters
1 gallon	=	3 79 liters
1 ton	=	0 91 metric tons
$^{\circ}\text{F} = \left(\frac{9}{5}^{\circ}\text{C}\right) + 32$		
1 Btu/h = 0 2931 watts (International Table)		

**WASTE TANK SUMMARY REPORT**  
For Month Ending October 31 2001

Note Changes from the previous month are in **bold print**

**I WASTE TANK STATUS**

Double Shell Tanks	28 double shell	10/86
Single-Shell Tanks	149 single-shell	1966
Assumed Leaker Tanks	67 single shell	07/93
Sound Tanks	28 double shell 82 single-shell	1986 07/93
Interim Stabilized Tanks <sup>a</sup> (IS)	129 single shell	06/01
Not Interim Stabilized <sup>b</sup>	20 single-shell	06/01
Isolated Intrusion Prevention Completed (IP)	108 single-shell	09/96
Controlled, Clean, and Stable (CCS)	36 single shell	09/96
Misc Underground Storage Tanks and Special Surveillance Facilities (Active)	10 Tanks East Area 7 Tanks West Area	03/01 (AX 152)
Misc Underground Storage Tanks and Special Surveillance Facilities (Inactive)	19 Tanks East Area 27 Tanks West Area	03/01 (AX 152)

Of the 129 tanks classified as Interim Stabilized, 65 are listed as Assumed Leakers. (See Table B-5)

<sup>b</sup> Two of these tanks are Assumed Leakers (BY 105 BY 106) (See Table B-5)

The TY tank farm was officially declared Controlled, Clean, and Stable (CCS) in March 1996. The TX tank farm and BX tank farms were declared CCS in September 1996.

**II WASTE TANK INVESTIGATIONS**

This section includes all single or double shell tanks or catch tanks which are showing surface level or interstitial liquid level (ILL) decreases or drywell radiation level increases in excess of established criteria.

**A Assumed Leakers or Assumed Re leakers (See Appendix D for definition of Re leaker')**

This section includes all single or double shell tanks or catch tanks for which an off normal or unusual occurrence report has been issued or for which a waste tank investigation is in progress for assumed leaks or re-leaks. Tanks/catch tanks will remain on this list until either a) completion of Interim Stabilization b) the updated occurrence report indicates that the tank/catch tank is not an assumed leaker or c) the investigation is completed.

**B Tanks with increases indicating possible intrusion**

This section includes all single shell tanks and related receiver tanks for which the surveillance data show that the surface level or ILL has met or exceeded the increase criteria, or are still being investigated

**Candidate Intrusion List** Surveillance data for following tanks indicate possible intrusions

Tank 241 B 202  
Tank 241-BX-101  
Tank 241 BX 103  
Tank 241 BY 103

The surveillance data were last reviewed on the tanks listed as having probable liquid intrusions Memo 74B20 99 045 dated November 22 1999 Documentation is being prepared which will remove some or all of the tanks from the Candidate Intrusion List expected completion of this documentation is November 30 2001

**III SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS**

**A Single-Shell Tanks Saltwell Jet Pumping (See Table B 1 footnotes for further information)**

**Tank 241 A 101** Pumping began May 6 2000 No pumping has occurred since August 2000 a total of 14 1 Kgallons has been pumped from this tank since the start of pumping in May 2000

**Tank 241 AX 101** Pumping began July 29 2000 No pumping between August 2000 and March 2001 pumping began again on March 22 2001 Pumping was shut down on April 3 2001 due to a transfer line failure A total of 21 7 Kgallons has been pumped since the start of pumping in July 2000

**Tank 241 BY-105** – Pumping began July 11 2001 During July a total of 8 8 Kgallons was pumped from this tank Pumping was halted in August 2001 due to transfer line leak detectors not meeting all operability requirements of the Technical Safety Requirements Compensatory actions have been established to allow resumption of pumping Additionally field work for Project W 314 Tank Farm Upgrades has taken the primary transfer route out of service Pumping will resume when the alternative route is established

**Tank 241 BY 106** – Pumping was restarted July 11 2001 Pumping originally started in August 1995 and was halted in October 1995 due to a USQ evaluation for flammable gas concerns A total of 70 0 Kgallons has been pumped from this tank since the start of pumping in August 1995 Pumping was halted in August 2001 due to transfer line leak detectors not meeting all operability requirements of the Technical Safety Requirements Compensatory actions have been established to allow resumption of pumping Additionally field work for Project W 314

Tank Farm Upgrades has taken the primary transfer route out of service. Pumping will resume when the alternative route is established.

Tank 241 S 102 Pumping problems forced many shutdowns. The pump was replaced and pumping resumed on February 19, 2000. Problems with the new pump forced a shutdown on March 23, 2000. Pumping was interrupted in early June 2000. Pumping was shut down due to equipment failure; the lower piping needs to be replaced. No pumping has occurred since June 2000. A total of 56.8 Kgallons has been pumped from this tank since the start of pumping in March 1999.

Tank 241 SX 101 Pumping began November 22, 2000. The pump failed on December 9, 2000, and pumping was shut down. Pumping resumed in September 2001 following replacement of the saltwell pump and lower piping. **During October 2001, a total of 9.4 Kgallons was pumped, a total of 31.8 Kgallons has been pumped from this tank since the start of pumping in November 2000.**

Tank 241 SX 103 Pumping began October 26, 2000. Pumping was shut down on April 22, 2001, due to leak detector and subsequent shielding problems in the pump pit. Pumping resumed on September 14, 2001. **During October 2001, a total of 3.0 Kgallons was pumped, a total of 122.8 Kgallons has been pumped from this tank since the start of pumping in October 2000.**

Tank 241 SX 105 Pumping began August 8, 2000. Pumping was shut down in late April 2001 when the saltwell screen in flow rate was measured at approximately 0.02 GPM. This tank is being evaluated to determine if it can be declared interim stabilized. A total of 152.6 Kgallons has been pumped since the start of pumping in August 2000.

Tank 241 U 102 Pumping began January 20, 2000. During September 2001, a total of 200 gallons was pumped. A total of 86.5 Kgallons has been pumped from this tank since the start of pumping in January 2000. This tank has been placed in observation mode to evaluate for interim stabilization.

Tank 241 U 107 – Pumping began September 29, 2001. **During October 2001, a total of 11.7 Kgallons was pumped, a total of 11.7 Kgallons has been pumped from this tank since the start of pumping in September 2001 (net decrease of zero gallons in September due to equipment/priming flushes)**

Tank 241 U 109 Pumping began March 11, 2000. The saltwell pump was replaced following its failure in December 2000, and pumping was restarted March 30, 2001. During September 2001, a total of 100 gallons was pumped. A total of 78.4 Kgallons has been pumped from this tank since the start of pumping in March 2000. This tank has been placed in observation mode to evaluate for interim stabilization.

**B**            **Changes to this Report**

**Table D 2 ENRAF SURFACE LEVEL GAUGE INSTALLATION AND DATA INPUT METHODS and Table D-3 TANK MONITOR AND CONTROL SYSTEM (TMACS) have been removed from this document. These tables are no longer pertinent, the information is available from the databases maintained by Task Surveillance and Data Acquisition**

**Table A-4 DOUBLE-SHELL TANKS MONITORING COMPLIANCE STATUS and Table B-6 SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS have been modified to reflect only those tanks which are Out of Compliance with the applicable regulatory documents. (There are none at the present time.) Out-of-service devices are no longer shown, the out-of-service device list was a select list which was incomplete, i e , the list did not show all the devices which were out of service**

**Future change Document HNF 2978, Rev 3, "Updated Pumpable Liquid Volume Estimates and Jet Pump Durations for Interim Stabilization of Remaining Single-Shell Tanks," is being prepared. This pertains to the 29 tanks covered by the Consent Decree. Volume information from this document will be included in this Report as soon as it is available.**

APPENDIX A  
DOUBLE SHELL TANKS  
MONTHLY SUMMARY TABLES

TABLE A 1 INVENTORY AND STATUS BY TANK DOUBLE-SHELL TANKS

October 31 2001

TANK	TANK INTEGRITY	TANK STATUS	EQUIVALENT WASTE INCHES	TOTAL WASTE (Kgall)	AVAIL SPACE (1) (Kgall)	WASTE VOLUMES			PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES
						SUPER NATANT LIQUID (Kgall)	SLUDGE (Kgall)	SALTCAKE (Kgall)	LAST IN TANK PHOTO	LAST IN TANK VIDEO	
<u>AN TANK FARM STATUS</u>											
AN 101	SOUND	DRCVR	91 6	252	868	252	0	0	06/30/99		
AN 102	SOUND	CWHT	393 5	1062	58	993	0	89	06/30/99		
AN 103	SOUND	CWHT	348 7	959	181	500	0	459	06/30/99	10/29/87	
AN 104	SOUND	CWHT	382 9	1053	87	608	0	445	06/30/99	08/19/88	
AN 105	SOUND	CWHT	409 8	1127	13	635	0	492	06/30/99	01/26/88	
AN 106	SOUND	CWHT	13 8	38	1102	21	0	17	06/30/99		
AN 107	SOUND	CWHT	378 2	1040	100	793	0	247	06/30/99	09/01/88	
7 DOUBLE SHELL TANKS TOTALS						5551	2429	3802	0	1749	
<u>AP TANK FARM STATUS</u>											
AP-101	SOUND	DRCVR	405 1	1114	26	1114	0	0	05/01/89		
AP-102	SOUND	DRCVR	396 0	1069	51	1069	0	0	07/11/89		
AP-103	SOUND	DRCVR	102 5	262	858	282	0	0	05/31/96		
AP-104	SOUND	DRCVR	402 9	1108	32	1108	0	0	10/13/88		
AP 105	SOUND	CWHT	412 4	1134	6	1045	0	89	06/30/99		09/27/86
AP 106	SOUND	DRCVR	225 8	621	519	621	0	0	10/13/88		
AP 107	SOUND	DRCVR	355 3	977	163	977	0	0	10/13/88		
AP 108	SOUND	DRCVR	97 5	268	872	268	0	0	10/13/88		
8 DOUBLE SHELL TANKS TOTALS						6593	2527	6504	0	89	
<u>AW TANK FARM STATUS</u>											
AW 101	SOUND	CWHT	410 2	1128	12	740	0	388	10/31/00	03/17/88	
AW 102	SOUND	EVFD	33 8	93	1047	63	30	0	01/31/01	02/02/83	
AW 103	SOUND	DRCVR	400 7	1102	38	789	273	40	06/30/99		
AW 104	SOUND	DRCVR	114 5	315	625	92	66	157	06/30/99	02/02/83	
AW 105	SOUND	DRCVR	154 9	426	714	171	255	0	06/30/99		
AW 106	SOUND	SRCVR	107 6	296	844	57	0	239	06/30/99	02/02/83	
6 DOUBLE SHELL TANKS TOTALS						3360	3480	1912	624	624	

TABLE A 1 INVENTORY AND STATUS BY TANK - DOUBLE SHELL TANKS

October 31 2001

TANK	INTEGRITY	TANK STATUS	EQUIVALENT WASTE INCHES	TOTAL WASTE (Kgall)	AVAIL SPACE (1)	WASTE VOLUMES			PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES
						SUPER-NATANT LIQUID (Kgall)	SLUDGE (Kgall)	SALTCAKE (Kgall)	SOLIDS VOLUME UPDATE	LAST IN TANK PHOTO	
<u>AY TANK FARM STATUS</u>											
AY 101	SOUND	DRCVR	65 5	180	800	84	96	0	06/30/99	12/28/82	
AY 102	SOUND	DRCVR	225 8	621	359	437	184	0	10/31/00	04/28/81	
2 DOUBLE SHELL TANKS TOTALS						801	1159	0			
<u>AZ TANK FARM STATUS</u>											
AZ 101	SOUND	CWHT	350 2	963	17	911	52	0	06/30/98	08/18/83	
AZ 102	SOUND	DRCVR	362 5	897	0	892	105	0	06/30/99	10/24/84	
2 DOUBLE SHELL TANKS TOTALS						1960	157	0			
<u>SY TANK FARM STATUS</u>											
SY 101	SOUND	CWHT	352 4	969	171	694	0	275	06/30/98	04/12/88	
SY 102	SOUND	DRCVR	370 9	1020	120	949	71	0	06/30/99	04/29/81	
SY 103	SOUND	CWHT	268 7	739	401	397	0	342	06/30/99	10/01/86	
3 DOUBLE SHELL TANKS TOTALS						2728	692	617			
GRAND TOTAL						20993	10298	16582	1132	3279	

Note +/- 1 Kgal differences are the result of computer rounding

Available Space Calculations Used in this Document		
Tank Farm		
(Most Conservative)		
AN AP AW SY	1 140 Kgal	(414 5 in
AY AZ (Aging Waste)	980 Kgal	(356 4 in

NOTE Supernatant + Sludge (includ liquid) + Saltcake (include liquid) = Total Was

(1) Available Space volume include restricted space

**TABLE A 2 SUMMARY OF WASTE TRANSACTIONS IN THE DOUBLE SHELL TANK (DST) SYSTEM**

October 31 2001

All volumes in Kilo-Gallons (Kgals)

The DST system received waste additions from SST pumping Tank 151AZ and miscellaneous water in October  
 There was a net change of +69 000 gallons in the DST system for October  
 The total DST inventory as of October 31 2001 was 20 993 million gallons  
 There were 0 Kgals of Saltwell Liquid (SWL) pumped to the East Area DSTs (AN 101) in October  
 There were ~77 Kgals of SWL (23 Kgals SWL + 74 Kgals water) pumped to the West Area DSTs (SY 102) in October  
 The SWL numbers are preliminary and are subject to change once the System Engineers do a validation the volumes reported contain the actual waste volume plus any water added for dilution and transfer line flushes  
 Tank 103-SY experienced a spontaneous gas release (GRE) on October 23rd At that time the liquid level in the tank dropped from 270 2" to 268 7" As supplied by System Engineers this GRE had an adjusted maximum hydrogen concentration of 1900 ppm and released ~167 cu ft. of retained gas  
 Previously individual raw water addition >= 250 gallons were reported from now on all raw water additions will be tracked and if a storage tank receives an accumulative monthly total of raw water >= 250 gallons that volume will be reported

OCTOBER 2001 DST WASTE RECEIPTS					
FACILITY GENERATIONS		OTHER GAINS ASSOCIATED WITH		OTHER LOSSES ASSOCIATED WITH	
SWL (West)	+77 Kgal (2SY)	SLURRY	+2 Kgal	SLURRY	-8 Kgal
TOTAL =	+77 Kgal	CONDENSATE	+8 Kgal	CONDENSATE	-5 Kgal
		INSTRUMENTATION	+0 Kgal	INSTRUMENTATION	-0 Kgal
		UNKNOWN	+2 Kgal	UNKNOWN	-9 Kgal
		TOTAL =	+12 Kgal	TOTAL =	20 Kgal

PROJECTED VERSUS ACTUAL WASTE VOLUMES						
	ACTUAL DST WASTE RECEIPTS	PROJECTED DST WASTE RECEIPTS (1)	MISC DST CHANGES (+/-)	PROJECTED WVR (1)	NET DST CHANGE	TOTAL DST VOLUME
OCT 01	77	114	-8	0	69	20993
NOV 01	0	388	0	0	0	0
DEC 01	0	647	0	0	0	0
JAN 02	0	544	0	0	0	0
FEB 02	0	528	0	0	0	0
MAR 02	0	151	0	-547	0	0
APR 02	0	316	0	0	0	0
MAY 02	0	185	0	0	0	0
JUN 02	0	160	0	0	0	0
JUL 02	0	-678	0	-823	0	0
AUG 02	0	168	0	0	0	0
SEP 02	0	109	0	0	0	0

(1) The PROJECTED DST WASTE RECEIPTS and "WVR" numbers were updated in October 2001 the projected volumes will be updated as new and/or more accurate information is obtained The projected volumes are the most current available as supplied by cognizant System Engineers

242 A Evaporator Waste Volume Reduction	
Campaign 94-1 (04/15/94 08/13/94)	2417
Campaign 94-2 (09/22/94 11/18/94)	2787
Campaign 95-1 (06/06/95 07/26/95)	2161
Campaign 96-1 (05/07/96 05/25/96)	1117
Campaign 97 1 (03/24/97 04/02/97)	-351
Campaign 97 2 (09/16/97 09/30/97)	-653
Campaign 99-1 (07/24/99 08/15/99)	-818
Campaign 00-1 (04/20/00 05/05/00)	-682
Campaign 01 1 (03/13/01 03/27/01)	-682
Total waste reduction (WVR) since restart on 4/15/94	11668

TABLE A 3 DOUBLE SHELL TANK SPACE USAGE AND INVENTORY BY WASTE TANK

October 31 2001

TOTAL AVAILABLE DST SPACE	
NON-AGING	27380
AGING =	3020
<b>TOTAL =</b>	<b>31280</b>

MONTHLY INVENTORY CHANGE		
INVENTORY	9/30/01	20924
INVENTORY	10/31/01	20993
<b>CHANGE =</b>		<b>69</b>

**Tank Space Usage**

TANK SPACE CHANGE	
09/30/01 TANK SPACE	10373
10/31/01 TANK SPACE	10304
<b>CHANGE =</b>	<b>-69</b>

OPERATIONAL SPACE	
AN-101 =	888
AP-106	872
AW 102	1047
AW 106	714
AW 106 =	844
SY 102	120
<b>TOTAL =</b>	<b>4485</b>

RESTRICTED SPACE	
AN-102 =	58
AN-103 =	181
AN-104 =	87
AN-105	13
AN-107	100
AP 102 =	51
AW 101 =	12
AZ 101 =	17
AZ 102	0
SY 101 =	171
SY 103 =	401
<b>TOTAL =</b>	<b>1091</b>

NON ALLOCATED SPACE	
AN 108 =	1102
AP-101 =	26
AP 103	858
AP 104	32
AP 105 =	6
AP 106 =	519
AP-107 =	163
AW 103 =	38
AW 104	825
AY 101 =	800
AY 102b=	359
<b>TOTAL =</b>	<b>4728</b>
EMERGENCY SPACE	1140
LAW or HLW RETURN	1140
<b>REMAINING SPACE</b>	<b>2448</b>

**Inventory Calculation by Waste Type**

DILUTE SUPERNATE (DN)	
AN-101	252
AP-106 =	268
AW 102 =	63
AW 104 =	92
AW 105 =	171
AY 102	437
<b>TOTAL DN =</b>	<b>1263</b>
<b>TOTAL SOLIDS =</b>	<b>692</b>

SLURRY SUPERNATE (DSS/DSSF)	
AN-103 =	500
AN-104 =	608
AN-105 =	635
AP 101	1114
AP 106 =	1046
AW 101	740
AW 103 =	789
AW 106 =	57
<b>TOTAL DSS/DSSF=</b>	<b>5488</b>
<b>TOTAL SOLIDS =</b>	<b>2425</b>

PHOSPHATE SUPERNATE (CP)	
<b>TOTAL CP (AP 102)=</b>	<b>1089</b>

COMPLEXED SUPERNATE (DCCC)	
AN-102 =	993
AN-106	21
AN-107 =	793
AP 103 =	282
AP-104	1108
AP-106	621
AP 107 =	977
AY 101 =	84
SY 101 =	694
SY 102	949
SY 103 =	397
<b>TOTAL DC/CC =</b>	<b>6919</b>
<b>TOTAL SOLIDS =</b>	<b>1137</b>

AGING SUPERNATE (AW)	
AZ 101 =	911
AZ 102 =	892
<b>TOTAL AW =</b>	<b>1803</b>
<b>TOTAL SOLIDS =</b>	<b>157</b>

GRAND TOTALS	
<b>DILUTE SUPERNATE (DN/DC) =</b>	<b>3830</b>
<b>SLURRY (DSS/DSSF) =</b>	<b>5488</b>
<b>CONCENTRATED COMPLEXED (CC) =</b>	<b>4372</b>
<b>CONCENTRATED PHOSPHATE (CP) =</b>	<b>1089</b>
<b>AGING SUPERNATE (AW) =</b>	<b>1803</b>
<b>DST SOLIDS (SL/SC) =</b>	<b>4411</b>
<b>TOTAL =</b>	<b>20993</b>

**TABLE A-4 DOUBLE SHELL TANKS MONITORING COMPLIANCE STATUS**  
 October 31 2001

There were no Double Shell Tanks Out of Compliance (O/C) this month

<b>Legend</b>	
<b>O/C</b>	<b>Noncompliance with applicable documentation</b>
<b>FIC/ENRAF/MT</b>	<b>Surface level measurement devices</b>
<b>OSD</b>	<b>OSD T 151-0007 OSD T 151-00031</b>
<b>FSAR/TSR</b>	<b>Final Safety Analysis Report/Technical Safety Requirements</b>
<b>None</b>	<b>Applicable equipment not installed</b>
<b>N/A</b>	<b>Not Applicable (not monitored or no monitoring scheduled)</b>

**Notes**

Psychrometrics monitoring is on an as needed basis  
 In tank photos/videos are taken on an as needed basis  
 Drywell monitoring is no longer required

**APPENDIX B**  
**SINGLE SHELL TANKS**  
**MONTHLY SUMMARY TABLES**

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

October 31, 2001

These volumes are the result of engineering calculations and may not agree with surface level measurements.

See footnotes for information on tanks in process of Interim Stabilization

TANK NO.	TANK INTEGRITY	TANK STATUS	TOTAL WASTE (Kgal)	WASTE VOLUMES						PHOTOS/VIDEOS			SEE FOOTNOTES FOR THESE CHANGES		
				SUPER-NATANT LIQUID (Kgal)	DRAINABLE INTERSTITIAL LIQUID (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	PUMPABLE LIQUID REMAINING (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE		LAST IN-TANK PHOTO	LAST IN-TANK VIDEO
<b>A TANK FARM STATUS</b>													(a)		
A-101	SOUND	/PI	877	(a) 4	(a) 8	0.0	14.1	(a) 12	(a) 4	3	380	09/30/99		08/21/85	
A-102	SOUND	IS/IP	41	5	45	0.0	39.5	12	4	15	22	07/27/89		07/20/89	
A-103	ASMD LKR	IS/IP	371	0	4	0.0	111.0	50	43	366	0	06/03/88		12/28/88	
A-104	ASMD LKR	IS/IP	28	0	0	0.0	0.0	4	0	28	0	01/27/78		06/25/86	
A-105	ASMD LKR	IS/IP	37	0	0	0.0	0.0	0	0	37	0	10/31/00		08/20/86	
A-106	SOUND	IS/IP	125	0	9	0.0	0.0	9	1	125	0	09/07/82		08/19/86	
6 TANKS - TOTALS			1479							574	402				
<b>AX TANK FARM STATUS</b>													(b)		
AX-101	SOUND	/PI	662	(b) 0	(b) 7	0.0	21.7	(b) 7	(b) 0	3	295	09/30/99		08/18/87	
AX-102	ASMD LKR	IS/IP	30	0	23	0.0	13.0	23	11	7	23	06/30/99		06/05/89	
AX-103	SOUND	IS/IP	112	0	1	0.0	0.0	1	0	8	104	06/30/99		08/13/87	
AX-104	ASMD LKR	IS/IP	8	0	0	0.0	0.0	0	0	8	0	06/30/99		08/18/87	
4 TANKS - TOTALS			812							26	422				
<b>B TANK FARM STATUS</b>													(b)		
B-101	ASMD LKR	IS/IP	113	0	24	0.0	0.0	24	17	0	113	06/30/99		05/19/83	
B-102	SOUND	IS/IP	32	4	7	0.0	0.0	11	4	0	28	06/30/99		08/22/85	
B-103	ASMD LKR	IS/IP	59	0	11	0.0	0.0	11	3	0	59	06/30/99		10/13/88	
B-104	SOUND	IS/IP	371	1	45	0.0	0.0	46	42	309	61	06/30/99		10/13/88	
B-105	ASMD LKR	IS/IP	158	0	20	0.0	0.0	20	16	28	130	06/30/99		05/19/88	
B-106	SOUND	IS/IP	117	1	25	0.0	0.0	26	19	0	116	02/29/00		02/28/85	
B-107	ASMD LKR	IS/IP	165	1	22	0.0	0.0	23	19	93	71	06/30/99		02/28/85	
B-108	SOUND	IS/IP	94	0	15	0.0	0.0	15	11	53	41	06/30/99		05/10/85	
B-109	SOUND	IS/IP	127	0	21	0.0	0.0	21	17	63	64	06/30/99		04/02/85	
B-110	ASMD LKR	IS/IP	246	1	27	0.0	0.0	28	20	245	0	02/28/85		03/17/88	
B-111	ASMD LKR	IS/IP	237	1	23	0.0	0.0	24	29	236	0	06/28/85		06/26/85	
B-112	ASMD LKR	IS/IP	33	3	4	0.0	0.0	7	3	30	0	05/31/85		05/29/85	
B-201	ASMD LKR	IS/IP	29	1	4	0.0	0.0	5	1	28	0	04/28/82		11/12/86	06/23/95
B-202	SOUND	IS/IP	27	0	4	0.0	0.0	4	0	27	0	05/31/85		05/29/85	06/15/95
B-203	ASMD LKR	IS/IP	51	1	5	0.0	0.0	6	1	50	0	05/31/84		11/13/86	
B-204	ASMD LKR	IS/IP	50	1	5	0.0	0.0	6	1	49	0	05/31/84	10/22/87		
16 TANKS - TOTALS			1909							1211	683				

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

October 31, 2001

These volumes are the result of engineering calculations and may not agree with surface level measurements  
See footnotes for information on tanks in process of Interim Stabilization

TANK NO.	TANK INTEGRITY	TANK STATUS	WASTE VOLUMES										PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES	
			TOTAL WASTE (Kgal)	SUPER-NATANT LIQUID (Kgal)	DRAINABLE LIQUID INTERSTITIAL (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	PUMPABLE LIQUID REMAINING (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO		LAST IN-TANK VIDEO
<b>BX TANK FARM STATUS</b>																
BX-101	ASMD LKR	IS/IP/CCS	43	1	4	0.0	0.0	5	1	42	0	04/28/82	11/24/88	11/10/94		
BX-102	ASMD LKR	IS/IP/CCS	96	0	0	0.0	0.0	0	0	96	0	04/28/82	09/18/85			
BX-103	SOUND	IS/IP/CCS	71	9	4	0.0	0.0	13	9	62	0	11/29/83	10/31/86	10/27/94		
BX-104	SOUND	IS/IP/CCS	93	3	4	0.0	17.4	7	3	90	0	02/29/00	09/21/89			
BX-105	SOUND	IS/IP/CCS	51	5	4	0.0	15.0	9	5	46	0	06/30/99	10/23/86			
BX-106	SOUND	IS/IP/CCS	38	0	4	0.0	14.0	4	0	38	0	08/01/95	06/19/88	07/17/95		
BX-107	SOUND	IS/IP/CCS	345	1	36	0.0	23.1	37	33	344	0	09/18/90	09/11/90			
BX-108	ASMD LKR	IS/IP/CCS	26	0	4	0.0	0.0	4	0	26	0	07/31/79	05/05/94			
BX-109	SOUND	IS/IP/CCS	193	0	25	0.0	8.2	25	20	193	0	09/17/90	09/11/90			
BX-110	ASMD LKR	IS/IP/CCS	207	3	28	0.0	1.5	31	26	133	71	06/30/99	07/15/94	10/13/94		
BX-111	ASMD LKR	IS/IP/CCS	162	1	5	0.0	116.9	6	2	25	136	06/30/99	06/19/94	02/28/95		
BX-112	SOUND	IS/IP/CCS	165	1	9	0.0	4.1	10	7	164	0	09/17/90	09/11/90			
<b>12 TANKS - TOTALS</b>			<b>1490</b>							<b>1259</b>	<b>207</b>					
<b>BY TANK FARM STATUS</b>																
BY-101	SOUND	IS/IP	387	0	28	0.0	35.8	28	24	109	278	05/30/84	09/19/89			
BY-102	SOUND	IS/PI	277	0	40	0.0	159.0	40	33	0	277	05/01/95	09/11/87	04/11/95		
BY-103	ASMD LKR	IS/PI	400	0	58	0.0	95.9	58	53	9	391	06/30/99	09/07/89	02/24/97		
BY-104	SOUND	IS/IP	326	0	40	0.0	329.5	40	36	150	176	06/30/99	04/27/83			
BY-105	ASMD LKR	/PI	494	(c)	(c)	0.0	8.8	(c)	(c)	48	446	07/31/01	07/01/86			(c)
BY-106	ASMD LKR	/PI	556	(d)	(d)	0.0	70.0	(d)	(d)	84	472	07/31/01	11/04/82			(d)
BY-107	ASMD LKR	IS/IP	266	0	39	0.0	56.4	39	35	40	226	06/30/99	10/15/86			
BY-108	ASMD LKR	IS/IP	228	0	33	0.0	27.5	33	26	154	74	04/28/82	10/15/86			
BY-109	SOUND	IS/PI	290	0	31	0.0	157.1	31	26	57	233	07/08/87	06/18/97			
BY-110	SOUND	IS/IP	388	0	21	0.0	213.3	21	17	103	295	09/10/79	07/26/84			
BY-111	SOUND	IS/IP	459	0	14	0.0	313.2	14	6	0	459	06/30/99	10/31/86			
BY-112	SOUND	IS/IP	291	0	24	0.0	116.4	24	12	0	291	06/30/99	04/14/88			
<b>12 TANKS - TOTALS</b>			<b>4372</b>							<b>754</b>	<b>3618</b>					

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

October 31, 2001

These volumes are the result of engineering calculations and may not agree with surface level measurements  
See footnotes for information on tanks in process of interim Stabilization

TANK NO.	TANK INTEGRITY	TANK STATUS	WASTE VOLUMES										PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES		
			TOTAL WASTE (Kgal)	SUPER-NATANT LIQUID (Kgal)	DRAINABLE LIQUID INTERSTITIAL (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	PUMPABLE LIQUID REMAINING (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO			
<b>C. TANK FARM STATUS</b>																	
C-101	ASMD LKR	IS/IP	88	0	4	0.0	0.0	4	0	0	88	0	11/29/83	11/17/87			
C-102	SOUND	IS/IP	316	0	62	0.0	46.7	62	55	316	0	09/30/95	05/18/76	08/24/95			
C-103	SOUND	/PI	198	79	18	0.0	0.0	97	83	119	0	12/31/98	07/28/87				
C-104	SOUND	IS/IP	263	0	0	0.0	0.0	0	0	263	0	02/01/00	07/25/90				
C-105	SOUND	IS/PI	132	0	20	0.0	0.0	20	0	132	0	02/29/00	08/05/94	08/30/95			
C-106	SOUND	/PI	48	42	0	0.0	0.0	42	9	6	0	10/31/99	08/05/94	08/08/94			
C-107	SOUND	IS/IP	257	0	30	0.0	40.8	30	25	257	0	06/30/99	00/00/00				
C-108	SOUND	IS/IP	66	0	4	0.0	0.0	4	0	66	0	02/24/84	12/05/74	11/17/94			
C-109	SOUND	IS/IP	66	4	4	0.0	0.0	8	4	62	0	11/29/83	01/30/76				
C-110	ASMD LKR	IS/IP	178	1	37	0.0	15.5	38	30	177	0	06/14/95	08/12/86	06/23/95			
C-111	ASMD LKR	IS/IP	57	0	4	0.0	0.0	4	0	57	0	04/28/82	02/25/70	02/02/95			
C-112	SOUND	IS/IP	104	0	6	0.0	0.0	6	1	104	0	09/18/90	09/18/90				
C-201	ASMD LKR	IS/IP	2	0	0	0.0	0.0	0	0	2	0	03/31/82	12/02/86				
C-202	ASMD LKR	IS/IP	1	0	0	0.0	0.0	0	0	1	0	01/19/79	12/09/86				
C-203	ASMD LKR	IS/IP	5	0	0	0.0	0.0	0	0	5	0	04/28/82	12/09/86				
C-204	ASMD LKR	IS/IP	3	0	0	0.0	0.0	0	0	3	0	04/28/82	12/09/86				
16 TANKS - TOTALS			1784							1658	0						
<b>S. TANK FARM STATUS</b>																	
S-101	SOUND	/PI	427	12	83	0.0	0.0	95	80	211	204	12/31/98	03/18/88				(e)
S-102	SOUND	/PI	492	(e)	45	0.0	56.8	(e)	39	105	387	05/31/00	03/18/88				
S-103	SOUND	IS/PI	237	1	34	0.0	23.9	46	31	9	227	04/30/00	06/01/89	01/28/00			
S-104	ASMD LKR	IS/IP	294	1	42	0.0	0.0	35	33	293	0	12/20/84	12/12/84				
S-105	SOUND	IS/IP	456	0	26	0.0	114.3	42	33	2	454	09/26/88	04/12/89				
S-106	SOUND	IS/PI	455	0	61	0.0	203.6	26	2	0	455	02/28/01	03/17/89	01/28/00			
S-107	SOUND	/PI	376	14	0	0.0	0.0	75	61	293	69	06/30/99	03/12/87				
S-108	SOUND	IS/PI	432	0	16	0.0	199.8	0	0	5	427	10/01/99	03/12/87	12/03/96			
S-109	SOUND	IS/PI	533	0	30	0.0	34.0	16	12	13	520	06/30/01	12/31/88				
S-110	SOUND	IS/PI	390	0	82	0.0	203.1	30	27	131	259	05/14/92	03/12/87	12/11/96			
S-111	SOUND	/PI	501	48	81	0.0	3.3	130	97	116	337	09/30/99	08/10/89				
S-112	SOUND	/PI	523	0	81	0.0	125.1	81	70	6	517	12/31/98	03/24/87				
12 TANKS - TOTALS			5116							1184	3856						

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

October 31, 2001

These volumes are the result of engineering calculations and may not agree with surface level measurements

See footnotes for information on tanks in process of Interim Stabilization

TANK NO.	TANK INTEGRITY	TANK STATUS	WASTE VOLUMES										PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES	
			TOTAL WASTE (Kgal)	SUPER-NATANT LIQUID (Kgal)	DRAINABLE LIQUID (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	PUMPABLE LIQUID REMAINING (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO		
<b>SX TANK FARM STATUS</b>																
SX-101	SOUND	/PI	426	(f)	(f)	0.0	22.5	(f)	0	426	0	0	09/30/01	03/10/89		(f)
SX-102	SOUND	/PI	514	134	(g)	95	0.0	0.0	229	216	0	380	04/30/00	01/07/88		(g)
SX-103	SOUND	/PI	511	(g)	(g)	48	0.0	122.8	(g)	44	109	402	09/30/01	12/17/87		(h)
SX-104	ASMD LKR	IS/PI	446	0	(h)	37	0.0	152.6	(h)	31	136	310	04/30/00	09/08/88	02/04/98	
SX-105	SOUND	/PI	484	(h)	(h)	37	0.0	147.5	(h)	0	65	419	04/30/01	06/15/88		(h)
SX-106	SOUND	IS/PI	397	0	(h)	37	0.0	147.5	(h)	0	0	397	05/31/99	06/01/89		
SX-107	ASMD LKR	IS/IP	102	0	(h)	37	0.0	147.5	(h)	0	85	17	10/31/00	03/06/87		
SX-108	ASMD LKR	IS/IP	87	0	(h)	37	0.0	147.5	(h)	0	87	0	12/31/93	03/06/87		
SX-109	ASMD LKR	IS/IP	249	0	(h)	37	0.0	147.5	(h)	0	60	189	10/31/00	05/21/86		
SX-110	ASMD LKR	IS/IP	62	0	(h)	37	0.0	147.5	(h)	0	62	0	10/06/76	02/20/87		
SX-111	ASMD LKR	IS/IP	122	0	(h)	37	0.0	147.5	(h)	8	122	0	06/30/99	06/09/94		
SX-112	ASMD LKR	IS/IP	108	0	(h)	37	0.0	147.5	(h)	6	108	0	06/30/99	03/10/87		
SX-113	ASMD LKR	IS/IP	31	0	(h)	37	0.0	147.5	(h)	0	31	0	06/30/99	03/18/88		
SX-114	ASMD LKR	IS/IP	165	0	(h)	37	0.0	147.5	(h)	0	44	121	10/31/00	02/26/87		
SX-115	ASMD LKR	IS/IP	12	0	(h)	37	0.0	147.5	(h)	0	12	0	04/28/82	03/31/88		
<b>15 TANKS - TOTALS:</b>			<b>3716</b>								<b>921</b>	<b>2661</b>				
<b>T TANK FARM STATUS</b>																
T-101	ASMD LKR	IS/PI	102	1	(f)	20	0.0	25.3	(f)	21	16	64	06/30/99	04/07/93		
T-102	SOUND	IS/IP	32	13	(g)	3	0.0	0.0	16	11	19	0	06/31/84	06/28/89		
T-103	ASMD LKR	IS/IP	27	4	(g)	3	0.0	0.0	7	3	23	0	11/29/83	07/03/84		
T-104	SOUND	IS/PI	317	0	(h)	31	0.0	149.5	(h)	31	27	317	12/31/99	06/29/89	10/07/99	
T-105	SOUND	IS/IP	98	0	(h)	5	0.0	0.0	5	0	98	0	05/29/87	05/14/87		
T-106	ASMD LKR	IS/IP	21	2	(h)	0	0.0	0.0	2	2	19	0	04/28/82	06/29/89		
T-107	ASMD LKR	IS/PI	173	0	(h)	34	0.0	11.0	34	20	173	0	05/31/96	07/12/84	05/09/96	
T-108	ASMD LKR	IS/IP	44	0	(h)	5	0.0	0.0	5	0	21	23	06/30/99	07/17/84		

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

October 31, 2001

These volumes are the result of engineering calculations and may not agree with surface level measurements

See footnotes for information on tanks in process of Interim Stabilization

TANK NO.	TANK INTEGRITY	TANK STATUS	TOTAL WASTE (Kgal)	WASTE VOLUMES						PHOTOS/VIDES			SEE FOOTNOTES FOR THESE CHANGES			
				SUPER-NATANT LIQUID (Kgal)	DRAINABLE LIQUID (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	PUMPABLE LIQUID REMAINING (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE		LAST IN-TANK PHOTO	LAST IN-TANK VIDEO	
T-109	ASMD LKR	IS/IP	58	0	10	0.0	0.0	10	3	0	58	06/30/99	02/25/93			
T-110	SOUND	IS/PI	369	1	48	0.0	50.3	48	43	368	0	01/31/00	07/12/84	10/07/99		
T-111	ASMD LKR	IS/PI	446	0	38	0.0	9.6	38	35	446	0	04/18/94	04/13/94	02/13/95		
T-112	SOUND	IS/IP	67	7	4	0.0	0.0	11	7	60	0	04/28/82	08/01/84			
T-201	SOUND	IS/IP	29	1	4	0.0	0.0	5	1	28	0	05/31/78	04/15/86			
T-202	SOUND	IS/IP	21	0	3	0.0	0.0	3	0	21	0	07/12/81	07/06/89			
T-203	SOUND	IS/IP	35	0	5	0.0	0.0	5	0	35	0	01/31/78	08/03/89			
T-204	SOUND	IS/IP	38	0	5	0.0	0.0	5	0	38	0	07/23/81	08/03/89			
16 TANKS - TOTALS			1877							1703	145					
<b>IX TANK FARM STATUS</b>																
TX-101	SOUND	IS/IP/CCS	87	3	8	0.0	0.0	11	7	74	10	06/30/99	10/24/85			
TX-102	SOUND	IS/IP/CCS	217	0	27	0.0	94.4	27	16	0	217	08/31/84	10/31/85			
TX-103	SOUND	IS/IP/CCS	157	0	18	0.0	68.3	18	11	0	157	06/30/99	10/31/85			
TX-104	SOUND	IS/IP/CCS	65	5	9	0.0	3.6	14	9	23	37	06/30/99	10/16/84			
TX-105	ASMD LKR	IS/IP/CCS	609	0	25	0.0	121.5	25	14	0	609	08/22/77	10/24/89			
TX-106	SOUND	IS/IP/CCS	341	0	37	0.0	134.6	37	30	0	341	06/30/99	10/31/85			
TX-107	ASMD LKR	IS/IP/CCS	36	1	6	0.0	0.0	7	1	8	27	06/30/99	10/31/85			
TX-108	SOUND	IS/IP/CCS	134	0	8	0.0	13.7	8	1	6	128	06/30/99	09/12/89			
TX-109	SOUND	IS/IP/CCS	384	0	6	0.0	72.3	6	2	384	0	06/30/99	10/24/89			
TX-110	ASMD LKR	IS/IP/CCS	462	0	14	0.0	115.1	14	10	37	425	06/30/99	10/24/89			
TX-111	SOUND	IS/IP/CCS	370	0	10	0.0	98.4	10	6	43	327	06/30/99	09/12/89			
TX-112	SOUND	IS/IP/CCS	649	0	26	0.0	94.0	26	21	0	649	05/30/83	11/19/87			
TX-113	ASMD LKR	IS/IP/CCS	653	0	30	0.0	19.2	30	0	0	653	10/31/00	04/11/83	09/23/94		
TX-114	ASMD LKR	IS/IP/CCS	535	0	17	0.0	104.3	17	11	4	531	06/30/99	04/11/83	02/17/85		
TX-115	ASMD LKR	IS/IP/CCS	568	0	25	0.0	99.1	25	15	0	568	06/30/99	06/15/88			
TX-116	ASMD LKR	IS/IP/CCS	631	0	21	0.0	23.8	21	17	68	563	06/30/99	10/17/89			
TX-117	ASMD LKR	IS/IP/CCS	626	0	10	0.0	54.3	10	5	29	597	06/30/99	04/11/83			
TX-118	SOUND	IS/IP/CCS	286	0	0	0.0	89.1	0	0	21	265	02/01/00	12/19/79			
18 TANKS - TOTALS			6810							697	6104					

TABLE B-1. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

October 31, 2001

These volumes are the result of engineering calculations and may not agree with surface level measurements

See footnotes for information on tanks in process of Inertim Stabilization

TANK NO.	TANK INTEGRITY	TANK STATUS	WASTE VOLUMES										PHOTOS/VIDEOS			SEE FOOTNOTES FOR THESE CHANGES
			TOTAL WASTE (Kgal)	SUPER-NATANT LIQUID (Kgal)	DRAINABLE INTERSTITIAL LIQUID (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAINABLE LIQUID REMAINING (Kgal)	PUMPABLE LIQUID REMAINING (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO		
<u>TY TANK FARM STATUS</u>																
TY-101	ASMD LKR	IS/IP/CCS	118	0	2	0.0	8.2	2	0	72	46	06/30/89	08/22/89			
TY-102	SOUND	IS/IP/CCS	64	0	12	0.0	6.6	12	5	0	64	06/28/82	07/07/87			
TY-103	ASMD LKR	IS/IP/CCS	162	0	20	0.0	11.5	20	16	162	0	07/09/82	08/22/89			
TY-104	ASMD LKR	IS/IP/CCS	43	0	4	0.0	0.0	4	0	43	0	06/27/90	11/03/87			
TY-105	ASMD LKR	IS/IP/CCS	231	0	12	0.0	3.6	12	10	231	0	04/28/82	09/07/89			
TY-106	ASMD LKR	IS/IP/CCS	21	0	3	0.0	0.0	3	0	21	0	06/30/89	08/22/89			
6 TANKS - TOTALS			639							529	110					
<u>U TANK FARM STATUS</u>																
U-101	ASMD LKR	IS/IP	25	3	3	0.0	0.0	6	2	22	0	04/28/82	06/19/79			(i)
U-102	SOUND	/PI	289	(i)		0.0	86.3	(i)	(i)	43	246	08/31/01	06/08/89			
U-103	SOUND	IS/PI	418	1	33	0.0	98.9	34	28	13	404	05/31/00	09/13/88			
U-104	ASMD LKR	IS/IP	122	0	0	0.0	0.0	0	0	79	43	06/30/89	08/10/89			
U-105	SOUND	IS/PI	353	0	44	0.0	87.5	44	32	32	321	03/31/01	07/07/88			
U-106	SOUND	IS/PI	172	2	36	0.0	39.1	38	30	0	170	03/31/01	07/07/88			(j)
U-107	SOUND	/PI	397	(j)		11.7	11.7	(j)	(j)	15	349	10/31/01	10/27/88			
U-108	SOUND	/PI	468	24	108	0.0	0.0	132	124	29	415	12/31/98	09/12/84			(k)
U-109	SOUND	/PI	387	(k)		0.1	78.4	(k)	(k)	35	352	08/31/01	07/07/88			
U-110	ASMD LKR	IS/PI	186	0	18	0.0	0.0	18	14	186	0	12/30/84	12/11/84			
U-111	SOUND	/PI	329	0	80	0.0	0.0	80	71	26	303	12/31/98	06/23/88			
U-112	ASMD LKR	IS/IP	49	4	4	0.0	0.0	8	4	45	0	02/10/84	08/03/89			
U-201	SOUND	IS/IP	5	1	1	0.0	0.0	2	1	4	0	08/15/79	08/08/89			
U-202	SOUND	IS/IP	5	1	1	0.0	0.0	2	1	4	0	08/15/79	08/08/89			
U-203	SOUND	IS/IP	3	1	0	0.0	0.0	1	1	2	0	08/15/79	06/13/89			
U-204	SOUND	IS/IP	3	1	0	0.0	0.0	1	1	2	0	08/15/79	06/13/89			
16 TANKS - TOTALS			3211							537	2603					
GRAND TOTAL			33215							11053	20811					

TABLE B 1 INVENTORY AND STATUS BY TANK – SINGLE SHELL TANKS

October 31 2001

FOOTNOTES

Total Waste is calculated as the sum of Sludge and Saltcake plus Supernatant The category Interim Isolated (II) was changed to Intrusion Prevention (IP) in June 1993 Stabilization information is from WHC SD RE TI 178 SST Stabilization Record latest revision, or from SST Stabilization or the System Engineer

Porosity values are 25% for saltcake and 15% for sludge per HNF 2978 Rev 1 Updated Pumpable Liquid Volume Estimates and Jet Pump Durations for Interim Stabilization of Remaining Single-Shell Tanks September 1999 with the exception of those tanks which have been interim stabilized and the porosities recalculated

(a) A 101 Initial estimated Pumpable Liquid volume 588.5 Kgal

Pumping began on May 6 2000 No pumping since August 2000 It is expected pumping will resume in November 2001

Final volumes will be determined at completion of Interim Stabilization.

(b) AX 101 Initial estimated Pumpable Liquid volume 444.0 Kgal

Pumping began July 29 2000 shut down in August 2000 and resumed March 22 2001 Pumping shut down April 3 2001 due to transfer line failure No pumping since April 2001 It is expected pumping will resume in November 2001

Final volumes will be determined at completion of Interim Stabilization.

(c) BY 105 Initial estimated Pumpable Liquid volume 109.9 Kgal

Pumping began July 11 2001 Remaining volumes are based on HNF 2978 Rev 2 Saltcake volume adjusted to correspond to current waste removal No pumping since July 2001

Pumping was shut down in August 2001 due to transfer line leak detectors not meeting all operability requirements of the Technical Safety Requirements (TSR) Compensatory actions were established to allow resumption of pumping Additionally field work for Project W 314 "Tank Farm Upgrades" has taken the primary transfer route out of service Pumping will resume when the alternative route is established

Final volumes will be determined at completion of Interim Stabilization

(d) BY 106 Initial estimated Pumpable Liquid volume 182.7 Kgal

Pumping was originally started August 10 1995 and shut down October 17 1995 due to an Unreviewed Safety Question (USQ) for flammable gas concerns Total pumped by October 1995 was 63.7 Kgal

Pumping was restarted July 11 2001 Pumping was shut down in August 2001 due to transfer line leak detectors not meeting all operability requirements of the TSR. Compensatory actions were established to allow resumption of pumping Additionally field work for Project W 314 "Tank Farm Upgrades" has taken the primary transfer route out of service Pumping will resume when the alternative route is established

Final volumes will be determined at completion of Interim Stabilization

(e) S 102 Initial estimated Pumpable Liquid volume 145.8 Kgal

Pumping commenced March 18 1999. Many pumping problems occurred over the following months and the pump was replaced several times. Pumping was interrupted again in June 2000. No pumping since June 2000.

Final volumes will be determined at completion of Interim Stabilization.

(f) SX 101 Initial estimated Pumpable Liquid volume 99.0 Kgal

Pumping began November 22 2000. No pumping since December 2000 due to pump failure. Pumping resumed in September 2001 following replacement of the saltwell pump and lower piping.

Final volumes will be determined at completion of Interim Stabilization.

(g) SX 103 Initial estimated Pumpable Liquid volume 132.0 Kgal

Pumping began October 26 2000. Pumping was shut down April 22 2001 due to leak detector and subsequent shielding problems in the pump pit. Pumping resumed September 14 2001.

Final volumes will be determined at completion of Interim Stabilization.

(h) SX 105 Initial estimated Pumpable Liquid volume 141.0 Kgal (PLR shows minus 11.6 Kgal due to there being more pumpable liquid [supernatant] than originally estimated)

Saltwell pumping began August 8 2000. Pumping was shut down in late April 2001 when the saltwell screen in flow rate was measured at about 0.02 gpm. Interstitial fluid level is now being allowed to stabilize to determine if the tank can be declared interim stabilized. An in-tank video will be taken.

Final volumes will be determined at completion of Interim Stabilization.

(i) U 102 Initial estimated Pumpable Liquid volume 93.0 Kgal

Pumping began in this tank on January 20 2000. This tank has been placed in observation mode for evaluation to determine if it meets the interim stabilization criteria.

Final volumes will be determined at completion of Interim Stabilization.

(j) U 107 Initial estimated Pumpable Liquid volume 115.0 Kgal

Pumping began September 29 2001.

Final volumes will be determined at completion of Interim Stabilization.

(k) U 109 Initial estimated Pumpable Liquid volume 119.4 Kgal

Pumping began March 11 2000. Pumping was shut down on December 3 2000 due to jet pump failure. Attempts to restart the pump were unsuccessful. The pump was replaced and restarted March 30 2001. This tank has been placed in observation mode for evaluation to determine if it meets the interim stabilization criteria.

Final volume determined at completion of Interim Stabilization.

TABLE B-2. SINGLE-SHELL TANKS STABILIZATION STATUS SUMMARY  
October 31, 2001

Partial Interim Isolated (PI)	Intrusion Prevention Completed (IP)		Interim Stabilized (IS)	
	EAST AREA	WEST AREA	EAST AREA	WEST AREA
A-101	A-103	S-104	A-102	S-103
A-102	A-104	S-105	A-103	S-104
	A-105		A-104	S-105
AX-101	A-106	SX-107	A-105	S-106
		SX-108	A-106	S-108
BY-102	AX-102	SX-109		S-109
BY-103	AX-103	SX-110	AX-102	S-110
BY-105	AX-104	SX-111	AX-103	
BY-106		SX-112	AX-104	SX-104
BY-109	B-FARM - 16 tanks	SX-113		SX-106
	BX-FARM - 12 tanks	SX-114	B-FARM - 16 tanks	SX-107
C-103		SX-115	BX-FARM - 12 tanks	SX-108
C-105	BY-101			SX-109
C-106	BY-104	T-102	BY-101	SX-110
East Area	BY-107	T-103	BY-102	SX-111
	BY-108	T-105	BY-103	SX-112
WEST AREA	BY-110	T-106	BY-104	SX-113
S-101	BY-111	T-108	BY-107	SX-114
S-102	BY-112	T-109	BY-108	SX-115
S-103		T-112	BY-109	
S-106	C-101	T-201	BY-110	T-Farm - 16 tanks
S-107	C-102	T-202	BY-111	TX-Farm - 18 tanks
S-108	C-104	T-203	BY-112	TY-Farm - 6 tanks
S-109	C-107	T-204		
S-110	C-108		C-101	U-101
S-111	C-109	TX-FARM - 18 tanks	C-102	U-103
S-112	C-110	TY-FARM - 6 tanks	C-104	U-104
	C-111		C-105	U-105
SX-101	C-112	U-101	C-107	U-106
SX-102	C-201	U-104	C-108	U-110
SX-103	C-202	U-112	C-109	U-112
SX-104	C-203	U-201	C-110	U-201
SX-105	C-204	U-202	C-111	U-202
SX-106	East Area	U-203	C-112	U-203
		U-204	C-201	U-204
T-101		West Area	C-202	West Area
T-104		53	C-203	69
T-107		Total	C-204	Total
T-110		106		129
T-111			East Area	60
U-102	Controlled, Clean, and Stable (CCS)			
U-103				
U-105	EAST AREA	WEST AREA		
U-106	BX-FARM - 12 Tanks	TX-FARM - 18 tanks		
U-107		TY FARM - 6 tanks		
U-108	East Area	West Area		
U-109	12	24		
U-110		Total		
U-111		36		
West Area				
29				
Total				
40				

Note: CCS activities have been deferred until funding is available.

TABLE B-3. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS

October 31, 2001

Tank Number	Tank Integrity	Interim Stabil. Date (1)	Stabil. Method	Tank Number	Tank Integrity	Interim Stabil. Date (1)	Stabil. Method	Tank Number	Tank Integrity	Interim Stabil. Date (1)	Stabil. Method
A-101	SOUND	N/A		C-101	ASMD LKR	11/83	AR	T-108	ASMD LKR	11/78	AR
A-102	SOUND	08/89	SN	C-102	SOUND	09/95	JET	T-109	ASMD LKR	12/84	AR
A-103	ASMD LKR	06/88	AR	C-103	SOUND	N/A		T-110	SOUND	01/00 (5)	JET
A-104	ASMD LKR	09/78	AR	C-104	SOUND	09/89	SN	T-111	ASMD LKR	02/95	JET
A-105	ASMD LKR	07/79	AR	C-105	SOUND	10/95	AR	T-112	SOUND	03/81	AR(2)(3)
A-106	SOUND	08/82	AR	C-106	SOUND	N/A		T-201	SOUND	04/81	AR (3)
AX-101	SOUND	N/A		C-107	SOUND	09/95	JET	T-202	SOUND	08/81	AR
AX-102	ASMD LKR	09/88	SN	C-108	SOUND	03/84	AR	T-203	SOUND	04/81	AR
AX-103	SOUND	08/87	AR	C-109	SOUND	11/83	AR	T-204	SOUND	08/81	AR
AX-104	ASMD LKR	08/81	AR	C-110	ASMD LKR	05/95	JET	TX-101	SOUND	02/84	AR
B-101	ASMD IKR	03/81	SN	C-111	ASMD LKR	03/84	SN	TX-102	SOUND	04/83	JET
B-102	SOUND	08/85	SN	C-112	SOUND	09/80	AR	TX-103	SOUND	08/83	JET
B-103	ASMD IKR	02/85	SN	C-201	ASMD LKR	03/82	AR	TX-104	SOUND	09/79	SN
B-104	SOUND	06/85	SN	C-202	ASMD LKR	08/81	AR	TX-105	ASMD LKR	04/83	JET
B-105	ASMD IKR	12/84	AR	C-203	ASMD LKR	03/82	AR	TX-106	SOUND	06/83	JET
B-106	SOUND	03/85	SN	C-204	ASMD LKR	09/82	AR	TX-107	ASMD LKR	10/79	AR
B-107	ASMD LKR	03/85	SN	S-101	SOUND	N/A		TX-108	SOUND	03/83	JET
B-108	SOUND	05/85	SN	S-102	SOUND	N/A		TX-109	SOUND	04/83	JET
B-109	SOUND	04/85	SN	S-103	SOUND	04/00	JET (6)	TX-110	ASMD LKR	04/83	JET
B-110	ASMD LKR	12/84	AR	S-104	ASMD LKR	12/84	AR	TX-111	SOUND	04/83	JET
B-111	ASMD LKR	06/85	SN	S-105	SOUND	09/88	JET	TX-112	SOUND	04/83	JET
B-112	ASMD LKR	05/85	SN	S-106	SOUND	02/01	JET (10)	TX-113	ASMD LKR	04/83	JET
B-201	ASMD LKR	08/81	AR (3)	S-107	SOUND	N/A		TX-114	ASMD LKR	04/83	JET
B-202	SOUND	05/85	AR(2)	S-108	SOUND	12/96	JET	TX-115	ASMD LKR	09/83	JET
B-203	ASMD LKR	06/84	AR	S-109	SOUND	06/01	JET (13)	TX-116	ASMD LKR	04/83	JET
B-204	ASMD LKR	06/84	AR	S-110	SOUND	01/97	JET	TX-117	ASMD LKR	03/83	JET
BX-101	ASMD LKR	09/78	AR	S-111	SOUND	N/A		TX-118	SOUND	04/83	JET
BX-102	ASMD LKR	11/78	AR	S-112	SOUND	N/A		TY-101	ASMD LKR	04/83	JET
BX-103	SOUND	11/83	AR(2)	SX-101	SOUND	N/A		TY-102	SOUND	09/79	AR
BX-104	SOUND	09/89	SN	SX-102	SOUND	N/A		TY-103	ASMD LKR	02/83	JET
BX-105	SOUND	03/81	SN	SX-103	SOUND	N/A		TY-104	ASMD LKR	11/83	AR
BX-106	SOUND	07/95	SN	SX-104	ASMD LKR	04/00	JET (7)	TY-105	ASMD LKR	02/83	JET
BX-107	SOUND	09/90	JET	SX-105	SOUND	N/A		TY-106	ASMD LKR	11/78	AR
BX-108	ASMD LKR	07/79	SN	SX-106	SOUND	05/00	JET (8)	U-101	ASMD LKR	09/79	AR
BX-109	SOUND	33117	JET	SX-107	ASMD LKR	10/79	AR	U-102	SOUND	N/A	
BX-110	ASMD LKR	08/85	SN	SX-108	ASMD LKR	08/79	AR	U-103	SOUND	09/00	JET (9)
BX-111	ASMD LKR	03/95	JET	SX-109	ASMD LKR	05/81	AR	U-104	ASMD LKR	10/78	AR
BX-112	SOUND	09/80	JET	SX-110	ASMD LKR	08/79	AR	U-105	SOUND	03/01	JET (11)
BY-101	SOUND	05/84	JET	SX-111	ASMD LKR	07/79	SN	U-106	SOUND	03/01	JET (12)
BY-102	SOUND	04/95	JET	SX-112	ASMD LKR	07/79	AR	U-107	SOUND	N/A	
BY-103	ASMD LKR	11/87	JET	SX-113	ASMD LKR	11/78	AR	U-108	SOUND	N/A	
BY-104	SOUND	01/85	JET	SX-114	ASMD LKR	07/79	AR	U-109	SOUND	N/A	
BY-105	ASMD LKR	N/A		SX-115	ASMD LKR	09/78	AR	U-110	ASMD LKR	12/84	AR
BY-106	ASMD LKR	N/A		T-101	ASMD LKR	04/83	SN	U-111	SOUND	N/A	
BY-107	ASMD LKR	07/79	JET	T-102	SOUND	03/81	AR(2)(3)	U-112	ASMD LKR	09/79	AR
BY-108	ASMD LKR	02/85	JET	T-103	ASMD LKR	11/83	AR	U-201	SOUND	08/79	AR
BY-109	SOUND	07/87	JET	T-104	SOUND	11/99 (4)	JET	U-202	SOUND	08/79	SN
BY-110	SOUND	01/85	JET	T-105	SOUND	06/87	AR	U-203	SOUND	08/79	AR
BY-111	SOUND	01/85	JET	T-106	ASMD LKR	08/81	AR	U-204	SOUND	08/79	SN
BY-112	SOUND	06/84	JET	T-107	ASMD LKR	05/96	JET				

LEGEND:

- AR = Administratively interim stabilized
- JET = Saltwell jet pumped to remove drainable interstitial liquid
- SN = Supernatant pumped (Non-Jet pumped)
- N/A = Not yet interim stabilized
- ASMD LKR = Assumed Leaker

Interim Stabilized Tanks	129
Not Yet Interim Stabilized	20
<b>Total Single-Shell Tanks</b>	<b>149</b>

TABLE B 3 SINGLE SHELL TANKS INTERIM STABILIZATION STATUS

## Footnotes (in chronological order)

- (1) These dates indicate when the tanks were actually interim stabilized. In some cases the official interim stabilization documents were issued at a later date.
- (2) Although tanks BX 103, T 102, and T 112 met the interim stabilization administrative procedure at the time they were stabilized, they no longer meet the recently updated administrative procedure. The tanks were re-evaluated in 1996 and letter 9654456 J H Wicks to J K McClusky DOE RL dated September 1996 was issued which recommended that no further pumping be performed on these tanks, based on an economic evaluation.  
  
Document RPP 5556 Rev 0 Updated Drainable Interstitial Liquid Volume Estimates for 119 Single Shell Tanks Declared Stabilized, J G Field, February 7 2000 states that five tanks no longer meet the stabilization criteria (BX 103, T 102, and T 112 exceed the supernatant criteria and BY 103 and C 102 exceed the DIL criteria)  
  
An intrusion investigation was completed on tank B 202 in 1996 because of a detected increase in surface level. As a result of this investigation, it was determined that this tank no longer meets the recently updated administrative procedure for 200 series tanks.
- (3) Earlier versions of HNF SD RE TI 178 SST Stabilization Record, indicated that original Interim Stabilization data are missing on four tanks B 201, T 102, T 112, and T 201. HNF SD RE TI 178 Rev 7 dated February 9 2001 added three additional tanks to those missing stabilization data A 104, BX 101, and SX 115.
- (4) Tank 241 T 104 was Interim Stabilized on November 19 1999. In tank video taken October 7 1999 shows the surface is clearly sludge type waste with no saltcake present. No visible water on surface. Waste surface appears level across tank with numerous cracks. There is a minimal collapsed area around the saltwell screen, with no visible bottom.
- (5) Tank 241 T 110 was Interim Stabilized on January 5 2000 after a major equipment failure. An in tank video taken October 7 1999 (pumping was discontinued on August 12 1999) showed the surface of this tank as smooth, brown tinted sludge with visible cracks.
- (6) Tank 241 S 103 was declared Interim Stabilized April 18 2000. The surface is a rough, black and brown colored waste with yellow patches of saltcake visible throughout. The surface appears to be damp but not saturated and shows irregular cracking typically seen with surfaces beginning to dry out. A pool of supernatant liquid (10 feet in diameter, 5 feet deep, 10 Kgallons) is visible from video observations.
- (7) Tank 241 SX 104 was declared Interim Stabilized April 26 2000 after a major equipment failure. The surface is a rough, yellowish gray saltcake waste with an irregular surface of visible cracks and shelves that were created as the surface dried out. The waste surface appears to be dry and shows no standing liquid within the tank.
- (8) Tank 241 SX 106 was declared Interim Stabilized May 5 2000. The surface is a smooth, white-colored saltcake waste. The surface level slopes slightly from the tank sidewall down to a large depression in the center of the tank. A second depression surrounds both saltwell screens and an abandoned LOW. The waste surfaces appear dry and show no standing liquid within the tank.

- (9) Tank 241 U 103 was declared Interim Stabilized September 11 2000. The surface is a brown colored waste with irregular patches of white salt crystal. Approximately 30% of the waste surface is covered by the salt formations. The surface level slopes slightly from the tank sidewall down to the first of two depressions in the center of the tank. The waste surface appears dry and shows signs of drying and cracking due to saltwell pumping. LOW readings indicate an average adjusted ILL of 60.2 inches. There is a small pool of supernatant liquid estimated to be 500 gallons.
- (10) Tank 241 S 106 was declared Interim Stabilized on February 1 2001. The surface is a rough, brown and yellow-colored saltcake waste with an irregular surface of mounds and saltcake crystals that were created as the surface was dried out. The waste surface appears to be dry and shows no standing liquid within the tank. There is no evidence of supernatant liquid from video observations. The waste surface slopes gradually from the tank sidewall to the depression in the center of the tank. The depression surrounds both of the saltwell screens, but does not extend around the temperature probe and ENRAF devices.
- (11) Tank 241 U 105 was declared Interim Stabilized on March 29 2001 after a major equipment failure. The surface is a brown colored waste with irregular patches of white salt crystal. Approximately 15% of the surface is covered by the salt formations. The surface level slopes to the first of two depressions in the center of the tank. The first depression is cone shaped and estimated to be 22 feet in diameter. The second depression, inside the first, is cylindrically shaped and has a diameter of approximately 10 feet. Both depressions are centered on the saltwell screen. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is no visible liquid in the tank.
- (12) Tank 241 U 106 was declared Interim Stabilized on March 9 2001. The surface is a dark brown/yellow colored waste that is covered with many stalagmite type crystals growing on the surface. The crystals cover approximately 75% of the waste surface. The waste surface is irregular, appears dry, and shows only minimal signs of cracking due to saltwell pumping. The supernatant pool is estimated to be 13.3 feet in diameter based on the visible portion of the saltwell screen. The pool is centered on the saltwell screen.
- (13) Tank 241 S 109 was declared Interim Stabilized on June 11 2001. The surface is primarily a white colored salt crystal with small patches of dark salt visible due to saltwell/sampling activities. Approximately 95% of the waste surface is covered by the salt formations. The surface level slopes slightly from the tank sidewall down to a depression in the center of the tank. The waste surface appears rough and dry and shows signs of cracking and slumping due to saltwell pumping.

**TABLE B-4 SINGLE SHELL TANK INTERIM STABILIZATION MILESTONES**  
October 31 2001

New single-shell tank interim stabilization milestones were negotiated in 1999 and are identified in the Consent Decree The Consent Decree was approved on August 16 1999

**CONSENT DECREE**  
Attachments A 1 and A 2

The following table is the schedule for pumping liquid waste from the remaining twenty nine (29) single shell tanks This schedule is enforceable pursuant to the terms of the Decree except for the "Projected Pumping Completion Dates" which are estimates only and not enforceable Also this schedule does not include tank C 106

Tank Designation	Project Pumping Start Date	Actual Pumping Start Date	Projected Pumping Completion Date	Interim Stabilization Date
1 T 104	Already initiated	March 24 1996	May 30 1999	November 19 1999
2 T 110	Already initiated	May 12 1997	May 30 1999	January 5 2000
3 SX 104	Already initiated	September 26 1997	December 30 2000	April 26 2000
4 SX 106	Already initiated	October 6 1998	December 30 2000	May 5 2000
5 S 102	Already initiated	March 18 1999	March 30 2001	
6 S 106	Already initiated	April 16 1999	March 30 2001	February 1 2001
7 S 103	Already initiated	June 4 1999	March 30 2001	April 18 2000
8 U 103 *	June 15 2000	September 26 1999	April 15 2002	September 11 2000
9 U 105 *	June 15 2000	December 10 1999	April 15 2002	March 29 2001
10 U 102 *	June 15 2000	January 20 2000	April 15 2002	
11 U 109 *	June 15 2000	March 11 1000	April 15 2002	
12 A 101	October 30 2000	May 6 2000	September 30 2003	
13 AX 101	October 30 2000	July 29 2000	September 30 2003	
14 SX 105	March 15 2001	August 8 2000	February 28 2003	
15 SX 103	March 15 2001	October 26 2000	February 28 2003	
16 SX 101	March 15 2001	November 22 2000	February 28 2003	
17 U 106 *	March 15 2001	August 24 2000	February 28 2003	March 9 2001
18 BY 106	July 15 2001	July 11 2001	June 30 2003	
19 BY 105	July 15 2001	July 11 2001	June 30 2003	
20 U 108	December 30 2001		August 30, 2003	
21 U 107	December 30 2001	September 29 2001	August 30 2003	
22 S 111	December 30 2001		August 30, 2003	
23 SX 102	December 30 2001		August 30, 2003	
24 U 111	November 30 2001		September 30 2003	
25 S 109	November 30 2002	September 23 2000	September 30 2003	June 11 2001
26 S 112	November 30 2002		September 30 2003	
27 S 101	November 30 2002		September 30 2003	
28 S 107	November 30 2002		September 30 2003	
29 C 103	The Decree states that no later than December 30 2000 DOE will determine whether the organic layer and pumpable liquids will be pumped from this tank together or separately and will establish a deadline for initiating pumping of this tank, the parties will incorporate the initiation deadline into this schedule as provided in Section VI of the Decree This action is complete ORP issued a letter to WDOE on December 22 2000 meeting the requirements of this milestone			

\* Tanks containing organic complexants

Completion of Interim Stabilization. DOE will complete interim stabilization of all 29 single shell tanks listed above by September 30 2004

Percentage of Pumpable Liquid Remaining to be Removed

93% of Total Liquid	9/30/1999 (1)
38% of Organic Complexed Pumpable Liquids	9/30/2000 (2)
5% of Organic Complexed Pumpable Liquids	9/30/2001 (3)
18% of Total Liquid	9/30/2002
2% of Total Liquid	9/30/2003

The percentage of pumpable liquid remaining to be removed is calculated by dividing the volume of pumpable liquid remaining to be removed from tanks not yet interim stabilized by the sum of the total amount of liquid that has been pumped and the pumpable liquid that remains to be pumped from all tanks

- (1) The Pumpable Liquid Remaining was reduced to 88% by September 30 1999 Reference LMHC 9957926 R1 D I Allen, LHMC to D C Bryson DOE-ORP dated October 26 1999
- (2) The Complexed Pumpable Liquid Remaining was reduced to 38% by September 15 2000 Reference CHG-0004752 R F Wood, CHG to J J Short, DOE-ORP dated September 13 2000
- (3) Reference CHG-0104859 R. F Wood CHG to J S O Connor DOE-ORP dated September 20 2001 this reference states that tanks U 102 and U 109 appear to have met the interim stabilization criteria, thereby reducing the Complexed Pumpable Liquid Remaining to zero however it may take three or more months before the settling waste levels approach equilibrium so that the final liquid levels and volumes can be calculated A request to extend the milestone date may be prepared if ORP chooses to do so

TABLE B-5. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 1 of 6)  
October 31, 2001

Tank Number	Date Declared Confirmed or Assumed Leaker (3)	Volume Gallons (2)	Associated KiloCuries 137 Cs (9)	Interim Stabilized Date (11)	Leak Estimate	
					Updated	Reference
241-A-103	1987	5500 (8)		06/88	1987	(j)
241-A-104	1975	500 to 2500	0.8 to 1.8 (q)	09/78	1983	(a)(q)
241-A-105 (1)	1963	10000 to 277000	85 to 760 (b)	07/79	1991	(b)(c)
241-AX-102	1988	3000 (8)		09/88	1989	(h)
241-AX-104	1977	-- (6)		08/81	1989	(g)
241-B-101	1974	-- (6)		03/81	1989	(g)
241-B-103	1978	-- (6)		02/85	1989	(g)
241-B-105	1978	-- (6)		12/84	1989	(g)
241-B-107	1980	8000 (8)		03/85	1986	(d)(f)
241-B-110	1981	10000 (8)		03/85	1986	(d)
241-B-111	1978	-- (6)		06/85	1989	(g)
241-B-112	1978	2000		05/85	1989	(g)
241-B-201	1980	1200 (8)		08/81	1984	(e)(f)
241-B-203	1983	300 (8)		06/84	1986	(d)
241-B-204	1984	400 (8)		06/84	1989	(g)
241-BX-101	1972	-- (6)		09/78	1989	(g)
241-BX-102	1971	70000	50 (l)	11/78	1986	(d)
241-BX-108	1974	2500	0.5 (l)	07/79	1986	(d)
241-BX-110	1976	-- (6)		08/85	1989	(g)
241-BX-111	1984 (13)	-- (6)		03/95	1993	(g)
241-BY-103	1973	<5000		11/97	1983	(a)
241-BY-105	1984	-- (6)		N/A	1989	(g)
241-BY-106	1984	-- (6)		N/A	1989	(g)
241-BY-107	1984	15100 (8)		07/79	1989	(g)
241-BY-108	1972	<5000		02/85	1983	(e)
241-C-101	1980	20000 (8)(10)		11/83	1986	(d)
241-C-110	1984	2000		05/95	1989	(g)
241-C-111	1968	5500 (8)		03/84	1989	(g)
241-C-201 (4)	1988	550		03/82	1987	(i)
241-C-202 (4)	1988	450		08/81	1987	(i)
241-C-203	1984	400 (8)		03/82	1986	(d)
241-C-204 (4)	1988	350		09/82	1987	(i)
241-S-104	1968	24000 (8)		12/84	1989	(g)
241-SX-104	1988	6000 (8)		04/00	1988	(k)
241-SX-107	1964	<5000		10/79	1983	(a)
241-SX-108 (5)(14)	1962	2400 to 35000	17 to 140 (m)(q)(t)	08/79	1991	(m)(q)(t)
241-SX-109 (5)(14)	1965	<10000	<40 (n)(t)	05/81	1992	(n)(t)
241-SX-110	1976	5500 (8)		08/79	1989	(g)
241-SX-111 (14)	1974	500 to 2000	0.6 to 2.4 (l)(q)(t)	07/79	1986	(d)(q)(t)
241-SX-112 (14)	1969	30000	40 (l)(t)	07/79	1986	(d)(t)
241-SX-113	1962	15000	8 (l)	11/78	1986	(d)
241-SX-114	1972	-- (6)		07/79	1989	(g)
241-SX-115	1965	50000	21 (o)	09/78	1992	(o)
241-T-101	1992	7500 (8)		04/93	1992	(p)
241-T-103	1974	<1000 (8)		11/83	1989	(g)
241-T-106	1973	115000 (8)	40 (l)	08/81	1986	(d)
241-T-107	1984	-- (6)		05/96	1989	(g)
241-T-108	1974	<1000 (8)		11/78	1980	(f)
241-T-109	1974	<1000 (8)		12/84	1989	(g)
241-T-111	1979, 1994 (12)	<1000 (8)		02/95	1994	(f)(r)
241-TX-105	1977	-- (6)		04/83	1989	(g)
241-TX-107 (5)	1984	2500		10/79	1986	(d)
241-TX-110	1977	-- (6)		04/83	1989	(g)
241-TX-113	1974	-- (6)		04/83	1989	(g)
241-TX-114	1974	-- (6)		04/83	1989	(g)
241-TX-115	1977	-- (6)		09/83	1989	(g)
241-TX-116	1977	-- (6)		04/83	1989	(g)
241-TX-117	1977	-- (6)		03/83	1989	(g)
241-TY-101	1973	<1000 (8)		04/83	1980	(f)
241-TY-103	1973	3000	0.7 (l)	02/83	1986	(d)
241-TY-104	1981	1400 (8)		11/83	1986	(d)
241-TY-105	1960	35000	4 (l)	02/83	1986	(d)
241-TY-106	1959	20000	2 (l)	11/78	1986	(d)
241-U-101	1959	30000	20 (l)	09/79	1986	(d)
241-U-104	1961	55000	0.09 (l)	10/78	1986	(d)
241-U-110	1975	5000 to 8100 (8)	0.05 (q)	12/84	1986	(d)(q)
241-U-112	1980	8500 (8)		09/79	1986	(d)
67 Tanks		<750,000 - 1,050,000 (7)				

N/A = not applicable (not yet interim stabilized)

TABLE B 5 SINGLE SHELL TANKS LEAK VOLUME ESTIMATES

Footnotes

(1) Current estimates [see Reference (b)] are that 610 Kgallons of cooling water was added to tank 241 A 105 from November 1970 to December 1978 to aid in evaporative cooling. In accordance with Dangerous Waste Regulations [Washington Administrative Code 173 303-070 (2)(a)(ii) as amended, Washington State Department of Ecology 1990 Olympia, Washington] any of this cooling water that has been added and subsequently leaked from the tank must be classified as a waste and should be included in the total leak volume. In August 1991 the leak volume estimate for this tank was updated in accordance with the WAC regulations. Previous estimates excluded the cooling water leaks from the total leak volume estimates because the waste content (concentration) in the cooling water which leaked should be much less than the original liquid waste in the tank (the sludge is relatively insoluble). The total leak volume estimate in this report (10 to 277 Kgallons) is based on the following (see References)

- 1 Reference (b) contains an estimate of 5 to 15 Kgallons for the initial leak prior to August 1968
- 2 Reference (b) contains an estimate of 5 to 30 Kgallons for the leak while the tank was being sluiced from August 1968 to November 1970
- 3 Reference (b) contains an estimate of 610 Kgallons of cooling water added to the tank from November 1970 to December 1978 but it was estimated that the leakage was small during this period. This reference contains the statement "Sufficient heat was generated in the tank to evaporate most, and perhaps nearly all, of this water." This results in a low estimate of zero gallons leakage from November 1970 to December 1978
- 4 Reference (c) contains an estimate the 378 to 410 Kgallons evaporated out of the tank from November 1970 to December 1978. Subtracting the minimum evaporation estimate from the cooling water added estimate provides a range from 0 to 232 Kgallons of cooling water leakage from November 1970 to December 1978

	<u>Low Estimate</u>	<u>High Estimate</u>
Prior to August 1968	5 000	15 000
August 1968 to November 1970	5 000	30 000
November 1970 to December 1978	<u>0</u>	<u>232,000</u>
Totals	10 000	277 000

- (2) These leak volume estimates do not include (with some exceptions) such things as (a) cooling/raw water leaks, (b) intrusions (rain infiltration) and subsequent leaks (c) leaks inside the tank farm but not through the tank liner (surface leaks, pipeline leaks leaks at the joint for the overflow or fill lines etc ) and (d) leaks from catch tanks diversion boxes encasements, etc
- (3) In many cases a leak was suspected long before it was identified or confirmed. For example Reference (d) shows that tank 241 U 104 was suspected of leaking in 1956. The leak was confirmed in 1961. This report lists the "assumed leaker" date of 1961. Using present standards, tank 241 U 104 would have been declared an assumed leaker in 1956. In 1984 the criteria designations of "suspected leaker" "questionable integrity" "confirmed leaker" "declared leaker" "borderline and dormant," were merged into one category now reported as "assumed leaker". See Reference (f) for explanation of when, how long and how fast some of the tanks leaked. It is highly likely that there have been undetected leaks from single shell tanks because of the nature of their design and instrumentation.
- (4) The leak volume estimate date for these tanks is before the declared leaker date because the tank was in a suspected leaker or questionable integrity status however a leak volume had been estimated prior to the tank being reclassified

- (5) The increasing radiation levels in drywells and laterals associated with these three tanks could be indicating continuing leak or movement of existing radionuclides in the soil. There is no conclusive way to confirm these observations. (Repeat spectral drywell scans are not part of the current Tank Farm leak detection program but can be run on request a special needs arise. A select subset of drywells is routinely monitored by the Vadose Zone Characterization Project to assess movement of gamma-emitting radionuclides in the subsurface. There are currently no functioning laterals and no plan to prepare them for use)
- (6) Methods were used to estimate the leak volumes from these 19 tanks based on the assumption that their cumulative leakage is approximately the same as for 18 of the 24 tanks identified in footnote (9). For more details see Reference (g). The total leak volume estimate for these tanks is 150 Kgallons (rounded to the nearest Kgallon) for an average of approximately 8 Kgallons for each of 19 tanks.
- (7) The total has been rounded to the nearest 50 Kgallons. Upper bound values were used in many cases in developing these estimates. It is likely that some of these tanks have not actually leaked.
- (8) Leak volume estimate is based solely on observed liquid level decreases in these tanks. This is considered to be the most accurate method for estimating leak volumes.
- (9) The curie content shown is as listed in the reference document and is not decayed to a consistent date therefore a cumulative total is inappropriate.
- (10) Tank 241-C 101 experienced a liquid level decrease in the late 1960s and was taken out of service and pumped to a minimum heel in December 1969. In 1970 the tank was classified as a "questionable integrity" tank. Liquid level data show decreases in level throughout the 1970s and the tank was saltwell pumped during the 1970s, ending in April 1979. The tank was reclassified as a 'confirmed leaker' in January 1980. See References (q) and (r) refer to Reference (s) for information on the potential for there to have been leaks from other C farm tanks (specifically C 102, C 103, and C 109).
- (11) These dates indicate when the tanks were declared to be interim stabilized. In some cases the official interim stabilization documents were issued at a later date. Also in some cases the field work associated with interim stabilization was completed at an earlier date.
- (12) Tank 241 T 111 was declared an "assumed re-leaker" on February 28, 1994 due to a decreasing trend in surface level measurement. This tank was pumped, and interim stabilization completed on February 22, 1995.
- (13) Tank 241 BX 111 was declared an "assumed re leaker" in April 1993. Preparations for pumping were delayed following an administrative hold placed on all tank farm operations in August 1993. Pumping resumed and the tank was declared interim stabilized on March 15, 1995.
- (14) The leak volume and curie release estimates on SX 108, SX 109, SX 111, and SX 112 have been re-evaluated using a Historical Leak Model [see Reference (t)]. In general the model estimates are much higher than the values listed in the table both for volume and curies released. The values listed in the table do not reflect this revised estimate because "In particular it is worth emphasizing that this report was never meant to be a definitive update for the leak baseline at the Hanford Site. It was rather meant to be an attempt to view the issue of leak inventories with a new and different methodology. (This quote is from the first page of the referenced report)
- (15) In July 1998 the Washington State Department of Ecology (Ecology) directed the U. S. Department of Energy (DOE) to develop corrective action plans for eight single-shell tank farms (B/BX/BY/S/SX/T/TX/TY) where groundwater contamination likely originated from tank farm operations. A Tri Party Agreement milestone (M-45 series) was developed that established a formalized approach for evaluating impacts on groundwater quality of loss of tank wastes to the vadose zone underlying these tank farms. Planning documents have been completed for the S, SX, B, BX, and BY tank farms and will be completed shortly for the T, TX, and TY farms. The phase 1 field investigation is near completion in the

S and SX tank farms and has begun in the B BX, and BY farms Field work is anticipated in FY-02 for the T TX, and TY tank farms The remaining four single-shell tank farms are expected to be included in corrective action plans in the near future

All of the information included in this appendix is currently under review and significant revisions are anticipated Recently major tank farm vadose zone investigative efforts (such as the baseline spectral gamma-ray logging of all drywells in all single-shell tank farms as well as drilling and sampling in the SX tank farm) were completed This appendix will be revised as a better understanding of past tank leak events is developed

SST Vadose Zone Project drilling and testing activities near tank BX 102 were completed March 2001 A borehole (299 E33-45) was drilled through the postulated uranium plume resulting from the 1951 tank BX 102 overflow event to confirm the presence of uranium, define its present depth, and survey other contaminants of interest such as Tc 99 Thirty five split-spoon samples were collected for laboratory analyses This borehole was decommissioned after collection and analysis of groundwater samples.

Borehole W33-46 adjacent to tank B 110 was drilled to a depth of approximately 190 feet in July 2001 Soil samples were collected for analysis as part of the tank farm vadose zone characterization activities During decommissioning, this borehole was completed as a vadose zone monitoring structure Work was accomplished in cooperation with scientists from Idaho National Engineering and Environmental Laboratory and Pacific Northwest National Laboratory This borehole is now the first fully instrumented vadose zone hydrographic monitoring structure to be completed in a Hanford site tank farm

## References

- (a) Murthy K S et al June 1983 *Assessment of Single-Shell Tank Residual Liquid Issues at Hanford Site Washington* PNL-4688 Pacific Northwest Laboratory Richland, Washington
- (b) WHC 1991a, *Tank 241 A 105 Leak Assessment* WHC MR 0264 Westinghouse Hanford Company Richland, Washington.
- (c) WHC 1991b *Tank 241 A 105 Evaporation Estimate 1970 Through 1978* WHC EP-0410 Westinghouse Hanford Company Richland, Washington.
- (d) Smith, D A January 1986 *Single-Shell Tank Isolation Safety Analysis Report* SD WM SAR-006 Rev 1 Westinghouse Hanford Company Richland, Washington.
- (e) McCann, D C and T S Vail, September 1984 *Waste Status Summary* RHO-RE SR 14 Rockwell Hanford Operations, Richland, Washington
- (f) Catlin, R. J March 1980 *Assessment of the Surveillance Program of the High Level Waste Storage Tanks at Hanford* Hanford Engineering Development Laboratory Richland, Washington.
- (g) Baumhardt, R. J May 15 1989 Letter to R. E Gerton, U S Department of Energy Richland Operations Office *Single-Shell Tank Leak Volumes* 8901832B R1 Westinghouse Hanford Company Richland, Washington
- (h) WHC 1990a, *Occurrence Report, Surface Level Measurement Decrease in Single Shell Tank 241 AX 102* WHC UO-89-023 TF-05 Westinghouse Hanford Company Richland, Washington.
- (i) Groth, D R. July 1 1987 Internal Memorandum to R. J Baumhardt, *Liquid Level Losses in Tanks 241 C 201 202 and 204* 65950-87 517 Westinghouse Hanford Company Richland, Washington.
- (j) Groth, D R. and G C Owens, May 15 1987 Internal Memorandum to J H Roecker *Tank 103 A Integrity Evaluation* Westinghouse Hanford Company Richland, Washington.
- (k) Dunford, G L July 8 1988 Internal Memorandum to R. K Welty *Engineering Investigation Interstitial Liquid Level Decrease in Tank 241-SX 104* 13331 88-416 Westinghouse Hanford Company Richland, Washington
- (l) ERDA, 1975 *Final Environmental Statement Waste Management Operations, Hanford Reservation Richland Washington* ERDA 1538 2 vols U S Energy Research and Development Administration, Washington, D C
- (m) WHC 1992a, *Tank 241 SX 108 Leak Assessment* WHC MR-0300 Westinghouse Hanford Company Richland, Washington
- (n) WHC 1992b, *Tank 241 SX 109 Leak Assessment* WHC MR-0301 Westinghouse Hanford Company Richland, Washington.
- (o) WHC 1992c *Tank 241 SX 115 Leak Assessment* WHC MR-0302 Westinghouse Hanford Company Richland, Washington.
- (p) WHC 1992d, *Occurrence Report, Apparent Decrease in Liquid Level in Single Shell Underground Storage Tank 241 T 101 Leak Suspected Investigation Continuing* RL WHC TANKFARM 1992-0073 Westinghouse Hanford Company Richland, Washington.
- (q) WHC 1990b *A History of the 200 Area Tank Farms* WHC MR-0132 Westinghouse Hanford Company Richland, Washington.

- (r) **WHC 1993a, *Assessment of Unsaturated Zone Radionuclide Contamination Around Single-Shell Tanks 241 C 105 and 241 C 106* WHC-SD-EN TI 185 REV OA, Westinghouse Hanford Company Richland, Washington**
- (s) **WHC 1994 Occurrence Report, *Apparent Liquid Level Decrease in Single Shell Underground Storage Tank 241 T 111 Declared an Assumed Re Leaker* RL WHC TANKFARM 1994-0009 Westinghouse Hanford Company Richland, Washington.**
- (t) **HNF 1998 Agnew S F and R. A Corbin, August 1998 *Analysis of SX Farm Leak Histories Historical Leak Model (HLM)* HNF 3233 Rev 0 Los Alamos National Laboratory Los Alamos New Mexico**

**TABLE B-6 SINGLE SHELL TANKS MONITORING COMPLIANCE STATUS**  
 149 Tanks  
 October 31 2001

There were no Single Shell Tanks Out of Compliance (O/C) this month

<b>Legend</b>	
O/C	Noncompliance with applicable documentation
N/A	Not Applicable (not monitored, or no monitoring schedule)
None	Applicable equipment not installed
LOW	LOW reading taken by Neutron Probe (Exception. Tank AX 101 taken by gamma sensors)
POP	Plant Operating Procedure TO-040-650
MT/FIC/ENRAF	Surface level measurement devices
OSD	Operating Specification Document OSD T 151-00013 -00030 -00031
FSAR/TSR	Final Safety Analysis Report/Technical Safety Requirements

Notes

- All Dome Elevation Survey monitoring is in compliance
- Drywell monitoring is no longer required
- Psychrometrics monitoring is on an as needed basis
- In tank photos/videos are taken on an as needed basis

**TABLE B 7 TEMPERATURE MONITORING**  
 October 31 2001

SINGLE SHELL TANKS WITH HIGH HEAT LOADS (>26,000 Btu/hr)

Nine tanks have high heat loads for which temperature surveillance requirements have been established. In an analysis WHC SD WM SARR-010 Rev 1 *Heat Removal Characteristics of Waste Storage Tanks*, Kummerer 1995 it was estimated that these nine tanks have heat sources >26 000 Btu/hr which is the new criterion for determining high heat load tanks.

Temperatures in these tanks did not exceed the Technical Safety Requirements (TSR) for this month. The tanks are monitored by the Tank Monitor and Control System (TMACS). All high heat load tanks are on active ventilation.

	<u>Tank No</u>	
C 106 (1)	SX 108	SX 111
SX 103	SX 109	SX 112
SX 107	SX 110	SX 114

- (1) The final thermal analysis report for tank C 106 was issued August 9 2000 (RPP-6463 Rev 0) and concluded that the best estimate for C 106 was between 7 000 and 11 000 Btu/hr therefore this tank no longer meets the criterion for a high heat load tank. An AB Amendment is required to revise the temperature control limits and monitoring frequency. The AB Amendment request is on temporary hold by ORP.

Active ventilation.

There are 15 single shell tanks on active ventilation (9 are high heat load tanks – see above)

C 105	SX 104	SX 109
C 106	SX 105	SX 110
SX 101	SX 106	SX 111
SX 102	SX 107	SX 112
SX 103	SX 108	SX 114

SINGLE SHELL TANKS WITH LOW HEAT LOADS (<26,000Btu/hr)

There are 114 low heat load tanks. Temperatures in tanks connected to TMACS are monitored by TMACS. Temperatures in those tanks not yet connected to TMACS are manually taken semiannually in January and July. These temperatures have been within historical ranges for the applicable tank.

No temperatures have been obtained for several years in the 14 tanks listed below. Most of these tanks have no thermocouple trees.

<u>Tank No.</u>				
BY 102	C 104	T 102	TX 110	U 104
BY 104	C 204	T 105	TX 114	
BY 109	SX 115	TX 101	TX 117	

**This page intentionally left blank**

**APPENDIX C**

**MISCELLANEOUS UNDERGROUND STORAGE TANKS  
AND SPECIAL SURVEILLANCE FACILITIES**

TABLE C-1. EAST AND WEST AREA MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES

ACTIVE - still running transfers through the associated diversion boxes or pipeline encasements  
October 31, 2001

<u>FACILITY</u> <u>EAST AREA</u>	<u>LOCATION</u>	<u>PURPOSE (receives waste from.)</u>	<u>WASTE</u> <u>(Gallons)</u>	<u>MONITORED BY</u>	<u>REMARKS</u>
241-A-302-A	A Farm	A-151 DB	668	SACS/ENRAF/Manually	Pumped to AW-105 7/00
241-ER-311	B Plant	ER-151, ER-152 DB	1874	SACS/ENRAF/Manually	
241-AZ-151	AZ Farm	AZ-702 condensate	7832	SACS/ENRAF/TMACS	Volume changes daily - pumped to AZ-101 or AZ-102 as needed.
241-AZ-154	AZ Farm		25	SACS/MT	
244-BX-TK/SMP	BX Complex	DCRT - Receives from several farms	24025	SACS/MT	Using Manual Tape for tank/sump, pumped 3 times in 7/01 to 63.0 in. Sump O/S 2/5/01.
244-A-TK/SMP	A Complex	DCRT - Receives from several farms	7320	MCS/SACS/WTF	WTF- pumped 3/99 to AP-108
A-350	A Farm	Collects drainage	349	MCS/SACS/WTF	WTF (uncorrected) pumped as needed
AR-204	AY Farm	Tanker trucks from various facilities	350	DIP TUBE	Alarms on SACS-pumped to AP-108, 7/00
A-417	A Farm		13814	SACS/WTF	Pumped 4/98; WTF O/S 6/01; readings taken with zip cord
CR-003-TK/SUMP	C Farm	DCRT	2960	MT/ZIP CORD	Zip cord in sump O/S, 3/96; water intrusion, 1/98
<u>WEST AREA</u>					
241-TX-302-C	TX Farm	TX-154 DB	164	SACS/ENRAF/Manually	
241-U-301-B	U Farm	U-151, U-152, U-153, U-252 DB	8040	SACS/ENRAF/Manually	Returned to service 12/30/93
241-UX-302-A	U Plant	UX-154 DB	3339	SACS/ENRAF/Manually	
241-S-304	S Farm	S-151 DB	130	SACS/ENRAF/Manually	Replaced S-302-A, 10/91; ENRAF installed 7/98. Sump not alarming.
244-S-TK/SMP	S Farm	From original tanks to SY-102	25462	SACS/Manually	WTF (uncorrected); transferred from S-219, 6/01
244-TX-TK/SMP	TX Farm	From original tanks to SY-102	16810	SACS/Manually	MT - pumped PFP 241-Z tank D-5 to 244-TX DCRT on 4/12/01, level now 76 in.
Vent Station Catch Tank		Cross Country Transfer Line	379	SACS/Manually	MT

**LEGEND:**

- DB - Diversion Box
- DCRT - Double-Contained Receiver Tank
- TK - Tank
- SMP - Sump
- FC, ENRAF - Surface Level Measurement Devices
- MT - Manual Tape - Surface Level Measurement Device
- Zip Cord - Surface Level Measurement Device
- WTF - Weight Time Factor - can be recorded as WTF, CWF (corrected), and Uncorrected WTF
- SACS - Surveillance Automated Control System
- MCS - Monitor and Control System
- Manually - Not connected to any automated system
- O/S - Out of Service

Total Active Facilities 17

**TABLE C-2. EAST AREA INACTIVE MISC. UNDERGROUND STORAGE TANKS AND SPECIAL SURV. FACILITIES**

INACTIVE - no longer receiving waste transfers  
October 31, 2001

<u>FACILITY</u>	<u>LOCATION</u>	<u>RECEIVED WASTE FROM:</u>	<u>WASTE (Gallons)</u>	<u>MONITORED BY</u>	<u>REMARKS</u>
216-BY-201	BY Farm	TBP Waste Line	Unknown	NM	
241-A-302-B	A Farm	A-152 DB	5837	SACS/MT	Isolated 1985, Project B-138 Interim Stabilized 1990, Rain intrusion Isolated 1985
241-AX-151	N of PUREX	PUREX	Unknown	NM	Declared Assumed Leaker; pumped to AY-102 3/1/01, no longer being used.
241-AX-152	AX Farm	AX-152 DB	0	SACS/MT	Isolated 1985 (1)
241-B-301-B	B Farm	B-151, B-152, B-153, B-252 DB	22250	NM	Isolated 1985 (1)
241-B-302-B	B Farm	B-154 DB	4930	NM	Isolated 1985 (1)
241-BX-302-A	BX Farm	BR-152, BX-153, BXR-152, BYR-152 DB	840	NM	Isolated 1985 (1)
241-BX-302-B	BX Farm	BX-154 DB	1040	NM	Isolated 1985 (1)
241-BX-302-C	BX Farm	BX-155 DB	870	NM	Isolated 1985 (1)
241-C-301-C	C Farm	C-151, C-152, C-153, C-252 DB	10470	NM	Isolated 1985 (1)
241-CX-70	Hot Semi-Works	Transfer lines	Unknown	NM	Isolated, Decommission Project, See Dwg H-2-95-501, 2/5/87
241-CX-72	Works	Transfer lines	650	NM	
241-ER-311A	SW B Plant	ER-151 DB	Unknown	NM	Isolated
244-AR VAULT	A Complex	Between farms & B-Plant	Unknown	NM	Not actively being used. Systems activated for final clean out.
244-BXR-TK/SMP-001	BX Farm	Transfer lines	7200	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-002	BX Farm	Transfer lines	2180	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-003	BX Farm	Transfer lines	1810	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-011	BX Farm	Transfer lines	7100	NM	Interim Stabilization 1985 (1)
361-B-TANK	B Plant	Drainage from B-Plant	Unknown	NM	Interim Stabilization 1985 (1)

Total East Area Inactive Facilities 19

**LEGEND:**

- DB - Diversion Box
- DCRT - Double-Contained Receiver Tank
- MT - Manual Tape
- SACS - Surveillance Automated Control System
- TK - Tank
- SMP - Sump
- R - Usually denotes replacement
- NM - Not Monitored

(1) SOURCE: WHC-SD-WM-TI-356, "Waste Storage Tank Status & Leak Detection Criteria," Rev. 0, September 30, 1988

TABLE C-3. WEST AREA INACTIVE MISC. UNDERGROUND STORAGE TANKS AND SPECIAL SURV. FACILITIES

INACTIVE - no longer receiving waste transfers  
October 31, 2001

<u>FACILITY</u>	<u>LOCATION</u>	<u>RECEIVED WASTE FROM:</u>	<u>WASTE (Gallons)</u>	<u>MONITORED BY</u>	<u>REMARKS</u>
216-TY-201	E. of TY Farm	Supernatant from T-112	Unknown	NM	Isolated
231-W-151-001	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
231-W-151-002	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
241-S-302	S Farm	240-S-151 DB	8357	SACS/ENRAF	Assumed Leaker EPDA 85-04
241-S-302-A	S Farm	241-S-151 DB	0	0	Assumed Leaker TF-EFS-90-042
Partially filled with grout 2/91, determined still to be an assumed leaker after leak test. Manual FIC readings are unobtainable due to dry grouted surface.					
CASS monitoring system retired 2/23/99; intrusion readings discontinued. S-304 replaced S-302-A					
241-S-302-B	S Farm	S Encasements	Unknown	NM	Isolated 1985 (1)
241-SX-302	SX Farm	SX-151 DB, 151 TB	Unknown	NM	Isolated 1987
241-SX-304	SX Farm	SX-152 Transfer Box, SX-151 DB	Unknown	NM	Isolated 1985 (1)
241-T-301	T Farm	DB T-151, -151, -153, -252	Unknown	NM	Isolated 1985 (241-T-301B)
241-TX-302	TX Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TX-302-X-B	TX Farm	TX Encasements	Unknown	NM	Isolated 1985 (1)
241-TX-302-B	TX Farm	TX-155 DB	1600	SACS/MT	New MT installed 7/16/93
241-TX-302-B(R)	E. of TX Farm	TX-155 DB	Unknown	NM	Isolated
241-TY-302-A	TY Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TY-302-B	TY Farm	TY Encasements	Unknown	NM	Isolated 1985 (1)
241-Z-8	E. of Z Plant	Recuplex waste	Unknown	NM	Isolated, 1974, 1975
242-T-135	T Evaporator	T Evaporator	Unknown	NM	Isolated
242-TA-R1	T Evaporator	Z Plant waste	Unknown	NM	Isolated
243-S-TK-1	N. of S. Farm	Personnel Decon. Facility	Unknown	NM	Isolated
244-U-TK/SMP	U Farm	DCRT - Receives from several farms	Unknown	NM	Not yet in use
244-TXR VAULT	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-001	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-002	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-003	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
270-W	SE of U Plant	Condensate from U-221	Unknown	NM	Isolated 1970
361-T-TANK	T Plant	Drainage from T-Plant	Unknown	NM	Isolated 1985 (1)
361-U-TANK	U Plant	Drainage from U-Plant	Unknown	NM	Interim Stabilized, MT removed 1984 (1)

Total West Area Inactive Facilities 27

**LEGEND:**

- DB - Diversion Box, TB - Transfer Box
- DCRT - Double-Contained Receiver Tank
- TK - Tank
- SMP - Sump
- R - Usually denotes replacement
- FIC - Surface Level Monitoring Device
- MT - Manual Tape
- O/S - Out of Service
- SACS - Surveillance Automated Control System
- NM - Not Monitored
- ENRAF - Surface Level Monitoring Device

(1) SOURCE: WHC-SD-WM-TI-356, "Waste Storage Tank Status & Leak Detection Criteria," Rev. 0, September 30, 1988

**APPENDIX D**  
**GLOSSARY OF TERMS**

TABLE D 1 GLOSSARY OF TERMS

1 TANK STATUS CODES

TANK USE (Double Shell Tanks Only)

CWHT	Concentrated Waste Holding Tank
DRCVR	Dilute Receiver Tank
EVFD	Evaporate Feed Tank
SRCVR	Slurry Receiver Tank

2 DEFINITIONS

WASTE TANKS General

Waste Tank Safety Issue

A potentially unsafe condition in the handling of waste material in underground storage tanks that requires corrective action to reduce or eliminate the unsafe condition. There are currently no waste tank safety issues

Characterization

Characterization is understanding the Hanford tank waste chemical physical and radiological properties to the extent necessary to ensure safe storage and interim operation, and ultimate disposition of the waste

WASTE TYPES

Aging Waste (AW)

High level first cycle solvent extraction waste from the PUREX plant (NCAW)

Concentrated Complexant (CC)

Concentrated product from the evaporation of dilute complexed waste

Concentrated Phosphate Waste (CP)

Waste originating from the decontamination of the N Reactor in the 100 N Area. Concentration of this waste produces concentrated phosphate waste

Dilute Complexed Waste (DC)

Characterized by a high content of organic carbon including organic complexants ethylenediaminetetraacetic acid (EDTA) citric acid, and hydroxyethyl-ethylenediaminetriacetic acid (HEDTA) were the major complexants used. Main sources of DC waste in the DST system are saltwell liquid inventory (from SSTs)

Dilute Non-Complexed Waste (DN)

Low activity liquid waste originating from Sand T Plants the 300 and 400 Areas, PUREX facility (decladding supernatant and miscellaneous wastes) 100 N Area (sulfate waste) B Plant, saltwells and PFP (supernatant)

Drainable Interstitial Liquid (DIL)

Interstitial liquid that is not held in place by capillary forces and will therefore migrate or move by gravity (See also Section 4 below)

Double Shell Slurry (DSS)

Waste that exceeds the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. For reporting purposes, DSS is considered a solid.

Double Shell Slurry Feed (DSSF)

Waste concentrated just before reaching the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits This form is not as concentrated as DSS

Supernatant Liquid

The liquid above the solids or in large liquid pools covered by floating solids in waste storage tanks (See also Section 4 below)

INTERIM STABILIZATION (Single Shell Tanks only)

Interim Stabilized (IS)

A tank which contains less than 50 Kgallons of drainable interstitial liquid and less than 5 Kgallons of supernatant liquid. If the tank was jet pumped to achieve interim stabilization, then the jet pump flow or saltwell screen inflow must also have been at or below 0.05 gpm before interim stabilization criteria are met

Jet Pump

The jet pump system includes 1) a jet assembly with foot valve mounted to the base of two pipes that extend from the top of the well casing to near the bottom of the well casing inside the saltwell screen, 2) a centrifugal pump to supply power fluid to the down hole jet assembly 3) flexible or rigid transfer jumpers, 4) a flush line and 5) a flowmeter The jumpers contain piping, valves and pressure and limit switches

The centrifugal pump and jet assembly are needed to pump the interstitial liquid from the saltwell screen into the pump pit, nominally a 40-foot elevation rise The power fluid passes through a nozzle in the jet assembly and acts to convert fluid pressure head to velocity head, thereby reducing the pressure in the jet assembly chamber The reduction in pressure allows the interstitial liquid to enter the jet assembly chamber and mix with the power fluid. Velocity head is converted to pressure head above the nozzle lifting power fluid, and interstitial liquid to the pump pit Pumping rates vary from 0.05 to about 4 gpm

Saltwell Screen

The saltwell system is a 10 inch diameter saltwell casing consisting of a stainless steel saltwell screen welded to a Schedule 40 carbon steel pipe The casing and screen are to be inserted into the 12 inch tank riser located in the pump pit. The stainless steel screen portion of the system will extend through the tank waste to near the bottom of the tank The saltwell screen portion of the casing is an approximately 10 foot length of 300 Series 10 inch diameter stainless steel pipe with screen openings (slots) of 0.05 inches

Emergency Pumping Trailer

A 45-foot tractor-type trailer is equipped to provide storage space and service facilities for emergency pumping equipment this consists of two dedicated jet pump jumpers and two jet pumps, piping and dip tubes for each, two submersible pumps and attached piping, and a skid-mounted Weight Factor Instrument Enclosure with an air compressor and electronic recording instruments The skid also contains a power control station for the pumps, pump pit leak detection, and instrumentation A rack for over 100 feet of overground double-contained piping is also in the trailer

INTRUSION PREVENTION (ISOLATION) (Single Shell Tanks only)

Partially Interim Isolated (PI)

The administrative designation reflecting the completion of the physical effort required for Interim Isolation except for isolation of risers and piping that is required for jet pumping or for other methods of stabilization.

Interim Isolated (II)

The administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump catch tank, or diversion box In June 1993 Interim Isolation was replaced by Intrusion Prevention.

### Intrusion Prevention (IP)

Intrusion Prevention is the administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump catch tank, or diversion box. Under no circumstances are electrical or instrumentation devices disconnected or disabled during the intrusion prevention process (with the exception of the electrical pump)

### Controlled, Clean, and Stable (CCS)

Controlled, Clean, and Stable reflects the completion of several objectives. "Controlled" provide remote monitoring for required instrumentation and implement controls required in the TWRS Authorization Basis.

"Clean" remove surface soil contamination and downpost the Tank Farms to RBA/URMA/RA radiological control status, remove abandoned equipment, and place reusable equipment in compliant storage and "Stable" remove pumpable liquids from the SSTs and IMUSTs and isolate the tanks.

## TANK INTEGRITY

### Sound

The integrity classification of a waste storage tank for which surveillance data indicate no loss of liquid attributed to a breach of integrity.

### Assumed Leaker

The integrity classification of a waste storage tank for which surveillance data indicate a loss of liquid attributed to a breach of integrity.

### Assumed Re Leaker

A condition that exists after a tank has been declared as an "assumed leaker" and then the surveillance data indicate a new loss of liquid attributed to a breach of integrity.

## TANK INVESTIGATION

### Intrusion

A term used to describe the infiltration of liquid into a waste tank.

## SURVEILLANCE INSTRUMENTATION

### Drywells

Historically the drywells were monitored with gross logging tools as part of a secondary leak monitoring system. In some cases, neutron moisture sensors were used to monitor moisture in the soil as a function of well depth, which could be indicative of tank leakage. The routine gross gamma logging data were stored electronically from 1974 through 1994. The routine gross gamma logging program ended in 1994. A program was initiated in 1995 to log each of the available drywells in each tank farm with a spectral gamma logging system. The spectral gamma logging system provides quantitative values for gamma-emitting radionuclides. The baseline spectral gamma logging database is available electronically.

Repeat spectral drywell scans are not part of the established Tank Farm leak detection program, but can be run on request if special needs arise. A select subset of drywells is routinely monitored by the Vadose Zone Characterization Project to assess movement of gamma-emitting radionuclides in the subsurface.

### Laterals

Laterals are horizontal drywells positioned under single shell waste storage tanks to detect radionuclides in the soil which could be indicative of tank leakage. These drywells can be monitored by radiation detection probes. Laterals are 4-inch inside diameter steel pipes located 8 to 10 feet below the tank's concrete base. There are three laterals per tank. Laterals are located only in A and SX farms. There are currently no functioning laterals and no plan to prepare them for use.

Surface Levels

The surface level measurements in all waste storage tanks are monitored by manual or automatic conductivity probes and recorded and transmitted or entered into the Surveillance Analysis Computer System (SACS)

Automatic FIC

An automatic waste surface level measurement device is manufactured by the Food Instrument Company (FIC) The instrument consists of a conductivity electrode (plummet) connected to a calibrated steel tape a steel tape reel housing and a controller that automatically raises and lowers the plummet to obtain a waste surface level reading. The controller can provide a digital display of the data and until February 1999 the majority of the FICs transmitted readings to the CASS Since CASS retirement, all FIC gauges are read manually FICs are being replaced by ENRAF detectors (see below)

ENRAF 854 ATG Level Detector

FICs and some manual tapes are in the process of being replaced by the ENRAF ATG 854 level detector The ENRAF gauge fabricated by ENRAF Incorporated, determines waste level by detecting variations in the weight of a displacer suspended in the tank waste The displacer is connected to a wire wound onto a precision measuring drum. A change in the waste level causes a change in the weight of the displacer which will be detected by the force transducer Electronics within the gauge causes the servo motor to adjust the position of the displacer and compute the tank level based on the new position of the displacer drum. The gauge displays the level in decimal inches The first few ENRAFs that received remote reading capability transmit liquid level data via analog output to the Tank Monitor and Control System (TMACS) The remaining ENRAFs and future installations will transmit digital level data to TMACS via an ENRAF Computer Interface Unit (CIU) The CIU allows fully remote communication with the gauge minimizing tank farm entry

Annulus

The annulus is the space between the inner and outer shells on DSTs only Drain channels in the insulating and/or supporting concrete carry any leakage to the annulus space where conductivity probes are installed The annulus conductivity probes and radiation detectors are the primary means of leak detection for all DSTs

Liquid Observation Well (LOW)

In-tank liquid observation wells are used for monitoring the interstitial liquid level (ILL) in single-shell tanks. The wells are usually constructed of fiberglass or TEFZEL-reinforced epoxy polyester resin (TEFZEL is a trademark of E I du Pont de Nemours & Company) There are a few LOWs constructed of steel LOWs are sized to extend to within 1 inch of the bottom of the waste tank, are sealed at their bottom ends, and have a nominal outside diameter of 3.5 inches Gamma and neutron probes are used to monitor changes in the ILL and can indicate intrusions or leakage by increases or decreases in the ILL There are 65 LOWs (64 are in operation) installed in SSTs that contain or are capable of containing greater than 50 Kgallons of drainable interstitial liquid. Two LOWs installed in DSTs SY 102 and AW 103 are used for special, rather than routine surveillance purposes only

Thermocouple (TC)

A thermocouple is a thermoelectric device used to measure temperature More than one thermocouple element on a device (probe) is called a thermocouple tree In DSTs there may be one or more thermocouple trees in risers in the primary tank. In addition, in DSTs only there are TC elements installed in the insulating concrete the lower primary tank knuckle the secondary tank concrete foundation, and in the outer structural concrete

These monitor temperature gradients within the concrete walls bottom of the tank, and the domes In SSTs, one or more thermocouples may be installed directly in a tank, although some SSTs do not have any trees installed A single TC element may be installed in a riser or lowered down an existing riser or LOW There are also four thermocouple laterals beneath tank 105 A in which temperature readings are taken in 34 TC elements

In-tank Photographs and Videos

In-tank photographs and videos may be taken to aid in resolving in-tank measurement anomalies and determine tank integrity. Photographs and videos help determine sludge and liquid levels by visual examination.

ACRONYMS

- CCS            Controlled, Clean, and Stable (tank farms)
- FSAR           Final Safety Analysis Report effective October 18 1999
- II                Interim Isolated
- IP                Intrusion Prevention Completed
- IS                Interim Stabilized
- MT/FIC/ENRAF    Manual Tape Food Instrument Corporation, ENRAF Corporation (surface level measurement "devices")
- OSD            Operating Specifications Document
- PI                Partial Interim Isolated
- SAR            Safety Analysis Report
- SHMS           Standard Hydrogen Monitoring System
- TMACS          Tank Monitor and Control System
- TPA            Hanford Federal Facility Consent and Compliance Order "Washington State Department of Ecology U S Environmental Protection Agency and U S Department of Energy " as amended (Tri Party Agreement)
- TSR            Technical Safety Requirement
- USQ            Unreviewed Safety Question

Wyden Amendment

Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the National Defense Authorization Act for Fiscal Year 1991, November 5 1990  
Public Law 101 510

3 INVENTORY AND STATUS BY TANK - COLUMN VOLUME CALCULATIONS AND DEFINITIONS FOR TABLE B 1 (Single Shell Tanks only)

COLUMN HEADING	COLUMN VOLUME CALCULATIONS (Underlined)/DEFINITIONS
Total Waste	<u>Solids volume plus Supernatant Liquid</u> Solids include sludge and saltcake (see definitions below)

COLUMN HEADING	COLUMN VOLUME CALCULATIONS (Underlined)/DEFINITIONS
Supernatant Liquid (1)	<u>May be either measured or estimated.</u> Supernatant is either the estimated or measured liquid floating on the surface of the waste or under a floating solids crust. In-tank photographs or videos are useful in estimating the liquid volumes liquid floating on solids and core sample data are useful in estimating large liquid pools under a floating crust
Drainable Interstitial Liquid (DIL) (1)	<u>This is initially calculated.</u> Drainable interstitial liquid is calculated based on the saltcake and sludge volumes using calculated porosity values from past pumping or actual data for each tank. Interstitial liquid is liquid that fills the interstitial spaces of the solids waste. The sum of the interstitial liquid contained in saltcake and sludge minus an adjustment for capillary height is the initial volume of drainable interstitial liquid
Pumped This Month	<u>Net total gallons of liquid pumped from the tank during the month.</u> If supernatant is present, pump production is first subtracted from the supernatant volume. The remainder is then subtracted from the drainable interstitial liquid volume
Total Pumped (1)	<u>Cumulative net total gallons of liquid pumped from 1979 to date</u>
Drainable Liquid Remaining (DLR) (1)	<u>Supernatant plus Drainable Interstitial Liquid.</u> The total Drainable Liquid Remaining is the sum of drainable interstitial liquid and supernatant.
Pumpable Liquid Remaining (PLR) (1)	<u>Drainable Liquid Remaining minus unpumpable volume</u> Not all drainable interstitial liquid is pumpable
Sludge	<u>Solids formed during sodium hydroxide additions to waste.</u> Sludge was usually in the form of suspended solids when the waste was originally received in the tank from the waste generator. In-tank photographs or videos may be used to estimate the volume
Saltcake	<u>Results from crystallization and precipitation after concentration of liquid waste, usually in an evaporator.</u> If saltcake is layered over sludge it is only possible to measure total solids volume. In-tank photographs or videos may be used to estimate the saltcake volume
Solids Volume Update	<u>Indicates the latest update of any change in the solids volume.</u>
Solids Update Source See Footnote	<u>Indicates the source or basis of the latest solids volume update</u>
Last In Tank Photo	<u>Date of last in-tank photographs taken</u>
Last In-Tank Video	<u>Date of last in-tank video taken.</u>
See Footnotes for These Changes	<u>Indicates any change made the previous month.</u> A footnote explanation for the change follows the Inventory and Status by Tank Appendix (Table B 1)

(1) Volumes for supernatant, DIL, DLR, and PLR are not shown in these columns until interim stabilization is completed. Total gallons pumped, total waste, sludge, and saltcake volumes are shown and adjusted based on actual pumping volumes.

**This page intentionally left blank**

**APPENDIX E**  
**TANK CONFIGURATION AND FACILITIES CHARTS**

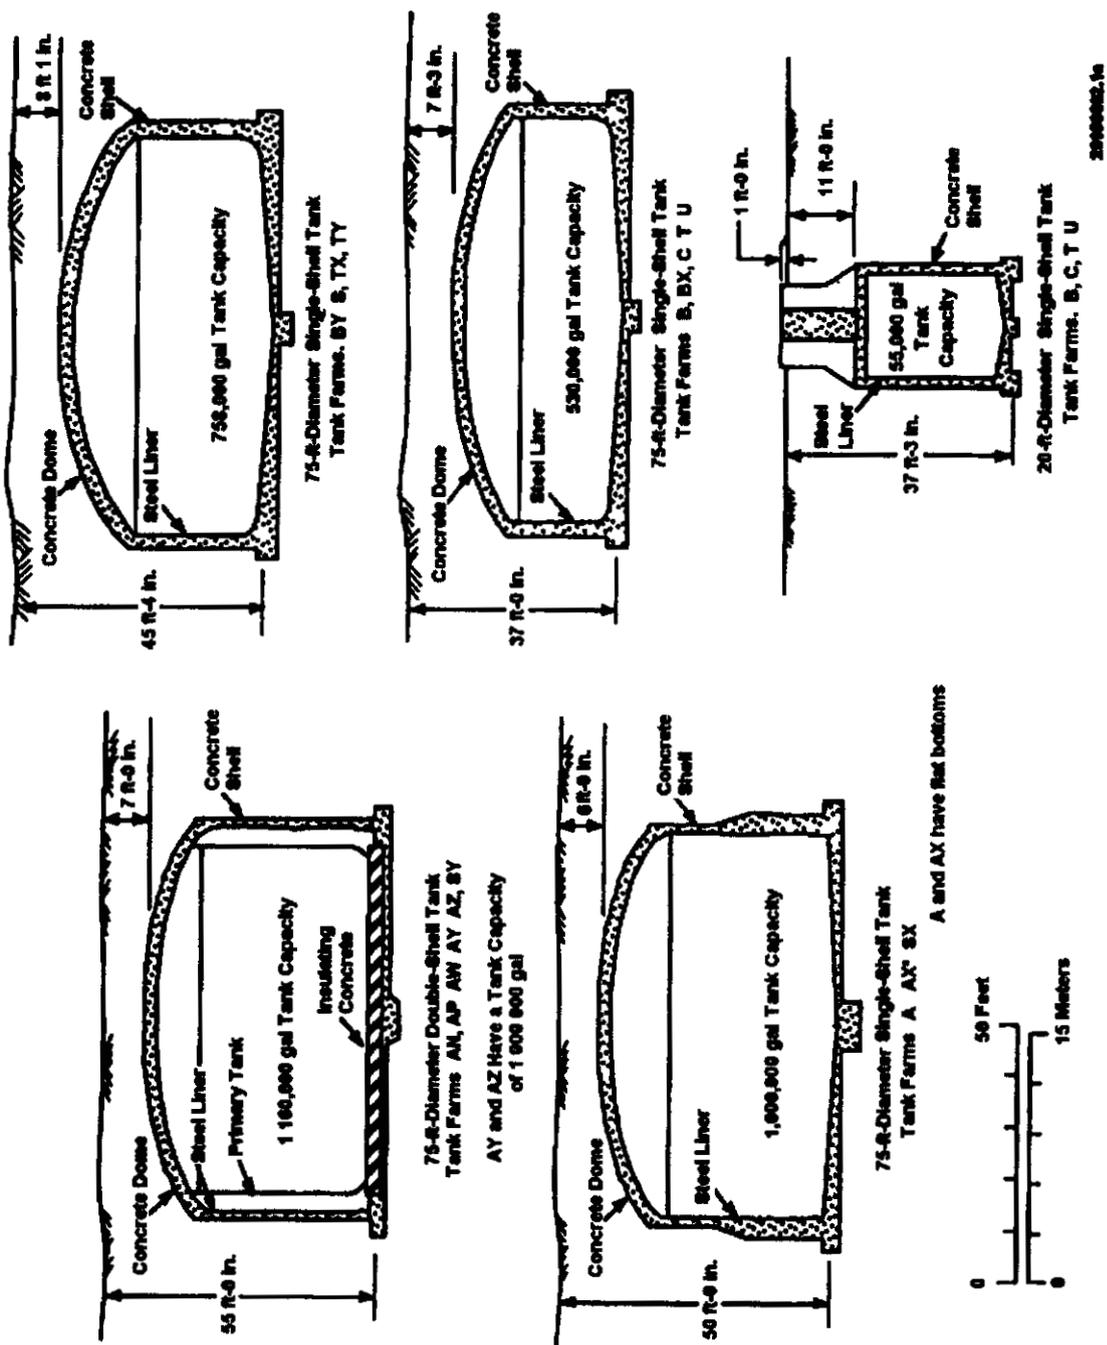


Figure E 1 High Level Waste Tank Configuration

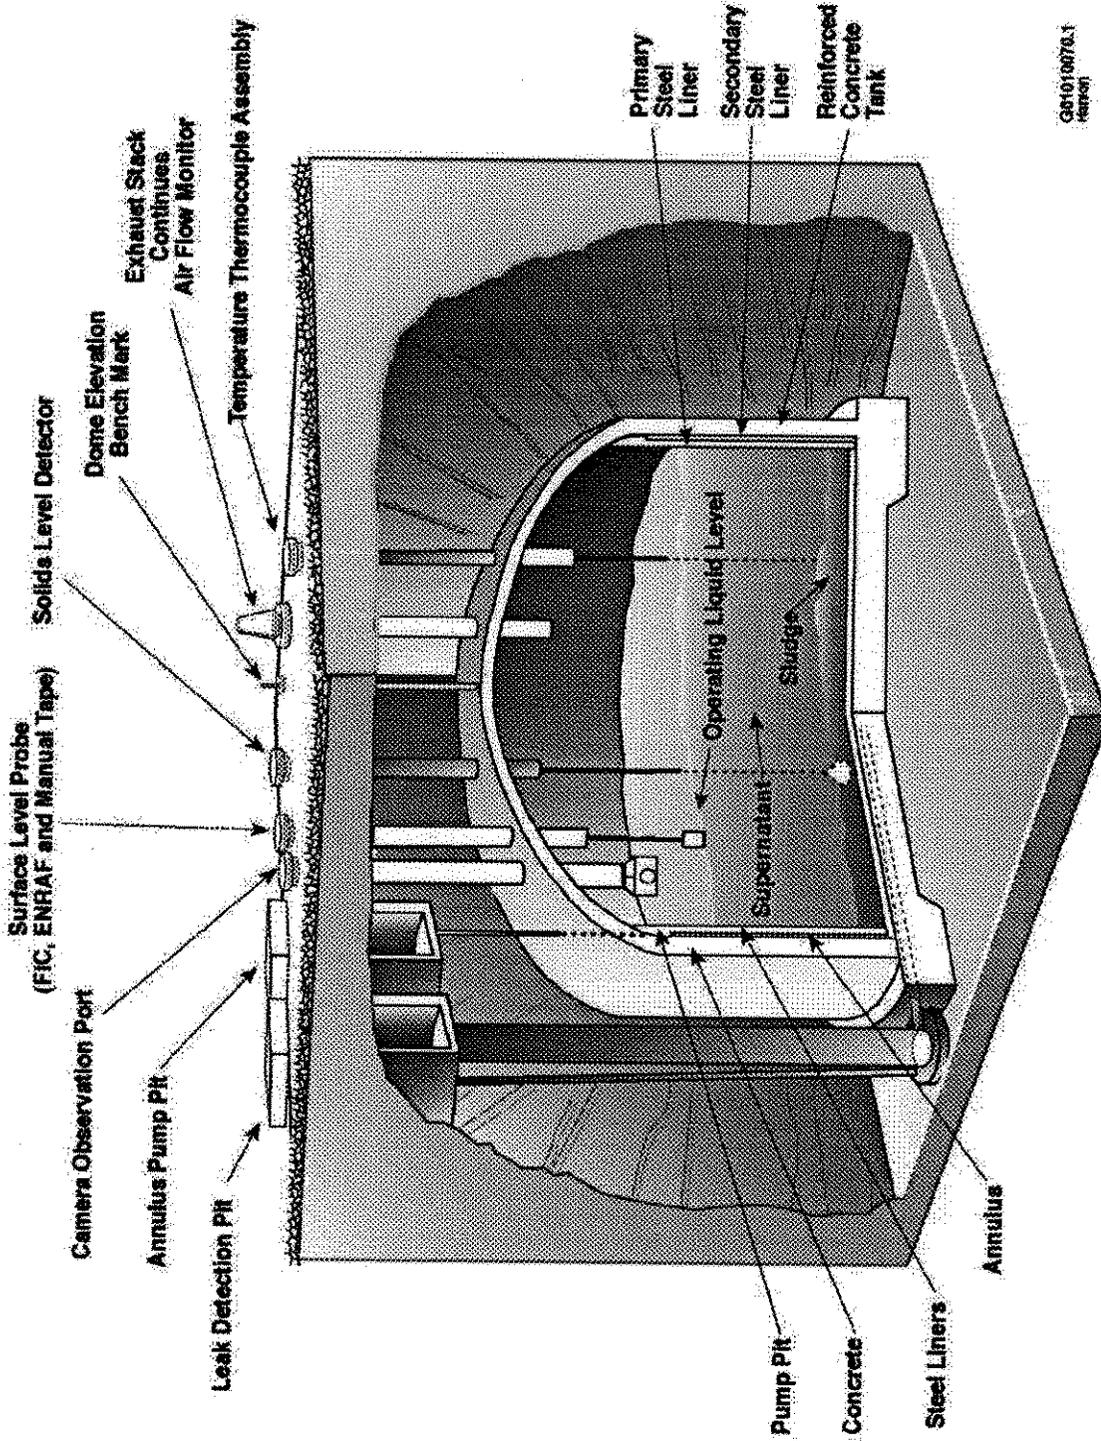


Figure E-2. Double-Shell Tank Instrumentation Configuration

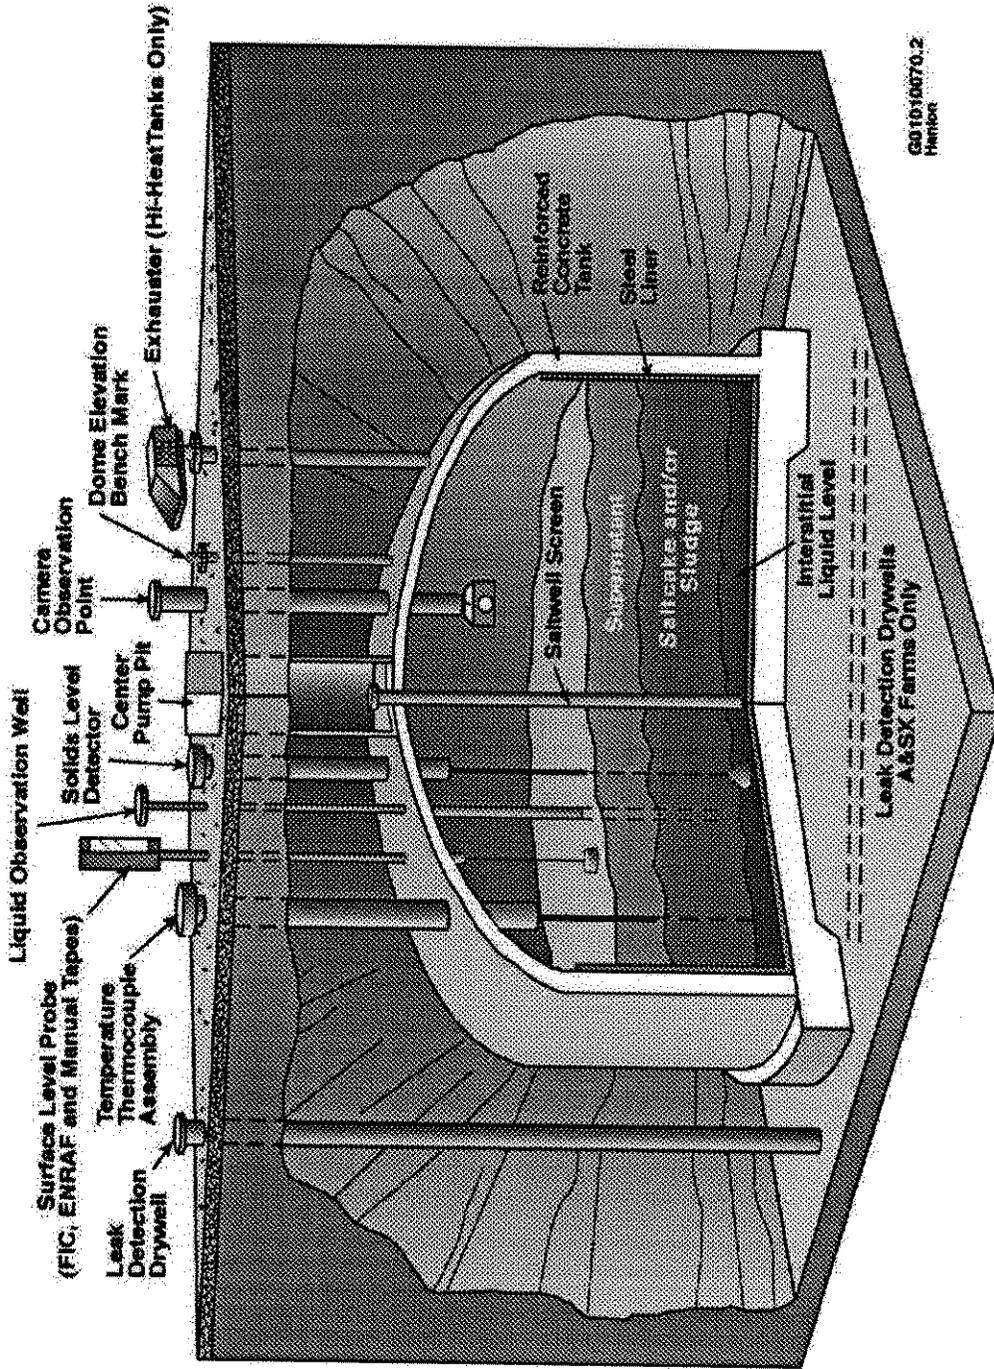


Figure E-3. Single-Shell Tank Instrumentation Configuration

**THE TANK FARM FACILITIES CHARTS (colored foldouts)  
ARE ONLY BEING INCLUDED IN THIS REPORT ON A QUARTERLY BASIS  
(i e months ending March 31 June 30 September 30 and December 31)**

**NOTE COPIES OF THE FACILITES CHARTS CAN BE OBTAINED  
FROM DENNIS BRUNSON LMSI MULTI MEDIA SERVICES  
376 2345 G3 51**

**ALMOST ANY SIZE IS AVAILABLE WHICH CAN BE LAMINATED  
A PURCHASING CARD (P Card) IS REQUIRED**

**This page intentionally left blank**

DISTRIBUTION  
October 31 2001

Number of copies

OFFSITE USA

- 2            **Congress of the United States**  
U S Senate  
717 Hart Senate Building  
Washington D C 20510
- Senator Ron Wyden
- U S House of Representatives  
1323 Longworth House Office Building  
Washington D C 20515
- Congressman Richard Doc Hastings 4th District  
Atten Jeff Markey
- 4            **U. S. Department of Energy Headquarters**  
1000 Independence Avenue SW  
Washington, D C 20585
- Harry Calley                            EM 38 Cloverleaf Bldg  
              Willam M Levitan                    EM 1 FORS/5A-014
- U. S. Department of Energy Headquarters**  
19901 Germantown Rd  
Germantown, MD 20874
- Kurt Juroff                            EM-44  
              Ralph Lightener                    EM-44
- 1            **Washington State Department of Ecology**  
Nuclear Waste Program  
P O Box 47600  
Olympia, WA 98504-7600
- Roger Stanley
- 1            **Washington State Department of Health**  
Radiation Protection  
7171 Cleanwater Lane  
P O Box 47827  
Olympia, WA 98504-7827
- Allen W Conklin
- 1            **Oregon State Office of Energy**  
625 Marion St. NE Suite 1  
Salem OR 97301
- Dirk Dunning  
**Do not remove from distribution without permission from ODOE**

1 Donald T Oakley  
4750 41<sup>st</sup> St. NW #1  
Washington, DC 20016

1 MACTEC  
8310 Centerbrook Place  
Alexandra, VA 22308

Stanley Blacker Vice President  
**Do not remove from distribution without permission from addressee**

1 CH2M HILL  
6060 S Willow Drive  
Greenwood Village CO 80111 5142

Dr Bob Iottu President and General Manager

TRI CITIES

1 ARES Corporation  
636 Jadwin Ave Suite B  
Richland, WA 99352

1 Winward Environmental  
3110 W Metaline  
Kennewick, WA 99336

R. T Winward

ONSITE

1 MACTEC ERS  
J F Bertsch B2-62

1 General Accounting Office  
C R. Abraham A1-80

1 Washington State Department of Ecology  
Library B5 18

1 U. S Environmental Protection Agency  
D R. Sherwood B5-01

9 U. S. Department of Energy  
D C Bryson H6-60  
V L Callahan H6-60  
E J Cruz H6-60  
D H Irby H6-60  
Wen Shou Liou H6-60  
J L Polehn H6-60  
M J Royack H6-60  
D J Williams H6-60  
Reading Room H2 53

2            **Pacific National Northwest Laboratories**

J L Huckaby	K7 15
B E Optz	K6 75

93           **CH2M Hill (CHG), and Affiliated Companies**

D I Allen	R2 50
J C Allen Floyd	H6-06
E S Aromi	H6-63
K M Bowen	R2 12
V C Boyles	R2 11
D L Carlile	T4-07
R J Cash	R1-04
J L Cowin	T4-08
W L Cowley	R1-44
C DeFigh-Price	R2 58
M P Delozier	H6-08
J N Doeler	T7-04
R A Dodd	H6 22
A F Erhart	R3 73
S D Estey	R2 11
A C Etheridge	H6-04
J G Field	R2 12
L A Fort	R2 11
K D Fowler	R2 11
G T Frater	R2 58
J C Fulton	R2 50
J R. Freeman Pollard	R2 50
J S Garfield	L4-07
K A Gasper	L4-07
B C Gooding	T4-07
B M Hanlon (6)	R3 72
D C Hedengren	R3 73
C C Hendersen	B2-05
B A Higley	R3 73
S W Hildreth	T4-07
K M Hodgson	R1 14
T M Hohl	R3 73
B A Johnson	S7-02
T E Jones	H0 22
J Kalta	R1-43
M. R. Kembel	S7-03
R. A Kirkbride	R3 73
P F Kison	T4-07
N W Kirch	R3 73
J S Konyu	S7-64
G M. Koreski	R2 11
J G Kristofzski	R2 39
J A Lechelt	R2 11
T H May	R2 11
J A McDonald Jr	R2 50
M A. Payne	H6-63
R. E Pohio	S7 95
R. S Popielarczyk	S5-07
R. E Raymond (2)	R2 50

B. J. Rabe	S7-83
W. E. Ross	S7-83
N. J. Scott-Proctor	S5-00
J. P. Sederburg	R1-04
J. N. Strode	R3-73
T. D. Taylor	H6-64
R. R. Thompson	R1-04
D. T. Vladimiroff	S7-20
L. R. Webb (10)	R1-10
L. D. Wiberg (12)	R1-51
Central Files	B1-07
200 West Shift Office	T4-00
200 East Shift Office	S7-02
Environmental	
Data Mgmt Center (2)	H6-08
Unified Dose Assessment	
Center (UDAC)	A0-20
Document Processing Center	A3-94