

CH2M HILL ENGINEERING CHANGE NOTICE

1a. ECN 722913 R 0

Page 2 of 2

DM FM TM

1b. Proj. ECN - - R

21. Revisions Planned (Include a brief description of the contents of each revision)

None

22. Design Basis Documents

Yes No

Note: All revisions shall have the approvals of the affected organizations as identified in block 11 "Approval Designator," on page 1 of this ECN.

23. Commercial Grade Item Dedication Numbers (associated with this design change)

NA

24. Engineering Data Transmittal Numbers (associated with this design change, e.g., new drawings, new documents)

NA

25. Other Non Engineering (not in HDCS) documents that need to be modified due to this change

Type of Document	Document Number	Update Completed On	Responsible Engineer (print/sign and date)
Alarm Response Procedure	None		
Operations Procedure	None		
Maintenance Procedure	None		
Type of Document	Document Number	Type of Document	Document Number
None			

26. Field Change Notice(s) Used?

Yes No

If Yes, Record Information on the ECN-2 Form, attach form(s), include a description of the interim resolution on ECN Page 1, block 17, and identify permanent changes.

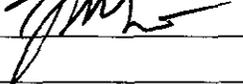
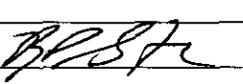
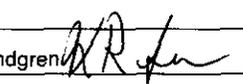
NOTE: ECNs are required to record and approve all FCNs issued. If the FCNs have not changed the original design media then they are just incorporated into the design media via an ECN. If the FCN did change the original design media then the ECN will include the necessary engineering changes to the original design media.

27. Design Verification Required?

Yes No

If Yes, as a minimum attach the one page checklist from TFC-ENG-DESIGN-P-17.

28. Approvals

Facility/Project Signatures		Date	A/E Signatures		Date
Design Authority	_____	_____	Originator/Design Agent	_____	_____
Resp. Engineer	R.D. Smith 	3/17/05	Professional Engineer	_____	_____
Resp. Manager	J. M. Grigsby 	3/18/05	Project Engineer	_____	_____
Quality Assurance	_____	_____	Quality Assurance	_____	_____
IS&H Engineer	_____	_____	Safety	_____	_____
NS&L Engineer	R.D. Smith 	3/17/05	Designer	_____	_____
Environ. Engineer	_____	_____	Environ. Engineer	_____	_____
Engineering Checker	K.R. Sandgren 	3/18/05	Other	_____	_____
Other	_____	_____	Other	_____	_____
Other	_____	_____	DEPARTMENT OF ENERGY / OFFICE OF RIVER PROTECTION		
Other	_____	_____	Signature or a Control Number that tracks the Approval Signature		
Other	_____	_____	ADDITIONAL SIGNATURES		
Other	_____	_____	_____	_____	_____
Other	_____	_____	_____	_____	_____

Safety Evaluation of the Single-Shell Tanks Modified Sluicing Waste Retrieval System

R.D. Smith
CH2M HILL Hanford Group, Inc.
Richland, WA 99352
U.S. Department of Energy Contract DE-AC27-99RL14047

EDT/ECN: 722913-R0 UC: N/A
Cost Center: 7B300 Charge Code: 502255
B&R Code: N/A Total Pages: 120

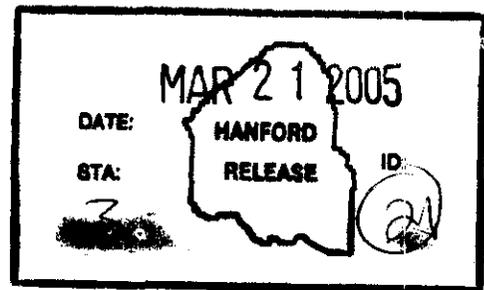
Key Words: Single-shell tank, SST, modified sluicing system, double-shell tank, DST, portable exhaustor, ventilation, variable frequency drive

Abstract: The purpose of this safety evaluation is to evaluate the potential for higher ventilation flow rates than previously analyzed as identified in RPP-CALC-24575, revision 0 for single-shell tank modified sluicing system retrieval of the 100-series SSTs.

TRADEMARK DISCLAIMER. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors.

Printed in the United States of America. To obtain copies of this document, contact: Document Control Services, P.O. Box 950, Mailstop H6-08, Richland WA 99352, Phone (509) 372-2420; Fax (509) 376-4989.

Carey Conner 3/21/05
Release Approval Date



Release Stamp

Approved For Public Release

CONTENTS

1.0 PURPOSE AND SCOPE..... 1-1
 1.1 PURPOSE..... 1-1
 1.2 SCOPE..... 1-1

2.0 DESCRIPTION OF THE SINGLE-SHELL TANK MODIFIED SLUICING
 WASTE RETRIEVAL SYSTEM DESIGN AND PROCESS 2-1

3.0 HAZARD ANALYSIS 3-1
 3.1 HAZARD IDENTIFICATION..... 3-1
 3.2 METHODOLOGY 3-1
 3.3 ASSUMPTIONS..... 3-4
 3.4 HAZOP RESULTS..... 3-4
 3.5 HAZARDOUS CONDITION SCREENING 3-4
 3.6 DETAILED DISCUSSION..... 3-5

4.0 ACCIDENT ANALYSIS..... 4-1
 4.1 EVALUATION OF RISK FROM MODIFIED SLUICING OF WASTE
 FOR DSA REPRESENTATIVE ACCIDENTS 4-1
 4.1.1 Flammable Gas Accidents 4-1
 4.1.2 Criticality 4-7
 4.1.3 Release from Contaminated Facility..... 4-8
 4.1.4 Waste Transfer Leaks 4-11
 4.2 EVALUATION OF RISK FROM MODIFIED SLUICING OF WASTE
 FOR DSA CANDIDATE ACCIDENTS NOT SELECTED AS
 REPRESENTATIVE ACCIDENTS..... 4-18
 4.2.1 Filtration Failures Leading to Unfiltered Releases 4-18

5.0 CONTROLS 5-1

6.0 REFERENCES 6-1

APPENDICES

A TEAM MEMBER ROSTER..... A-i

B DEFINITIONS..... B-i

C HAZOP DATA TABLE C-i

D SAFETY EVALUATION FOR SLUICING IN SINGLE-SHELL TANK
 241-S-102 WITH DOUBLE-SHELL TANK 241-SY-102 SUPERNATANT D-i

E SAFETY EVALUATION FOR SLUICING IN SINGLE-SHELL TANK
241-C-103 WITH DOUBLE-SHELL TANK 241-AN-106 SUPERNATANTE-i

F PEER REVIEW CHECKLISTSF-i

LIST OF TABLES

Table 3-1. Deviation Guide For Process Variables. 3-2

Table 4-1. Properties Associated with the Waste 4-12

Table 4-2. Properties Associated with the Transfer Pumps..... 4-15

Table 4-3. Seepex Pump Maximum Pressure Exposure Comparison. 4-16

LIST OF TERMS

AC	administrative control
AIChE	American Institute of Chemical Engineers
ARF	airborne release fraction
CAM	continuous air monitor
DCRT	double-contained receiver tank
DSA	documented safety analysis
DST	double-shell tank
FHA	fire hazards analysis
GRE	gas release event
HAZOP	Hazards and Operability Study
HEPA	high-efficiency particulate air (filter)
HIHTL	hose-in-hose transfer line
LCO	limiting condition for operation
LFL	lower flammability limit
LPF	leak path factor
MAR	material at risk
NFPA	National Fire Protection Association
ORP	Office of River Protection
RF	respirable fraction
SER	Safety Evaluation Report
SSC	structures, systems, and components
SST	single-shell tank
TSR	technical safety requirements
ULD	unit-liter dose

This page intentionally left blank.

1.0 PURPOSE AND SCOPE

1.1 PURPOSE

The purpose of this safety evaluation is to determine if the potential risk associated with using the single-shell tank (SST) modified sluicing system for retrieval of the 100-series SSTs in the tank farms is adequately addressed and bounded by the current tank farms safety basis (documented safety analysis [DSA]) and to determine if additional controls may be required. This safety evaluation also supports the requirement to perform a generic safety basis amendment for the retrieval of any additional SSTs (other than 241-S-112, and 241-U-107) by modified sluicing from the U.S. Department of Energy, Office of River Protection (ORP) Safety Evaluation Report (SER) 03-TED-066, *Safety Evaluation Report (SER) for Approval of Justification for Continued Operation (JCO) for Tank Farms Single-Shell Tank (SST) Retrieval/Closure Modified Sluicing*.

1.2 SCOPE

The scope of this safety evaluation is SST modified sluicing waste retrieval system operations that are planned for conduct in 100-series SSTs. Waste from the 100-series tanks is planned to be transferred to double-shell tank (DST) storage. Initially modified sluicing campaigns are planned for the 241-S, 241-C, and 241-U tank farms. This safety evaluation is based on two separate designs originally prepared for SSTs 241-C-106 and 241-S-112; however, the design for these two tanks is expected to be bounding for future tanks to be modified sluiced. When the system designs and processes for the retrieval of these subsequent tank farms' 100-series tanks are established, the analysis of this safety evaluation will be reviewed via the Unreviewed Safety Question process to determine whether this analysis satisfactorily bounds the retrievals from these subsequent tank farms.

Revision 2 of this document adds Appendix D, which is a safety evaluation for modified sluicing with DST supernatant in SST 241-S-102.

Revision 3 of this document adds Appendix E, which is a safety evaluation for modified sluicing with DST supernatant in SST 241-C-103.

Revision 4 of this document evaluates the potential for higher than expected ventilation flow rates for the high-efficiency particulate air (HEPA) filter filtration failures leading to unfiltered releases accident. The higher than expected ventilation flow rates were due to the re-evaluation of the variable frequency drives of the ventilation system.

This page intentionally left blank.

2.0 DESCRIPTION OF THE SINGLE-SHELL TANK MODIFIED SLUICING WASTE RETRIEVAL SYSTEM DESIGN AND PROCESS

SST modified sluicing waste retrieval systems will retrieve waste from designated tanks to the extent needed for tank closure and transfer the retrieved waste to the DST system. The SST modified sluicing waste retrieval system is designed to dissolve SST crystallized salt and to mobilize sludge through the application of high pressure water or supernatant spray to break down the waste salt, sludge, and solids and to direct the waste to the intake of a slurry transfer pump for transfer into the DST system. Various SST waste retrieval system sluicing designs may be used. Each system uses sluicing nozzles, waste transfer pump(s), monitoring and control systems, portable exhauster ventilation, and new and existing waste transfer systems. Support systems necessary for the sluicing design include raw water and electrical supply.

The SST waste retrieval system sluicing designs employ remote controlled or automatic sluicing nozzles that are strategically placed and installed in the tank headspace via SST risers. The number of sluicing nozzles can vary depending on the amount and location of solidified waste within the SST. Current sluicing designs rely upon one to six sluicing nozzles. The nozzle system is designed to aim pressurized fluid (raw water or SST supernatant) that will break up, mobilize, and move the sludge, dissolved saltcake, and compacted solids slurry to a location where they are picked up by a slurry transfer pump. The design flow rate of the remote operated sluicing nozzles is variable up to approximately 100 gal/min with normal operating pressures up to approximately 100 lb/in². The automatic self-indexing sluicers operate at a flow rate of approximately 20 gal/min. The nozzle spray range will cover a minimum range of 30 ft up to a maximum range of approximately 75 ft. The sluicers are capable of 360 degree rotation in the horizontal, and vertical pan and tilt from 0 degrees to 90 degrees.

The nozzles are remotely directed from a control trailer by use of hydraulic or electric controls. Automatic self-indexing sluicing nozzles may also be used that do not require operator action.

SST waste retrieval system sluicing designs use different pump configurations that could include one or two pumps in series for waste retrieval, with the possibility of the addition of a separate supernatant recirculation pump. The primary waste retrieval pump(s) are typically located near the center of the SST. The pump(s) are physically located within the SST or external to the tank in an enclosed structure, with the pump suction draw located near the tank bottom. Pump designs include centrifugal pumps and progressive cavity positive displacement pumps. Except for positive displacement pumps where higher pressures are possible, the slurry transfer pumps operate at flow rates and pressures bounded by existing waste transfer pumps (see Section 2.4.2.3). An SST supernatant recirculation pump may be used during the sluicing operation to provide recirculation capability to the sluicing system. The supernatant recirculation pump operates at a nominal 100 gal/min at 100 lb/in².

Dilution water may be used to aid in the retrieval process by diluting the slurry to the appropriate specific gravity conducive to waste transfer. Dilution water can also be supplied to flush the slurry transfer pump and/or the waste transfer line. Dilution water can be added at up to approximately 100 gal/min, with a nominal flow rate of 50 gal/min.

Operators located within a control trailer direct the monitoring and control system. The control trailer could be located within the tank farm or nearby outside the fenced boundary. The control trailer contains sluicing operation controls and closed-circuit television monitors and controls. The sluice nozzles are remotely operated using joysticks and observed via the television monitors displaying the view from cameras located within the source SST. In-tank lighting is used to enhance in-tank camera viewing. During retrieval operations, the video cameras provide visual feedback on the waste mobilization process; assisting operations in the control of water or supernatant spray application and moving slurry to the transfer pump suction.

Process parameters that are monitored during the sluicing process include system temperatures, pressures, waste temperature and density, flow rates of the system, and raw water flow and waste transfer volume. Liquid depth in the SST pool is also monitored.

Active ventilation is connected to the SST to aid the sluicing operations by removing aerosols and/or fog generated during sluicing to enable better visual monitoring capability. The tank ventilation system is comprised of an inlet HEPA filter, a portable exhauster, and a demister. The portable exhauster contains a heater, pre-filter, two stages of HEPA filters, a fan, an exhaust stack, an effluent monitoring system, and ventilation stack continuous air monitor interlock system. The portable exhausters use variable speed blowers that normally operate at between 100 ft³/min and 1,000 ft³/min but have been analyzed up to 5,600 ft³/min.

The slurry transfer pumping system is connected to either an existing underground waste transfer system or to a hose-in-hose transfer line (HIHTL) that is used to transfer the retrieved waste to the DST system. The HIHTL is heat traced and insulated. The waste transfer system includes required leak detection and alarm capabilities.

The SST waste retrieval system sluicing designs use raw water and electric power. Raw water is provided to the sluicing nozzles and auxiliary equipment. Backflow preventers or service water pressure detection systems are used to assure that no contamination of the raw water supply can occur. Raw water supply may be heat traced and insulated as necessary. Heated water may also be provided.

Electric power is used to power the operation control trailers, the portable exhausters, electric pump motors, raw water and waste transfer line heat tracing, and the process monitoring and control systems, including leak detection and alarms. Electric power is provided via connection to the Hanford Site power distribution system or via portable power generators.

3.0 HAZARD ANALYSIS

3.1 HAZARD IDENTIFICATION

SST modified sluicing waste retrieval system operations are proposed activities that have not been approved under the DSA; however, approval of modified sluicing waste retrieval system operations is approved under the final safety analysis report for SSTs 241-S-112 and 241-U-107 via ORP SER 03-TED-066 and SST 241-C-106 via a negative Unreviewed Safety Question and ORP SER 03-TED-029, "Approval of Interim Authorization Using Alternate Controls Related to the Operation of Active Ventilation on Single-Shell Tank (SST) 241-C-106 During Accelerated Waste Retrieval," which allowed for the passive breather filter to be closed during active ventilation.

A Hazards and Operability Study (HAZOP) was performed to identify and evaluate potential hazards associated with the SST modified sluicing waste retrieval system for 100-series SSTs retrieval. In addition, HAZOPs performed on SSTs 241-S-112 (RPP-9014, *Process Hazards Analysis for the S-112 Saltcake Waste Retrieval Technology Demonstration Project Preconceptual Design*), 241-U-107 (RPP-7689, *Hazard Evaluation for Single-Shell Retrieval Via Salt Cake Dissolution Proof of Concept in Tank 241-U-107*), and 241-C-106 (RPP-13557, *Safety Evaluation of the Phase I Retrieval of Liquid Waste from Single-Shell Tank 241-C-106*) were reformatted to conform with the DSA and were added to the modified sluicing HAZOP.

The results of the combined HAZOPs were reviewed to identify potential hazardous conditions associated with the modified sluicing waste retrieval system that may not be adequately bounded or represented by the DSA analyzed representative accidents.

3.2 METHODOLOGY

The hazards identification and evaluation of modified sluicing waste retrieval system operations used the HAZOP method. A HAZOP is a systematic process for identifying potential causes and consequences of off-normal conditions in a system or process. The HAZOP uses a team leader to guide an interdisciplinary team of subject matter experts (Appendix A) in evaluating a system or process. The HAZOP process is based on "brainstorming" and uses a standardized set of process parameters (e.g., temperature, pressure, flow) and guide words (e.g., high, low, part of, reverse) to facilitate the "brainstorming." Table 3-1 presents a list of process parameters and guide words. The HAZOP team also established consequence and frequency estimates for radiological and toxicological effects to three receptor categories. These are offsite individual, onsite worker, and facility worker. Each hazardous condition was evaluated using a qualitative estimation process, without consideration of the application of any controls. The definitions/criteria for the information developed during the HAZOP process are found in Appendix B.

Table 3-1. Deviation Guide For Process Variables.

Guide Words Process Parameter	NO, NOT,1 NONE	LESS, LOW, SHORT	MORE, HIGH, LONG	PART OF	AS WELL AS, ALSO	OTHER THAN, WHERE ELSE	REVERSE
FLOW	No Flow	Low Rate, Low Total	High Rate, High Total	Misdirection, Material in Inappropriate Areas	Contamination, Impurities	Wrong Material	Backflow
PRESSURE	Open to Atmosphere	Low Pressure	High Pressure	--	--	--	Vacuum
TEMPERATURE	Freezing	Low Temperature	High Temperature	--	--	--	Auto-refrigeration
LEVEL	Empty	Low Level	High Level	Low Interface	High Interface	--	--
CONFINEMENT	No Confinement	Degraded Confinement	--	--	--	Bypass Pathway	--
TIME PROCEDURE	Skipped or missing Step	Too Short, Too Little	Too Long, Too Much	Action(s) Skipped	Extra Action(s) (Shortcuts)	Wrong Action	Out of Order, Opposite
SPEED	Stopped	Too Slow	Too Fast	Out of Sync	--	Web or Belt Break	Backward
COMPOSITION/ CONCENTRATION	Missing Ingredient	Less Ingredient/ Low Concentration	More Ingredient/ High Concentration	Missing Ingredient	Contaminant/ Additional Ingredient	Wrong Ingredient	--
Ph	--	Low pH	High pH	--	Additional Acid, Additional Base	Wrong Acid, Wrong Base	--
VISCOSITY	--	Low Viscosity	High Viscosity	--	--	--	--
VOLTAGE	No Voltage	Voltage Low	Voltage High	Wrong Waveform	Interference Voltage	Wrong Frequency, AC instead of DC DC instead of AC	Wrong Polarity
CURRENT	No Current	Current Low	Current High	--	--	Current Fluctuating	Wrong Polarity
STATIC	No Static Charge (when required)	--	Static Charge	--	--	--	--
AGITATION	No Mixing	Poor Mixing	Excessive Mixing	Mixing Interruption	Foaming	--	Phase Separation
REACTION	No Reaction	Slow Reaction	Runaway Reaction	Partial Reaction	Side Reaction	Wrong Reaction	Decomposition
STRUCTURAL INTEGRITY	Structural Failure	Less Integrity	More Integrity	--	--	--	--
SHIELDING	No Shielding	Less Shielding	More Shielding	--	--	Wrong Type of Shielding	--
SPECIAL	Utility Failure	External Leak	External Rupture	Tube Leak	Tube Rupture	Startup, Shutdown, Maintenance	--

The expertise and experience of the HAZOP team is of primary importance in establishing the credibility of the analysis because of the largely qualitative nature of the HAZOP process. The attendance roster is included in Appendix A to document the presence of each team member. The HAZOP process is recognized by the American Institute of Chemical Engineers (AIChE) and is described in *Guidelines for Hazard Evaluation Procedures* (AIChE 1992).

One of the important features of a HAZOP is the division of a process or activity into discrete segments called nodes. Node selection is designed to facilitate the hazard identification process by focusing the attention of the team on specific process sections or operating steps. The team applies the HAZOP process to each node in a stepwise fashion. The waste retrieval system HAZOP for the modified sluicing system was based on the following nodes to capture points in the process where deviations could result in significant consequences:

- Node A: Equipment installation and decommissioning
- Node B: Water supply system, including flush systems for transfer lines
- Node C: Sluicing system
- Node D: Transfer pump
- Node E: Transfer lines, SST to DST and SST recirculation
- Node F: SST ventilation system
- Node G: DST receiver tank ventilation system
- Node H: SST being retrieved
- Node I: DST receiver tank
- Node J: Instrumentation and camera system
- Node K: Criticality Concerns (what if?).

The hazardous conditions presented under Node K are intended to indicate that the hazard evaluation team performed a broad brush "what if" evaluation to ensure that criticality concerns are appropriately addressed.

The HAZOP results were used as input for this safety evaluation to identify and evaluate hazardous conditions that may not be adequately addressed by the tank farms safety basis.

The HAZOP data was used in this safety evaluation to compare the identified hazardous conditions to the DSA representative and/or candidate accidents. The safety evaluation includes consideration of the safety basis controls (i.e., safety SSCs and technical safety requirements [TSR]), which the HAZOP did not consider. Any HAZOP identified hazardous conditions that were estimated not to be adequately addressed by the DSA accident analysis and controls are discussed in this safety evaluation.

3.3 ASSUMPTIONS

No key assumptions were identified for this safety evaluation.

3.4 HAZOP RESULTS

The HAZOP team identified 111 hazardous conditions associated with operation of the SST waste retrieval modified sluicing system. The team used the consolidated hazardous conditions from the HAZOPs for SSTs 241-S-112 (RPP-9014), 241-U-107 (RPP-7689), and 241-C-106 (RPP-13557) and the Justification for Continued Operation for modified sluicing in SSTs 241-S-112 and 241-U-107 as a starting point, identifying new hazardous conditions as necessary.

3.5 HAZARDOUS CONDITION SCREENING

Hazardous conditions were screened to determine if they 1) are not represented by a DSA representative accident, 2) are similar to, but not bounded by a DSA representative accident, 3) are similar to and bounded by a DSA representative accident but are unique in regard to process or control applicability, or 4) are not appropriately represented by a candidate accident. Hazardous conditions meeting one or more of these criteria require further evaluation. Chapters 4.0 and 5.0 of this safety evaluation document the evaluation of these hazardous conditions. Hazardous conditions not meeting the screening criteria were not further evaluated and will not be incorporated into the DSA hazard evaluation database.

Hazardous conditions involving exposure to radioactive and other hazardous materials were assigned a representative accident and/or a candidate accident designator as appropriate. The representative accident designator allows cross reference to the appropriate analysis in the DSA. Candidate accident designators allow hazardous conditions to be compared with the hazardous conditions contained in the DSA hazard evaluation database. Thirty-one hazardous conditions were identified as meeting the screening criteria and are presented in Appendix C. The information in Appendix C reflects the final results of this safety evaluation.

The break down of these hazardous conditions is as follows:

- 10 Representative Accident 1, Flammable Gas Accidents (Candidate Accidents 04/05)
- 6 Representative Accident 2, Nuclear Criticality (Candidate Accident 01)
- 3 Representative Accident 4, Release from Contaminated Facility (Candidate Accident 07)
- 3 Representative Accident 13, Waste Transfer Leak (Candidate Accident 33)
- 8 *Identifiable to a Candidate Accident but DSA Hazardous Conditions Determined to be Risk Bin III or IV (i.e., no Representative Accident identified), Filtration Failures Leading to Unfiltered Releases (Candidate Accidents 06/18B)*
- 1 *Identifiable to a Candidate Accident but DSA Hazardous Conditions Determined to be Risk Bin III or IV (i.e., no Representative Accident identified), Tank Bump (Candidate Accident 18A)*

3.6 DETAILED DISCUSSION

The following text provides a brief discussion of the specific reasons that hazardous conditions were identified for further evaluation:

Ten hazardous conditions involving flammable gas accidents (Representative Accident 1, Candidate Accident 05, deflagrations in other than DSTs) were identified as having the characteristics sufficiently different from the hazardous conditions in the DSA hazard evaluation database to warrant further evaluation. The specific concern involves deflagrations resulting from induced gas release events (GRE). The process of retrieving waste by sluicing from an SST has the potential for creating induced releases of flammable gas that were not evaluated in the DSA.

Hazardous conditions involving nuclear criticality (Representative Accident 2, Candidate Accident 01) were identified that are very similar to the hazardous conditions in the DSA hazard evaluation database. They are included with the hazardous conditions requiring further evaluation to ensure that criticality concerns are verified as adequately addressed.

Three hazardous conditions involving release from contaminated facility (Representative Accident 4, Candidate Accident 07) were identified as having characteristics sufficiently different from the hazardous conditions in the DSA hazard evaluation database to warrant further evaluation. The concern is associated with the possible use of a hydraulic motor driven positive displacement transfer pump, hydraulically powered nozzle indexer (rotation), and hydraulically powered articulation actuator (radial position). Use of hydraulic power creates the potential for combustible fluid to be released and ignited in a contaminated area pit which is not addressed in the current DSA.

Three hazardous conditions involving waste leaks (Representative Accident 13, Candidate Accidents 33A, 33C, and 33E) were identified as having characteristics sufficiently different from the hazardous conditions in the DSA hazard evaluation database to warrant further evaluation. The specific concerns involve the potential for transfer system pressures higher than what was evaluated in the current DSA analysis. This is due to the use of a progressive cavity positive displacement pump to transfer mobilized waste from an SST. Positive displacement pumps have the potential for producing very high pressures under the off-normal conditions.

Eight hazardous conditions associated with filtration failures leading to unfiltered releases (Candidate Accidents 06 and 18B) were identified as having higher consequences than reported in the DSA. The specific concern involves the potential for the release source term to be greater than what was used in the current DSA analysis.

One hazardous condition associated with tank bump (Candidate Accident 18A) was identified as having characteristics sufficiently different from the hazardous conditions in the DSA hazard evaluation database to warrant further evaluation. The specific concern involves water infiltration and subsequent steam evolution behind the steel SST liner. Such an event has happened in the tank farms in the past. The current DSA control suit does not address this accident. However, based on the following qualitative argument, no discussion is necessary in Chapters 4.0 or 5.0 of this safety evaluation.

Tank bump resulting from water intrusion behind an SST liner is judged to have a frequency “beyond extremely unlikely. Hazardous conditions with a frequency of “beyond extremely unlikely” require no further evaluation. The frequency estimate is based on the fact that a heat load of > 11.3 kW is required to result in waste temperatures that exceed the saturation temperature of water (RPP-6213). Only four SSTs (241-A-104, 241-AX-104, 241-C-103, and 241-C-107) have heat loads in excess of 11.3 kW (RPP-5926, *Steady-State Flammable Gas Release Rate and Lower Flammability Level Evaluation for Hanford Tank Waste*). Current waste temperature data shows that these tanks are well below the saturation temperature of water. The highest temperature found in these four tanks is 76 °C (168.8 °F) (SST 241-A-104). These tanks have been under passive cooling conditions for many years and show no trend of increasing temperature. Since the temperature is substantially below the saturation of water there is no possibility of steam bubble formation behind the tank liner no matter what quantity of water is involved.

4.0 ACCIDENT ANALYSIS

4.1 EVALUATION OF RISK FROM MODIFIED SLUICING OF WASTE FOR DSA REPRESENTATIVE ACCIDENTS

4.1.1 Flammable Gas Accidents

4.1.1.1 DSA Representative Accident

The DSA related representative accident is (Candidate Accident 04/05), Flammable Gas Accidents and is addressed in DSA Section 3.3.2.4.1, "Flammable Gas Accidents," addresses this hazardous condition. The DSA evaluates flammable gas hazards in all tank farm facilities where waste is present, including DSTs, SSTs, double-contained receiver tanks (DCRT), active catch tanks, inactive tanks, waste transfer-associated structures, waste transfer systems, and waste-intruding equipment. There are two mechanisms by which waste-generated flammable gases can reach high concentrations in tank farm facilities. First, flammable gases generated by the waste are continuously released into vapor spaces. In the absence of adequate ventilation, the steady-state concentration of these gases can potentially exceed the lower flammability limit (LFL). Second, a fraction of the gas generated by the waste can be retained within the waste. This retained gas can be released in a spontaneous or induced GRE thereby increasing the flammable gas concentration in a tank headspace to above the LFL.

The representative accident for DSTs (Candidate Accident 04) is a headspace deflagration due to a steady-state accumulation of flammable gas or a spontaneous GRE. Without controls, the DSA qualitatively determined the frequency of a headspace deflagration in a DST due to a steady-state accumulation of flammable gases or a spontaneous GRE to be "unlikely." The deflagration in the headspace of a DST is qualitatively determined to result in "low" onsite radiological consequences, "low" offsite toxicological consequences, and "moderate" onsite toxicological consequences. Safety-significant structures, systems, and components (SSC) and/or TSRs are required based on the Risk Bin II result associated with the onsite toxicological consequences.

Other hazardous conditions associated with the DST flammable gas representative accident address various DST deflagration scenarios (e.g., different flammable gas sources, different ignition sources). The other accident scenarios identified in the DSA as requiring safety-significant SSCs and/or TSRs based on either their risk binning results or their potential for significant facility worker consequences are DST Headspace Deflagration Due to an Induced GRE, Deflagration in a DST Annulus, Deflagration in DST Waste-Intruding Equipment, Deflagration in a Waste Transfer Line, and DST Gasoline Deflagration. The DST accident scenarios relevant to modified sluicing operations are summarized below:

- **DST Headspace Deflagration Due to an Induced GRE.** This hazardous condition is identical to the representative accident except that the flammable gas concentration in the headspace reaches the LFL due to an induced GRE. As documented in PNNL-13781, *Effects of Globally Waste-Disturbing Activities on Gas Generation, Retention, and Release in Hanford Waste Tanks*, activities with the potential to induce a significant GRE

in DSTs are waste transfers, mixer pump operation, air lift circulator operation, and large water or chemical additions. Because these are current or planned activities, the frequency without controls was qualitatively determined to be “anticipated.”

Safety-significant SSCs and/or TSRs are required based on the Risk Bin I result associated with the onsite toxicological consequences.

- **Deflagration in DST Waste-Intruding Equipment.** Waste-intruding equipment is equipment that is inserted below the waste surface and is open ended, breached, or uses a mechanical seal as a barrier to electrical components and creates an unvented vapor space where flammable gases generated or retained in the waste may accumulate (e.g., core sample drill pipes, pump suction legs, weight factor dip tubes). Incidents have occurred where the concentration of flammable gas in waste-intruding equipment has exceeded the LFL. These incidents were attributed to the equipment encountering gas pockets in the waste. Flammable gas concentrations exceeding the LFL in waste-intruding equipment have also resulted from steady-state generation and accumulation. Given this operational history, the frequency of a deflagration in waste-intruding equipment without controls was qualitatively determined to be “anticipated.” The consequences were qualitatively determined to be “low” for the onsite and offsite receptors due to the localized nature of the deflagration and the smaller material at risk (MAR) relative to the representative accident. This frequency/consequence combination yields a Risk Bin III result for the onsite and offsite receptors. It was, however, qualitatively determined that a deflagration in waste-intruding equipment could result in significant facility worker consequences (i.e., a prompt fatality or serious injuries or significant radiological or chemical exposures). Accordingly, safety-significant SSCs and/or TSRs are required. This evaluation is also applicable to waste-intruding equipment in SSTs.
- **Deflagration in a Waste Transfer Line.** There is limited potential for flammable gas accumulation and ignition in either the primary or encasement piping of a waste transfer line. The frequency of a deflagration without controls was qualitatively determined to be “unlikely.” The consequences were qualitatively determined to be “low” for the onsite and offsite receptors due to the limited volume of hydrogen and the smaller MAR relative to the representative accident. This frequency/consequence combination yields a Risk Bin III result for the onsite and offsite receptors. It was, however, qualitatively determined that a deflagration in a waste transfer line could result in significant facility worker consequences (i.e., a prompt fatality or serious injuries or significant radiological or chemical exposures). Accordingly, safety-significant SSCs and/or TSRs are required.

The representative accident for SSTs (Candidate Accident 05) is a headspace deflagration due to a steady-state accumulation of flammable gas. Without controls, the DSA qualitatively determined the frequency of a headspace deflagration in an SST due to a steady-state accumulation of flammable gas to be “unlikely.” The deflagration in the headspace of an SST is qualitatively determined to result in “moderate” onsite radiological consequences, “low” offsite toxicological consequences, and “moderate” onsite toxicological consequences. Safety-significant SSCs and/or TSRs are required based on the Risk Bin II result associated with the onsite radiological and toxicological consequences.

Other hazardous conditions associated with the SST flammable gas representative accident address various SST deflagration scenarios (e.g., different flammable gas sources, different ignition sources). The other accident scenarios identified in the DSA as requiring safety-significant SSCs and/or TSRs based on either their risk binning results or their potential for significant facility worker consequences are SST Headspace Deflagration Due to an Induced GRE, Deflagration in SST Waste-Intruding Equipment, SST Gasoline Deflagration, Deflagration in a Double-Contained Receiver Tank, Deflagration in an Active Catch Tank, Deflagration in a Waste Transfer-Associated Structure, Deflagration in a Waste Transport Cask, and Deflagration in Inactive Tanks. The accident scenarios relevant to modified sluicing operations are summarized below:

- **SST Headspace Deflagration Due to an Induced GRE.** This hazardous condition is identical to the representative accident except that the flammable gas concentration in the headspace reaches the LFL due to an induced GRE. As documented in PNNL-13781, activities with the potential to induce a significant GRE in SSTs are saltwell pumping and water additions/saltcake dissolution. Because these are planned activities, the frequency without controls was qualitatively determined to be “anticipated.” Safety-significant SSCs and/or TSRs are required based on the Risk Bin I result associated with the onsite radiological and toxicological consequences.
- **Deflagration in SST Waste-Intruding Equipment.** Refer to the DST summary above.
- **Deflagration in a Waste Transfer-Associated Structure.** There are two means by which flammable gas can be present in a waste transfer-associated structure. First, flammable gases can enter a structure if it is connected via open piping, drain lines, or risers to an SST, DST, or other waste storage facility. Second, flammable gases would be produced if waste were present in a structure due to a waste transfer misroute or transfer line failure. In the absence of controls, the flammable gas concentration could exceed the LFL via either means.

The frequency and consequences of flammable gas deflagrations in typical waste transfer-associated structures (e.g., pump pits, valve pits) are qualitatively addressed in DSA Section 3.3.2.4.4. The frequency of a postulated flammable gas deflagration in a waste transfer-associated structure without controls depends on the source of the flammable gas hazard (e.g., flammable gases entering from a connected tank, flammable gases generated by waste from a new or past leak) with the highest frequency being “anticipated.” The radiological consequences to the onsite worker and toxicological consequences to the offsite public are qualitatively determined to be “low,” and the toxicological consequences to the onsite worker are qualitatively determined to be “moderate.” Safety-significant SSCs and/or TSRs are required based on the Risk Bin II result associated with the onsite toxicological consequences.

4.1.1.2 Modified Sluicing Operations Hazardous Conditions

The HAZOP for modified sluicing systems and operations described in Chapter 3.0 identified potential hazardous conditions that could result in a flammable gas deflagration. However, the only hazardous conditions identified that require additional safety evaluation are associated with

the induced release of flammable gases caused by modified sluicing operations in SSTs. The other identified flammable gas hazardous conditions are addressed by the existing DSA hazard and accident analyses and derived controls (i.e., safety SSCs and/or TSRs), and no further evaluation is required. This section, therefore, only evaluates induced GRE flammable gas hazardous conditions in SSTs caused by modified sluicing operations.

During modified sluicing operations in SSTs flammable gases retained in the waste will be released. Trapped gases exist as small bubbles in the interstices of the solid waste matrix, separated from other bubbles and the headspace by interstitial liquid. During modified sluicing operations, drainage of the interstitial liquid from the undisturbed solid waste matrix, dissolution of the saltcake matrix, and mechanical break-up of the solid waste matrix will release trapped gases. Draining reduces the tank interstitial liquid level, releasing any entrained gas bubbles. Waste dissolution involves liquid addition causing saltcake to dissolve, thus releasing any trapped gas. Mechanical disturbance of the waste such as by sluicing, vortex action, or pump suction and return, causes shear forces on the solid waste matrix releasing entrained gas bubbles. All three of these gas release mechanisms (draining, dissolution, and mechanical disturbance) individually and collectively contribute to the flammable gas concentration within the SST headspace during modified sluicing operations.

PNNL-14271, *Flammable Gas Release Estimates for Modified Sluicing Retrieval of Waste from Selected Hanford Single-Shell Tanks*, evaluates the potential for induced GRE flammable gas hazards in SSTs during modified sluicing operations. Models developed to estimate retained gas releases, conservative retained gas inventory estimates, tank data, and anticipated waste retrieval rates were used to evaluate the dissolution and erosion of saltcake by water jets impinging on the waste surface, and the drainage of interstitial liquids from saltcake and the dissolution of saltcake by unsaturated liquids during a shutdown of modified sluicing operations.

The results of the evaluation in PNNL-14271 show that under conservative assumptions the flammable gas concentration in the SST headspace can rapidly approach 25% of the LFL when the tank is passively ventilated (e.g., for SST 241-S-112, 25% of the LFL is reached in just over 8 hr). Use of a portable exhauster within the assumed operating range of 270 to 475 ft³/min prevents the SST headspace from reaching 25% of the LFL. Conservative estimates of gas release volumes after modified sluicing shutdown show that SST headspace flammable gas concentrations could exceed 100% of the LFL assuming no ventilation, complete interstitial drainage, and release of all retained gas from the region above the final interstitial liquid level. The free liquid inventories in an SST (i.e., maximum allowable tank inventory of process water and minimum level of liquid in the central pool) that would prevent exceeding 100% of the LFL in the SST headspace after modified sluicing shutdown are calculated.

4.1.1.3 Accident Consequence Comparison

The consequences of a flammable gas deflagration caused by an induced GRE during modified sluicing operations are bounded by the DSA analysis of SST deflagrations (i.e., “moderate” onsite radiological consequences, “low” offsite toxicological consequences, and “moderate” onsite toxicological consequences). That is, material source terms, release fractions, and airborne respirable fractions are bounded by the DSA analysis for deflagration in an SST.

4.1.1.4 Accident Frequency Comparison

Flammable gas deflagrations due to induced GRE flammable gas hazardous conditions caused by modified sluicing operation in SSTs was qualitatively determined to be “anticipated” which is the same as the frequency of the induced GRE accident scenario in the DSA.

4.1.1.5 Accident Risk Bin Results Without Controls

Based on the risk binning methodology presented in the DSA, an induced GRE flammable gas deflagration accident caused by modified sluicing operations in an SST with an “anticipated” frequency results in a Risk Bin I for onsite radiological and toxicological (moderate consequence) and Risk Bin III for offsite toxicological (low consequence).

4.1.1.6 Safety-Significant SSCs and TSR Controls

Based on the hazard evaluation of postulated induced GRE flammable gas hazards in SSTs caused by modified sluicing operations, safety-significant SSCs and/or TSRs are required to protect the onsite (and facility) worker. For induced GRE flammable gas hazards in the DSA, there are no identified safety-significant SSCs, but the following TSR is established to prevent induced GRE flammable gas hazards.

A flammable gas concentration control point of $\leq 25\%$ of the LFL shall be implemented for all tank farm facilities during activities that can induce a gas release that can achieve 100% of the LFL without the use of flammable gas concentration controls (e.g., active or manually configured passive ventilation, process controls, flammable gas concentration monitoring and proceduralized actions). Any combination of flammable gas concentration controls may be used to maintain the flammable gas concentration $\leq 25\%$ of the LFL. Flammable gas concentration controls shall be monitored on a sufficient frequency to ensure that appropriate actions are taken for conditions $> 25\%$ of the LFL.

Flammable gas concentration controls shall be documented in a process control plan such that the flammable gas concentration is maintained $\leq 25\%$ of the LFL. A process control plan will not be required for saltwell pumping.

If the concentration of flammable gas is $> 25\%$ of the LFL:

1. Immediately stop all activities in and directly above the affected tank, except for the following:
 - a. Flammable gas sampling/monitoring.
 - b. Deenergizing, removing, or stopping the use of equipment that does not meet ignition controls.
 - c. Actions to reduce the flammable gas concentration.

2. Prior to the concentration of flammable gas exceeding 60% of the LFL:
 - a. Stop all activities in enclosed spaces connected to the affected tank headspace, except for flammable gas sampling/monitoring and actions to reduce the flammable gas concentration.
 - b. Deenergize, remove, or stop use of equipment that does not meet ignition controls in the affected tank headspace and connected enclosed spaces.

The flammable gas concentration controls selected as an acceptable method to implement this TSR for modified sluicing operations are :

1. Develop process controls such that the anticipated flammable gas concentration in Waste Group B SSTs is maintained $\leq 25\%$ of the LFL for modified sluicing operations. (Note: Active ventilation may be used to maintain the flammable gas concentration $\leq 25\%$ of the LFL.)
2. Periodically monitor the flammable gas concentration in the tank headspace to verify that it is $\leq 25\%$ of the LFL during modified sluicing operations in Waste Group B SSTs. If the flammable gas concentration is $> 25\%$ of the LFL, take the actions prescribed in the TSR. (Note: Actions taken if the flammable gas concentration is $> 25\%$ of the LFL include stopping modified sluicing operations.)

Note: There are no Waste Group A SSTs, and there is no induced GRE flammable gas hazard in Waste Group C SSTs (i.e., there is insufficient retained gas to achieve 100% of the LFL if 100% of the retained gas was instantaneously released) and, therefore, induced GRE flammable gas concentration controls are not required.

The specific process controls to maintain the flammable gas concentration $\leq 25\%$ of the LFL (e.g., active ventilation) and the periodicity for monitoring the flammable gas concentration in the tank headspace will be specified in the process control plan. The flammable gas monitoring frequency will be based on a conservative evaluation of the time for the flammable gas concentration to increase by 25% of the LFL (e.g., PNNL-14271). For example, based on the evaluation of SST 241-S-112 in PNNL-14271 (see Section 4.1.1.2), the frequency of flammable gas monitoring would be at least once every 8 hr. Periodic flammable gas monitoring would also continue after shutdown of modified sluicing operations until a downward trend is observed that demonstrates that 25% of the LFL will not be exceeded.

In addition to the above flammable gas concentration controls, if active ventilation is required to maintain the flammable gas concentration $\leq 25\%$ of the LFL, process controls will be developed such that the flammable gas concentration is maintained $\leq 100\%$ of the LFL following the loss of active ventilation and shutdown of modified sluicing operations. The specific process controls (e.g., maximum allowable tank inventory of process water and minimum level of liquid in the central pool derived in the PNNL-14271 evaluation) will be specified in the process control plan.

4.1.1.7 Conclusions

Potential flammable gas hazards caused by modified sluicing operations are addressed and bounded by the DSA representative accidents. Postulated flammable gas accidents are also acceptably controlled by existing safety SSCs and TSRs, and no additional controls are necessary. Specific flammable gas concentration controls to implement the existing TSR requirement for induced flammable gas hazard controls have been defined.

4.1.2 Criticality

4.1.2.1 DSA Representative Accident

The DSA-related representative accident is 02 (Candidate Accident 01), Nuclear Criticality. The technical basis for the nuclear criticality safety of waste stored in underground tanks at the Hanford Site is summarized in DSA Section 3.3.2.4.2, "Nuclear Criticality." The DSA analysis postulated a mistransfer of waste from the Plutonium Finishing Plant that was routed to a DST where a criticality occurred.

The DSA indicates that no credible scenario has been identified for a criticality in a waste tank because of normal operations of waste storage. The potential for a criticality as a result of a mistransfer was analyzed. The potential for an accidental criticality without controls was estimated to be "beyond extremely unlikely." The criticality accident onsite radiological and onsite and offsite toxicological consequences are "low" (i.e., < 25 rem, < TEEL-1, and < TEEL-2, respectively). Based on the estimated consequences and qualitative judgment, all the exposure categories were assigned to Risk Bin IV, which typically do not require safety SSC or TSR-level controls. However, one TSR-level control was selected to protect the frequency assumption as described in the DSA.

4.1.2.2 Waste Retrieval System Operations Hazardous Conditions

The modified sluicing waste retrieval system HAZOP concluded the potential for a criticality in the source SST and the receiving DST to remain in Risk Bin IV.

4.1.2.3 Accident Frequency Comparison

RPP-7475, *Criticality Safety Evaluation of Hanford Site Tank Farm Facility*, Section 2.8, "Sludge Retrieval Process Description," describes tank farm waste retrieval operations. Criticality concerns associated with sludge retrieval operations were evaluated in RPP-7475, Section 6.13, "Sludge Retrieval." The tank sludge contains most of the plutonium inventory of the tanks, which could create a criticality concern. Sludge retrieval operations involving waste retrieval modified sluicing operations were evaluated in RPP-7475. It was concluded that criticality due to sludge retrieval operations was not a concern. Sludge retrieval operations were considered to be the same as previously analyzed fluid dynamic sludge systems, specifically mixer pumps, air lift circulators, or sluicing relative to potential to create a criticality. Based on the evaluation in RPP-7475, it is concluded that criticality due to waste retrieval modified sluicing system operations remains "beyond extremely unlikely" without application of controls,

and therefore, there is no increase in the frequency of a criticality accident as analyzed in the DSA.

4.1.2.4 Accident Consequence Comparison

The consequence of an unplanned nuclear criticality in a waste tank includes release of fission gases, small amounts of aerosolized plutonium, and tank waste (DSA, Section 3.3.2.4.2.3).

A criticality due to modified sluicing system operations would not result in an increase in SST source term considering the MAR, leak path factors (LPF), airborne release fractions (ARF), or respirable fraction (RF). As such, there would be no increase in potential radiological dose consequences from the SST being retrieved. A qualitative evaluation of the consequences of a nuclear criticality accident is described in RPP-12371, *Technical Basis for the Nuclear Criticality Accident and Associated Represented Hazardous Conditions*. Based on a review of this document, it is concluded that the DSA analysis unit-liter dose (ULD) values bound the ULD values of DST liquids and the ULD of the slurry mixture to be transferred from the 100-series SSTs. As such, the DSA representative accident analysis radiological dose consequences remain bounding for a criticality from modified sluicing system operations.

4.1.2.5 Safety SSCs and TSR Controls

Administrative Control (AC) 5.7, "Safety Management Programs," Section 5.7.2, Program Key Element "a" requires that the safety management programs (SMP) of DSA Chapters 6.0 through 17.0 to be established, implemented, and maintained. Chapter 6.0 of the DSA outlines the criticality safety program, which protects the assumptions on the current configuration of the tank waste with respect to criticality by establishing waste acceptance criteria (e.g., limits on fissile material concentration and alkalinity) for wastes entering the tank farms from outside sources. The criticality safety program also requires that criticality safety evaluations be performed for proposed tank farm operations that could change the form of the fissile material (e.g., dissociation of the fissile material from bound neutron absorbers by acid additions) or the distribution of the fissile material in the tanks (e.g., concentration of the fissile material).

4.1.2.6 Conclusions

A criticality evaluation of modified sluicing waste retrieval system operations concluded that a criticality was not credible. TSR controls are in place to ensure that the assumptions used to derive this conclusion remain valid. As such, the DSA representative accident remains bounding and no additional controls are necessary.

4.1.3 Release from Contaminated Facility

The DSA, Section 3.3.2.4.4, "Release from Contaminated Facility," provides the evaluation of this representative accident. Numerous contaminated areas exist within the tank farm facilities that are susceptible to releasing hazardous material, specifically during a fire. Contamination of tank farm facilities occurs from various operations required to manage tank waste. Contaminated facilities at the tank farms include waste transfer-associated structures (e.g., valve pits, pump pits, diversion boxes, clean-out boxes), 244-CR Vault cells, 242-T Evaporator, etc.

The hazard analysis performed for tank farm facilities and operations, including HNF-SD-WM-FHA-020, *Tank Farms Fire Hazards Analysis* (FHA), identify energy sources that could result in the uncontrolled release of radioactive and other hazardous material from contaminated tank farm facilities.

A qualitative evaluation of the frequency, consequences, and risk bin without controls for postulated release accidents from contaminated facilities, and the controls (i.e., safety SSCs and TSRs) selected to prevent or mitigate these previously analyzed accidents, are described in RPP-13354, *Technical Basis for the Release from Contaminated Facility Representative Accident and Associated Represented Hazardous Conditions*. These qualitative evaluations and the resulting controls for the uncontrolled release of radioactive and other hazardous material from contaminated facilities are addressed in Section 3.3.2.4.4 of the DSA.

4.1.3.1 DSA Representative Accident

A flammable gas deflagration in a waste transfer-associated structure is considered the bounding representative accident for a Release from a Contaminated Facility as discussed in the DSA. In this bounding accident scenario, flammable gases from a connected tank (e.g., DST, SST) or from waste present in the structure accumulate to the LFL and are ignited. Other identified energy sources that could result in uncontrolled releases from waste transfer-associated structures or other contaminated facilities include load-handling (e.g., load drop) accidents, compressed gas system failures, and other fires. Postulated causes of these other fires include electrical fires; fires due to maintenance activities (e.g., cutting, grinding, welding) and transient combustibles; and vehicle fuel fires. The FHA provides a complete description of the hazards investigated.

4.1.3.2 Waste Retrieval System Operations Hazardous Conditions

The waste retrieval modified sluicing system design introduces sluice nozzles and actuators that are hydraulically driven. These hydraulic lines, if ruptured, could leak into a pit and could be subject to internal fires (e.g., electrical or fluid) or exposed to vehicle fuel fires or other external fires (e.g., range fires or lighting initiated fires).

A HAZOP was performed to identify and evaluate potential hazards associated with SST waste retrieval modified sluicing system. The results of the HAZOP were reviewed to determine potential hazardous conditions created by the waste retrieval modified sluicing system and to identify potential hazardous conditions that may not be adequately bounded by current tank farms (DSA) analyzed representative accidents.

Hazardous conditions involving energy sources that could result in the uncontrolled release of radioactive and other hazardous material from contaminated tank farm facilities similar to those associated with the waste retrieval modified sluicing system have previously been considered in the DSA as Representative Accident Number 4 (Candidate Accident 7). A total of 11 hazardous conditions involving releases from contaminated facilities associated with the waste retrieval modified sluicing system operations were identified via the HAZOP process. The hazardous conditions expected during conduct of the waste retrieval modified sluicing system operations are similar to those previously identified in the tank farm operations hazards analysis database, Section 3.3.1.7, "Hazard Analysis Database," with the exception of the additional hydraulic line

rupture leaking hydraulic fluid into a pit. Three of these hazardous conditions were identified as having characteristics sufficiently different from the hazardous conditions in the DSA hazard evaluation database to warrant further evaluation (i.e., MODSLUIC-C-031, MODSLUIC-D-003a, and MODSLUIC-D-003b).

4.1.3.3 Accident Frequency Comparison

The frequency of a postulated fire within a contaminated structure without controls is dependent on the cause of the fire. An electrical fire, or fire due to maintenance activities or transient combustibles in a contaminated facility without controls, is also qualitatively estimated as “anticipated” based on operating experience. Since, the DSA estimated frequency for these accident scenarios is already “anticipated” without controls, the uncontrolled accident frequency cannot be increased by modified sluicing waste retrieval system operations. A frequency of “unlikely” however was determined qualitatively for this postulated hazardous condition and therefore bounded by the DSA estimated frequency of “anticipated.” “Unlikely” was chosen because the hydraulic fluid is limited to approximately 150 gal and has a high flashpoint (e.g., > 380 °F, and a NFPA Fire Rating of 1).

4.1.3.4 Accident Consequence Comparison

To estimate the potential consequences of a fire in a contaminated facility, the MAR is conservatively assumed in the DSA to be the equivalent of between 10 and 100 L of tank waste with solids fractions ranging from 1% to 10%.

The ARF and RF used to determine the amount of respirable material released during a fire in a contaminated facility are from DOE-HDBK-3010-94, *Airborne Release Fractions/Rates and Respirable Fractions for Nonreactor Nuclear Facilities*. An ARF of 0.2 and an RF of 0.3 for an aqueous solution or air-dried salts under a gasoline fire on a surface that is a strong conductor of heat (i.e., metal) are considered to conservatively bound releases from a fire.

Based on the above MAR and release fractions, the total amount of respirable material suspended by a fire in a contaminated facility represented by a waste transfer-associated structure is conservatively estimated to be between a few mL and 2.5 L, depending on the release mechanism. Radiological and toxicological consequences for this material release are estimated using the bounding radiological ULD for all tank wastes, the bounding toxicological sum of fraction (SOF) values for all tank wastes, and the accident analysis methodology described in RPP-13354. For the fire, a conservative release duration of 15 min was assumed for estimating consequences. In addition, the fire analysis included the thermal (buoyant) effects of the fire when determining the atmospheric dispersion coefficients.

The radiological consequences to the onsite worker and toxicological consequences to the offsite public are “low” (< 25 rem, < TEEL-1, and < TEEL-2, respectively) based on the conservative calculations in RPP-13354 for fires in contaminated facilities (see DSA Table 3.3.2.4.4-1).

The waste retrieval modified sluicing system design uses existing tank farm pits with drains. Hence, little to no accumulation of wastes is expected within the pits as a result of a spill or leak. The 42-L of MAR previously analyzed in the DSA is considered bounding for this scenario. Additionally, a review of the waste retrieval modified sluicing system indicates that only a

limited amount of combustibles may be available to burn from a hydraulic oil rupture (approximately 150 gal) and the hydraulic oil has a high flashpoint (e.g., > 380 °F, and NFPA Fire Rating of 1). Therefore, the DSA consequences for a “Release from Contaminated Facility” would remain bounding.

4.1.3.5 Safety SSCs and TSR Controls

Based on the low offsite and onsite consequences, there are no TSR and/or safety SSC controls required for this postulated accident.

4.1.3.6 Conclusions

Based upon this safety evaluation, the DSA representative accident for “Release from Contaminated Facility” adequately bounds the frequency and consequences of similar hazards (e.g., fires) involving the waste retrieval modified sluicing system operations, when considering the application of current TSR controls.

No additional controls are necessary to prevent and/or mitigate releases from contaminated facilities due to waste retrieval modified sluicing operations.

4.1.4 Waste Transfer Leaks

4.1.4.1 DSA Representative Accidents

The DSA representative accidents are the “fine spray into the air” scenario and the “large pipe break into a pit” scenario. The fine spray into the air scenario assumes that a small width crack (the optimal width for producing fine aerosol) has occurred in a waste transfer line, and that waste slurry is spraying into the air under maximum available pump pressure. The large pipe break into a pit scenario assumes that a large pipe break has occurred, and that waste is leaking into an open pit at the maximum flow rate of the transfer pump. DSA Section 3.3.2.4.13, “Waste Transfer Leak,” addresses these hazardous conditions. The DSA section also addresses several other accident scenarios, but the fine spray into the air and the large pipe break into a pit scenario are the limiting scenarios. The DSA estimates the frequency of the fine spray into the air scenario to be “unlikely,” and the large pipe break into a pit scenario to be “anticipated.” The onsite radiological and toxicological guidelines are exceeded for the two representative accident scenarios, and safety SSCs and/or TSR controls are required. The offsite radiological and toxicological guidelines are not exceeded.

4.1.4.2 Waste Retrieval System Operations Hazardous Conditions

The waste retrieval modified sluicing system HAZOP identified numerous hazardous conditions that could occur during modified sluicing system operations that would result in waste transfer leaks. These conditions involve leaks occurring in transfer lines at various locations and in various configurations. All of these scenarios are similar to scenarios already evaluated in DSA Section 3.3.2.4.13. The significant analysis parameters that differ in value between modified sluicing and the existing DSA include ULDs, SOFs, ¹³⁷Cs and ⁹⁰Sr concentrations, maximum transfer pump pressure, and maximum transfer pump flow rate. Other parameters significant to

the calculation of radiological dose and toxicological exposure values are expected to be the same for modified sluicing and the DSA (e.g., χ/Q atmospheric dispersion values). If the values of all of these parameters for the modified sluicing system are bounded by the values of these parameters used for the current DSA analysis, then it may be concluded that modified sluicing is bounded by the current DSA.

Tables 4-1 and 4-2 provide a comparison of the analysis parameter values for properties associated with the waste (ULDs, SOFs, ^{137}Cs and ^{90}Sr concentrations), and for properties associated with the transfer pumps (maximum transfer pump pressure, and maximum transfer pump flow rate) for modified sluicing and the existing DSA analyses. Table 4-3 provides a comparison of radiological and toxicological consequence values specifically for the Seepex¹ positive displacement pump.

Properties Associated with the Waste

The DSA used values for ULD, SOF, ^{137}Cs concentration and ^{90}Sr concentration that are bounding for all tanks in tank farms. Therefore, it is necessarily true that these values bound those associated with modified sluicing, which are based on the limiting values for 100-series SSTs. However, the DSA assumes that the maximum insoluble solids concentration of a pumped waste stream will be 25 vol%. It has been identified that during modified sluicing, an insoluble solids concentration as high as 30 vol% may be achieved for short periods of time. Consequently, Table 4-1 presents a comparison of analysis parameter values for properties associated with the waste, including waste slurry properties for 30 vol% insoluble solids.

Table 4-1. Properties Associated with the Waste. (2 sheets)

Description	DSA ⁽¹⁾	Bounding 100-series SSTs (Modified Sluicing)⁽²⁾ [the bounding tank from which the parameter value is taken is shown below the parameter]
Onsite ULD Liquid	1.0E+3 Sv/L	4.5E+2 (U-106)
Onsite ULD Solids	1.9E+5 Sv/L	1.4E+5 Sv/L (AX-104)
Onsite Slurry ULD	4.8E+4 Sv/L (25 vol%)	4.2E+4 (30 vol%)
Offsite ULD Liquid	1.5E+3 Sv/L	6.0E+2 (U-106)
Offsite ULD Solids	2.9E+5 Sv/L	1.9E+5 Sv/L (AX-104)
Offsite Slurry ULD	7.4E+4 Sv/L (25 vol%)	5.7E+4 Sv/L (30 vol%)
Onsite SOF Liquid	5.8E+8 (TEEL-2)	5.73E+8 (A-106)
Onsite SOF Solids	3.9E+9 (TEEL-2)	6.28E+8 (TEEL-2) (A-102)

¹ Seepex is a registered trademark of Seeberger GmbH and Company, Germany.

Table 4-1. Properties Associated with the Waste. (2 sheets)

Description	DSA ⁽¹⁾	Bounding 100-series SSTs (Modified Sluicing) ⁽²⁾ [the bounding tank from which the parameter value is taken is shown below the parameter]
Onsite Slurry SOF	1.4E+9 (25 vol%)	5.9E+8 (30 vol%)
Offsite SOF Liquid	7.9E+9 (TEEL-1)	3.71E+9 (A-106)
Offsite SOF Solids	3.8E+9 (TEEL-1)	2.21E+9 (TEEL-1) (TY-102)
Offsite Slurry SOF	6.9E+9 (25 vol%)	3.3E+9 (30 vol%)
¹³⁷ Cs Solids	7.0E+10 Bq/L	1.9E+6 uCi/L ⁽³⁾ 7.0E+10 Bq/L (AX-104)
¹³⁷ Cs Liquid	5.9E+10 Bq/L	5.3E+5 uCi/L ⁽³⁾ 2.0E+10 Bq/L (A-102)
Slurry Cs-137	6.2E+10 Bq/L (25 vol%)	3.5E+10 Bq/L (30 vol%)
⁹⁰ Sr Solids	2.9E+12 Bq/L	7.9E+7 uCi/L ⁽³⁾ 2.9E+12 Bq/L (AX-104)
⁹⁰ Sr Liquid	3.5E+9 Bq/L	5.9E+4 uCi/L ⁽³⁾ 2.2E+9 Bq/L (U-106)
Slurry Sr-90	7.3E+11 Bq/L (25 vol%)	8.7E+11 Bq/L (30 vol%)

Notes:

DSA = documented safety analysis.

SOF = sum of fractions.

SST = single-shell tank.

TEEL = Temporary Emergency Exposure Limit.

ULD = unit-liter dose.

⁽¹⁾Onsite radiological data and onsite and offsite toxicological data from RPP-13750, *Waste Transfer Leaks Technical Basis Document*. Offsite radiological data from RPP-14499, *Offsite Radiological Consequence Analysis for the Waste Transfer Leak*.

⁽²⁾Radiological data from RPP-5924, *Radiological Source Terms for Tank Farms Safety Analysis, Rev. 3*, unless otherwise noted. Toxicological data from RPP-8369, *Chemical Source Terms for Tank Farms Safety Analyses, Rev. 1*.

⁽³⁾¹³⁷Cs and ⁹⁰Sr data are from the July 10, 2003 download of the Best-Basis Inventory. This is the same download that was used as the basis for RPP-5924 Rev.3. The Best-Basis Inventory is maintained at <http://twins.pnl.gov/twins.htm>, Pacific Northwest Laboratory, Richland, Washington.

Table 4-1 indicates that waste transfer leak analysis properties associated with the waste to be transferred during modified sluicing are bounded by the values of these properties assumed in the DSA analysis, except for the ⁹⁰Sr concentration. The ⁹⁰Sr concentration in the slurry exceeds the maximum DSA value for slurries if the insoluble solids concentration is greater than approximately 25 vol% insoluble solids. However, the ¹³⁷Cs concentration and the ⁹⁰Sr concentration are always used together and are only used to calculate the direct radiation dose from a surface pool for the onsite receptor (direct shine does not affect an offsite receptor). Consequently, the lower concentration of ¹³⁷Cs for sluicing tends to compensate for the higher concentration of ⁹⁰Sr. This can be seen by comparing the direct shine dose for the fine spray and the large break representative accidents as calculated for the DSA (assuming 25 vol% solids),

with the same values calculated using the ^{137}Cs and ^{90}Sr concentrations from Table 4-1 (assuming 30 vol% solids). The result is that, for the large pipe break scenario, the DSA value for direct shine dose is $3.6\text{E}+2$ rem (RPP-13750, Table A6-5) and the direct shine dose using modified sluicing values for ^{137}Cs and ^{90}Sr concentrations is also $3.6\text{E}+2$ rem (from Excel model *Large Break 8hr 30% modified sluicing (9-26-03).xls*). Similarly, for the fine spray representative accident, both the DSA case for 25 vol% solids and the modified sluicing case for 30 vol% solids give a direct shine dose of $2.2\text{E}+1$ rem (see RPP-1370 Table A6-1 and Excel model *Fine Spray 8hr 30% modified sluicing (9-26-03).xls*). From these results it is concluded that, while the ^{90}Sr concentration for modified sluicing assuming 30 vol% solids is not bounded by the ^{90}Sr concentration used for the DSA analysis which assumes a maximum of 25 vol% solids, the combination of ^{137}Cs and ^{90}Sr concentrations for modified sluicing is within the envelop of the values assumed for purposes of the DSA analyses. All of the other waste properties used for modified sluicing are individually bounded by the values of those properties assumed in the DSA analysis.

The other modified sluicing properties that are important for the waste transfer leak analysis are those associated with the waste transfer pumps.

Properties Associated with the Transfer Pumps

Two types of waste transfer pumps are currently planned for use for modified sluicing. The Lawrence pump configuration consists of an immersible (also referred to as “submersible”) pump that provides positive suction head to a vertical inline “booster” pump. These two pumps are centrifugal pumps. This configuration was selected to bound the pump configuration that will be used for modified sluicing because the final pump configuration has not yet been selected.

The other transfer pump configuration planned for use during modified sluicing consists of a single Seepex positive displacement pump. A positive displacement pump is especially appropriate for pumping higher solids content waste material.

Table 4-2 compares the transfer pump properties with those assumed in the DSA.

A composite pump curve is not available for the Lawrence Centrifugal Pump configuration. Therefore, the maximum pressures from the two individual pump curves (i.e., the submersible pump and the vertical inline pump) were added to produce an approximate bounding maximum pressure for the two pumps operating in series. The maximum flow rate for the two pumps operating in series was taken to be the maximum flow rate for the vertical inline pump, since it has the lower maximum flow rate of the two pumps and would therefore be limiting. As Table 4-2 shows, the Lawrence Centrifugal Pump configuration pump parameters are bounded by the pump parameters assumed in the DSA analysis.

Table 4-2. Properties Associated with the Transfer Pumps.

	DSA	Lawrence centrifugal pump configuration	Seepex positive displacement pump
Max. Flow Rate	790 gal/min	~ 685 gal/min ⁽¹⁾	521 gal/min ⁽⁴⁾
Max. Pressure	800 ft (approx. 460 lb/in ² gauge for 7 vol% insoluble solids waste)	153.5ft + 550.1ft = 703.6ft ⁽²⁾⁽³⁾	480 lb/in ² gauge ⁽⁵⁾

Notes:

DSA = documented safety analysis.

⁽¹⁾ This flow rate is for the Vertical Inline Pump. It is taken from Section 8.3, Test No. T3549, CVI #22668 Supplement No. 147, *Quality Documentation Plan*, Lawrence Pumps, Inc., Lawrence Mass.

⁽²⁾ 153.5 ft is for the submersible pump. It is taken from Section 8.1, Test No. T3553, CVI #22668 Supplement No. 147, *Quality Documentation Plan*, Lawrence Pumps, Inc., Lawrence Massachusetts.

⁽³⁾ 550.1 ft is for the Vertical Inline Pump. It is taken from Section 8.3, Test No. T3549, CVI #22668 Supplement No. 147, *Quality Documentation Plan*, Lawrence Pumps, Inc., Lawrence Massachusetts.

⁽⁴⁾ This maximum flow rate was based on an extrapolation of pump performance curves in *Seepex Operating and Maintenance Instruction for Progressive Cavity Pump BE 55-24, Serial Numbers 806306 and 806307, Section 9 – Auxiliary Documentation*.

⁽⁵⁾ This maximum pressure was estimated based on pump test data presented in CVI #50253.

The Seepex pump is a positive displacement pump rather than a centrifugal pump and, consequently, it does not have a pump curve like a centrifugal pump. However, the uncontrolled maximum pump flow rate and the uncontrolled maximum pump discharge pressure can be estimated based on the point at which the pump motor is estimated to begin to fail (i.e., for the uncontrolled case, no credit is taken for the pressure relief valve or amperage limits that are normally associated with the pump). The Seepex pump electric motor has a nominal horsepower rating of 30 hp, based on *Seepex Quality Inspection Certificates According to DIN 55 350-18-4.2.2* (CVI #50253). The point at which motor failure begins is taken to be 115% of this value (the “nameplate value”), since typical industry standards (e.g., *National Electrical Manufacturer's Association Safety Standard and Guide for Selection, Installation, and Use of Electric Motors and Generators*, MG2-2001) specify that operation up to 115% of nominal rating shall not have an immediate damaging effect on motor operation. 115% of 30 HP = 34.5 hp. This is the point for which maximum pump pressure and maximum pump flow rate are estimated.

The 34.5 hp produces a maximum pump speed of approximately 650 rpm in a no backpressure condition. Based on 650 rpm, a maximum flow rate of approximately 521 gal/min is estimated by extrapolation of the pump performance curves in *Seepex Operating and Maintenance Instruction for Progressive Cavity Pump BE 55-24, Serial Numbers 806306 and 806307, Section 9 – Auxiliary Documentation*.

Based on pump test data included in vendor file CVI #50253 34.5 hp motor operation suggests a maximum pump pressure of approximately 480 lb/in² gauge.

As Table 4-2 indicates, the maximum flow rate for the Seepex pump is bounded by the DSA assumed maximum flow rate, while the maximum pressure may not be bounded. However, recalculation of the bounding onsite and offsite radiological and toxicological consequences using the waste properties from Table 4-1, together with an assumed 480 lb/in² gauge pump pressure, produces the following results (Table 4-3).

Table 4-3. Seepex Pump Maximum Pressure Exposure Comparison.

	DSA	480 lb/in ² gauge pressure
Onsite radiological exposure	Moderate risk bin ⁽¹⁾	Moderate risk bin ⁽³⁾
Onsite toxicological exposure	High risk bin ⁽¹⁾	High risk bin ⁽³⁾
Offsite radiological exposure	1.4E-1 rem ⁽²⁾	9.6E-2 rem ⁽³⁾
Offsite toxicological exposure	Low risk bin ⁽¹⁾	Low risk bin ⁽³⁾

Notes:

DSA = documented safety analysis.

⁽¹⁾ RPP-13750, *Waste Transfer Leaks Technical Basis Document*.

⁽²⁾ RPP-14499, *Offsite Radiological Consequence Analysis for the Waste Transfer Leak*.

⁽³⁾ Based on the same calculational methodology as described for the fine spray accident scenario analyses in RPP-13750 and RPP-14499.

Calculations of the results for 480 lb/in² gauge pressure are contained in the following Excel spreadsheets:

Fine Spray 8hr 0% 480 psig (9-28-03).xls

Fine Spray 8hr 7% 480 psig (9-28-03).xls

Fine Spray 8hr 15% 480 psig (9-28-03).xls

Fine Spray 8hr 25% 480 psig (9-28-03).xls

Fine Spray Offsite 8hr 0% 480 psig (9-28-03).xls

Fine Spray Offsite 8hr 7% 480 psig (9-28-03).xls

Fine Spray Offsite 8hr 15% 480 psig (9-28-03).xls

Fine Spray Offsite 8hr 25% 480 psig (9-28-03).xls

(note that 30 vol% cases were not required because the maximum dose values occurred for vol%'s less than 25 vol%)

Based on the information in Table 4-3, a maximum pump pressure of 480 lb/in² gauge would produce consequences that are bounded by the current DSA analysis.

Based on informal discussion with the Seepex pump vendor, it is possible that a pressure spike greater than 480 lb/in² gauge may occur for a short period of time. If the pressure is high enough (on the order of 2,000 lb/in² gauge to 3,000 lb/in² gauge) and a leak occurs, the offsite evaluation guideline could be exceeded. However, this would require a fine crack that has optimal width for producing fine spray to form and be maintained for an 8 hr period. If such a crack did occur, it is very likely that it would quickly expand due to erosion by the high pressure of the leaking fluid. As the width of the crack increases from the optimal width for spray production, the amount of respirable size aerosol particles produced decreases rapidly, and the leak begins to more closely resemble the large pipe break into a pit scenario. Consequently, it is qualitatively judged that, even if a leak occurred at a pressure much higher than 480 lb/in² gauge and a crack occurs that has the optimal width for production of fine aerosol, this crack configuration would not exist for an extended period of time (i.e., 8 hr is assumed in the DSA analysis) and offsite radiological consequences would not challenge guidelines. Also, the leak scenario would become more like a large break scenario as the crack width increases due to erosion. For large break scenarios, the maximum pump flow rate is more important for determining consequences

than the maximum pump pressure. As noted in Table 4-2, the maximum flow rate of the Seepex pump is bounded by the maximum flow rate assumed in the DSA. Also, the Seepex pump includes a relief valve. No credit is taken for this relief valve when estimating uncontrolled radiological and toxicological consequences. However, this relief valve is considered a defense-in-depth feature for mitigation of accident scenarios involving high pump pressures. Vendor information file CVI #50253 includes documentation from the manufacturer indicating that the valve is pressure tested to meet or exceed the pertinent requirements of ASME B&PV Code Section VIII, Division 1, subsections UG-125 through UG-136.

4.1.4.3 Safety SSCs and TSR Controls

The discussion presented in Section 4.1.4.2 indicates that waste transfer leak accident scenarios associated with modified sluicing are bounded by those currently addressed in the DSA. Therefore, the controls specified in the TSRs for the waste transfer leak accident as analyzed in the DSA also provide adequate risk reduction to allow modified sluicing operations to be conducted safely. The current controls for waste transfer leak accident scenarios specified in the TSRs are as follows:

- LCO 3.1.1, "Transfer Leak Detection Systems"
- LCO 3.1.2, "Backflow Prevention Systems"
- AC 5.7, "Safety Management Programs"
- AC 5.8, "Emergency Preparedness"
- AC 5.11, "Transfer Controls"
- AC 5.12, "Administrative Lock Controls."

Applicable safety-significant SSCs include:

- Transfer Leak Detection Systems
- Hose-in-hose Transfer Line Systems
- Aboveground Transfer System Vehicle Barriers (if used to comply with AC 5.11)
- Service Water Pressure Detection Systems (if used to comply with LCO 3.1.2)
- Backflow Preventers (if used to comply with LCO 3.1.2).

It is assumed in this analysis that all transfer lines used for modified sluicing will be either underground or, if aboveground, will be safety-significant HIHTL systems.

As noted above, the relief valve installed on the Seepex positive displacement pump will be treated as a defense-in-depth feature.

4.1.4.4 Conclusions

The waste transfer leak accident scenarios associated with modified sluicing are bounded by those currently addressed in the DSA. Therefore, the controls specified in the TSRs for the waste transfer leak accident as analyzed in the DSA also provide adequate risk reduction for waste transfer leak accidents associated with modified sluicing operations.

4.2 EVALUATION OF RISK FROM MODIFIED SLUICING OF WASTE FOR DSA CANDIDATE ACCIDENTS NOT SELECTED AS REPRESENTATIVE ACCIDENTS

4.2.1 Filtration Failures Leading to Unfiltered Releases

4.2.1.1 DSA Representative Accident

There is no DSA representative accident because HEPA filter failures from exposure to high temperature or pressure were analyzed and binned in Risk Bin III (RPP-13437, *Technical Basis Document for Ventilation System Filtration Failures Leading to Unfiltered Release*). The analyses assume an event that results in failure of all prefilters, HEPA filters, and other filters (i.e., high-efficiency mist eliminators and high-efficiency gas adsorbers) present in the ventilation system. It is further assumed that a fraction of the inventory of tank waste accumulated on filters and ventilation system ductwork is released. Failure of the filters results in an unfiltered release that also contributes to the consequences of the event. Consequences of all HEPA filter failure and unfiltered release scenarios evaluated in RPP-13437 fall into the “low” category.

4.2.1.2 Waste Retrieval System Operations Hazardous Conditions

SST modified sluicing waste retrieval systems will retrieve waste from designated tanks and transfer the retrieved waste to the DST system. The SST modified sluicing waste retrieval system is designed to dissolve SST crystallized salt and to mobilize sludge through the application of high pressure water or supernatant spray to break down the waste salt, sludge, and solids and to direct the waste to the intake of a slurry transfer pump for transfer into the DST system. Various SST waste retrieval system sluicing designs may be used.

The SST waste retrieval system sluicing designs employ sluicing nozzles that are installed in the tank headspace via SST risers. The number of sluicing nozzles can vary depending on the amount and location of solidified waste within the SST. The nozzle system is designed to aim pressurized fluid (raw water or supernatant) that will break up, mobilize, and move the sludge and compacted solids slurry to a location where they are picked up by a slurry transfer pump.

The SST modified sluicing HAZOP identified potential SST HEPA failures and unfiltered releases from various initiators such as moisture buildup, dome cracking, vapor condensation resulting in a vacuum, and sluice water evaporation resulting in headspace pressurization.

Sluicing operations have the potential to increase the aerosol content of the headspace beyond what is currently evaluated in the DSA. Therefore the effect of the increased aerosol loading requires further evaluation.

4.2.1.3 Accident Frequency Comparison

Aerosol generation and moisture buildup causing HEPA filter failure has been previously identified and documented in the hazard analysis database. The assigned frequency for these

conditions is “anticipated” in RPP-13437. Since that is the highest frequency category, the SST modified sluicing operations cannot exceed this frequency.

4.2.1.4 Accident Consequence Comparison

The source terms (including ULD, ARF, and RF) for HEPA filter failure during SST modified sluicing operations would not be different from those currently considered in RPP-13437, since the waste composition will not change and the HEPA filter loading parameters remain the same.

There are no mechanisms during SST modified sluicing operations that would cause an increase in the radiological dose or toxicological consequences from the release of material from the HEPA filters or ducting during a HEPA filter failure over that analyzed in support of the DSA (RPP-13437). However, the unfiltered release portion of the event during modified sluicing operations was postulated to have consequences higher than those evaluated in RPP-13437 because of the potentially high aerosol loading in the headspace of the tank being retrieved.

4.2.1.4.1 Reasonably Conservative Base Case. This case assumes that one ventilation system is operating at the maximum ventilation runout flow of a portable exhauster with a variable frequency drive at the normal 60 Hz set point (RPP-CALC-24575, *Assessment of Maximum Ventilation Flow Rates for VFD Driven Portable Exhausters for SST Ventilation*). Tank waste releases are qualitatively estimated at 10% SST solids and 90% SST liquids from experience from sluicing SST 241-C-106 (RPP-19919, *Campaign Report for the Retrieval of Waste Heel from Tank 241-C-106*) and past sluicing campaigns (SD-WM-TI-302, *Hanford Waste Tank Sluicing History*). An aerosol partition fraction of 2×10^{-8} L waste/L for air lift circulator operation is used. This is conservative compared to the measured aerosol partition fraction during a waste transfer of 2×10^{-9} L waste/L (RPP-13437).

4.2.1.4.1.1 Toxicological Consequences of an Unfiltered Release. The aerosol release rate can be calculated as follows:

$$(1,304 \text{ ft}^3/\text{min}) (1 \text{ min}/60 \text{ sec}) (28.3 \text{ L}/\text{ft}^3) (2 \times 10^{-8} \text{ L waste}/\text{L air}) \\ = 1.23 \times 10^{-5} \text{ L}/\text{sec}$$

where:

1,304 ft³/min is the maximum ventilation exhaust flowrate for a portable exhauster for SST retrieval ventilation (RPP-CALC-24575)

28.3 L/ft³ is a conversion factor (Weast 1981, *CRC Handbook of Chemistry and Physics*)

2×10^{-8} L waste/L air is the partition fraction of waste in the headspace air during air lift circulator operation which is a conservative selection since the measured partition fraction during a waste transfer is 2×10^{-9} L waste/L air (RPP-13437).

4.2.1.4.1.2 Onsite Toxicological Consequences. Calculating the TEEL-2 SOF multiplier for an onsite release assuming 10% SST solids and 90% SST liquids:

$$(0.90) (5.73 \times 10^8) + (0.10) (6.28 \times 10^8) = 5.79 \times 10^8$$

where:

5.73×10^8 is the bounding liquid TEEL-2 SOF multiplier for 100-series SSTs (RPP-8369, *Chemical Source Terms for Tank Farms Safety Analysis*)

6.28×10^8 is the bounding solid TEEL-2 SOF multiplier for 100-series SSTs (RPP-8369).

Calculating the onsite moderate toxicological consequences:

$$\begin{aligned} \text{Onsite, moderate SOF} &= (\text{aerosol release rate}) (\text{onsite } \chi/Q) (\text{TEEL-2 SOF multiplier}) \\ \text{Onsite, moderate SOF} &= (1.23 \times 10^{-5} \text{ L/sec}) (3.28 \times 10^{-2} \text{ sec/m}^3) (5.79 \times 10^8) / (1,000 \text{ L/m}^3) \\ &= 2.3 \times 10^{-1} \end{aligned}$$

where:

$3.28 \times 10^{-2} \text{ sec/m}^3$ is the bounding onsite χ/Q for a ground level release (RPP-13482)

1,000 L/m³ is a volumetric conversion factor.

4.2.1.4.1.3 Offsite Toxicological Consequences. Calculating the TEEL-1 SOF multiplier for an offsite release assuming 10% SST solids and 90% SST liquids:

$$(0.90) (3.71 \times 10^9) + (0.10) (2.21 \times 10^9) = 3.56 \times 10^9$$

where:

3.71×10^9 is the bounding liquid TEEL-1 SOF multiplier for 100-series SSTs (RPP-8369)

2.21×10^9 is the bounding solid TEEL-1 SOF multiplier for 100-series SSTs (RPP-8369).

Calculating the offsite moderate toxicological consequences:

$$\begin{aligned} \text{Offsite, moderate SOF} &= (\text{aerosol release rate}) (\text{offsite } \chi/Q) (\text{TEEL-1 SOF multiplier}) \\ \text{Offsite, moderate SOF} &= (1.23 \times 10^{-5} \text{ L/sec}) (2.22 \times 10^{-5} \text{ sec/m}^3) (3.56 \times 10^9) / (1,000 \text{ L/m}^3) \\ &= 9.7 \times 10^{-4} \end{aligned}$$

where:

$2.22 \times 10^{-5} \text{ sec/m}^3$ is the bounding offsite χ/Q for a ground level release (RPP-13482).

4.2.1.4.1.4 Radiological Consequences of an 8-hr Unfiltered Release. The total release over the 8-hr period can be found by:

$$(1.23 \times 10^{-5} \text{ L/sec}) (60 \text{ sec/min}) (60 \text{ min/h}) (8 \text{ hr}) = 3.54 \times 10^{-1} \text{ L}$$

Calculating the onsite ULD for an onsite release assuming 10% SST sludge and 90% supernatant:

$$(0.90) (4.5 \times 10^2 \text{ Sv/L}) + (0.10) (1.4 \times 10^5 \text{ Sv/L}) = 1.4 \times 10^4 \text{ Sv/L}$$

where:

4.5×10^2 Sv/L is the bounding ULD for supernatant in 100-series SSTs (RPP-5924)

1.4×10^5 Sv/L is the bounding ULD for sludge in 100-series SSTs (RPP-5924).

Calculating the onsite radiological dose:

$$\begin{aligned} \text{Onsite Dose} &= (\text{aerosol released}) (\text{onsite } \chi/Q) (\text{onsite ULD}) (\text{breathing rate}) \\ \text{Onsite Dose} &= (3.54 \times 10^{-1} \text{ L}) (5.58 \times 10^{-3} \text{ sec/m}^3) (1.4 \times 10^4 \text{ Sv/L}) (3.33 \times 10^{-4} \text{ m}^3/\text{sec}) \\ &= 9.2 \times 10^{-3} \text{ Sv} \\ &= 9.2 \times 10^{-1} \text{ rem} \end{aligned}$$

where:

$5.58 \times 10^{-3} \text{ sec/m}^3$ is the onsite 8-hr χ/Q including plume meander (RPP-13482)

$3.33 \times 10^{-4} \text{ m}^3/\text{sec}$ is the breathing rate (RPP-5924).

It can be seen that the consequences for the unfiltered release accident are below the moderate risk guidelines (1.0 is the toxicological guideline and 25 rem is the radiological guideline). Even when the consequences for the bounding HEPA filter failure are added to the unfiltered release the guidelines are not challenged. The contribution to the toxicological consequences due to high pressure failure of the HEPA filters is 3.1×10^{-3} for onsite and 4.2×10^{-6} for offsite releases while the bounding contribution to the radiological consequences is 2.2×10^{-4} rem (RPP-13437). The resultant risk bin is III for an accident with a frequency of "anticipated."

4.2.1.4.2 Sensitivity Case 1 (30% Solids Loading)

4.2.1.4.2.1 Toxicological Consequences of an Unfiltered Release. The aerosol release rate can be calculated as follows:

$$\begin{aligned} &(1,304 \text{ ft}^3/\text{min}) (1 \text{ min}/60 \text{ sec}) (28.3 \text{ L}/\text{ft}^3) (2 \times 10^{-8} \text{ L waste}/\text{L air}) \\ &= 1.23 \times 10^{-5} \text{ L}/\text{sec} \end{aligned}$$

where:

$1,304 \text{ ft}^3/\text{min}$ is the maximum ventilation exhaust flowrate for a portable exhaustor for SST retrieval ventilation (RPP-CALC-24575)

$28.3 \text{ L}/\text{ft}^3$ is a conversion factor (Weast 1981)

$2 \times 10^{-8} \text{ L waste}/\text{L air}$ is the partition fraction of waste in the headspace air during air lift circulator operation which is a conservative selection since the measured partition fraction during a waste transfer is $2 \times 10^{-9} \text{ L waste}/\text{L air}$ (RPP-13437).

4.2.1.4.2.2 Onsite Toxicological Consequences. Calculating the TEEL-2 SOF multiplier for an onsite release assuming 30% SST solids and 70% SST liquids (RPP-13437):

$$(0.70) (5.73 \times 10^8) + (0.30) (6.28 \times 10^8) = 5.89 \times 10^8$$

where:

5.73×10^8 is the bounding liquid TEEL-2 SOF multiplier for 100-series SSTs (RPP-8369)

6.28×10^8 is the bounding solid TEEL-2 SOF multiplier for 100-series SSTs (RPP-8369).

Calculating the onsite moderate toxicological consequences:

$$\begin{aligned} \text{Onsite, moderate SOF} &= (\text{aerosol release rate}) (\text{onsite } \chi/Q) (\text{TEEL-2 SOF multiplier}) \\ \text{Onsite, moderate SOF} &= (1.23 \times 10^{-5} \text{ L/sec}) (3.28 \times 10^{-2} \text{ sec/m}^3) (5.89 \times 10^8) / (1,000 \text{ L/m}^3) \\ &= 2.4 \times 10^{-1} \end{aligned}$$

where:

$3.28 \times 10^{-2} \text{ sec/m}^3$ is the bounding onsite χ/Q for a ground level release (RPP-13482)
 $1,000 \text{ L/m}^3$ is a volumetric conversion factor.

4.2.1.4.2.3 Offsite Toxicological Consequences. Calculating the TEEL-1 SOF multiplier for an offsite release assuming 30% SST solids and 70% SST liquids (RPP-13437):

$$(0.70) (3.71 \times 10^9) + (0.30) (2.21 \times 10^9) = 3.26 \times 10^9$$

where:

3.71×10^9 is the bounding liquid TEEL-1 SOF multiplier for 100-series SSTs (RPP-8369)
 2.21×10^9 is the bounding solid TEEL-1 SOF multiplier for 100-series SSTs (RPP-8369).

Calculating the offsite moderate toxicological consequences:

$$\begin{aligned} \text{Offsite, moderate SOF} &= (\text{aerosol release rate}) (\text{offsite } \chi/Q) (\text{TEEL-1 SOF multiplier}) \\ \text{Offsite, moderate SOF} &= (1.23 \times 10^{-5} \text{ L/sec}) (2.22 \times 10^{-5} \text{ sec/m}^3) (3.26 \times 10^9) / (1000 \text{ L/m}^3) \\ &= 8.9 \times 10^{-4} \end{aligned}$$

where:

$2.22 \times 10^{-5} \text{ sec/m}^3$ is the bounding offsite χ/Q for a ground level release (RPP-13482).

4.2.1.4.2.4 Radiological Consequences of an 8-hr Unfiltered Release. The total release over the 8-hr period can be found by:

$$(1.23 \times 10^{-5} \text{ L/sec}) (60 \text{ sec/min}) (60 \text{ min/h}) (8 \text{ hr}) = 3.54 \times 10^{-1} \text{ L}$$

Calculating the onsite ULD for an onsite release assuming 30% SST sludge and 70% supernatant (RPP-13437):

$$(0.70) (4.5 \times 10^2 \text{ Sv/L}) + (0.30) (1.4 \times 10^5 \text{ Sv/L}) = 4.2 \times 10^4 \text{ Sv/L}$$

where:

4.4×10^2 Sv/L is the bounding ULD for supernatant in 100-series SSTs (RPP-5924)
 1.4×10^5 Sv/L is the bounding ULD for sludge in 100-series SSTs (RPP-5924).

Calculating the onsite radiological dose:

$$\begin{aligned} \text{Onsite Dose} &= (\text{aerosol released}) (\text{onsite } \chi/Q) (\text{onsite ULD}) (\text{breathing rate}) \\ \text{Onsite Dose} &= (3.54 \times 10^{-1} \text{ L}) (5.58 \times 10^{-3} \text{ sec/m}^3) (4.2 \times 10^4 \text{ Sv/L}) (3.33 \times 10^{-4} \text{ m}^3/\text{sec}) \\ &= 2.8 \times 10^{-2} \text{ Sv} \\ &= 2.8 \text{ rem} \end{aligned}$$

where:

$5.58 \times 10^{-3} \text{ sec/m}^3$ is the onsite 8-hr χ/Q including plume meander (RPP-13482)
 $3.33 \times 10^{-4} \text{ m}^3/\text{sec}$ is the breathing rate (RPP-5924).

It can be seen that the consequences for the unfiltered release accident are below the moderate risk guidelines (1.0 is the toxicological guideline and 25 rem is the radiological guideline). Even when 30% SST solids are assumed and the consequences for the bounding HEPA filter failure are added to the unfiltered release the guidelines are not challenged. The contribution to the toxicological consequences due to high pressure failure of the HEPA filters is 3.1×10^{-3} for onsite and 4.2×10^{-6} for offsite releases while the bounding contribution to the radiological consequences is 2.2×10^{-4} rem (RPP-13437). The resultant risk bin is III for an accident with a frequency of "anticipated."

4.2.1.4.3 Sensitivity Case 2 (Maximum Allowable Ventilation Flow Rate). The purpose of this sensitivity case is to back calculate the maximum ventilation flow rate during modified sluicing operations that is within the DSA guidelines. This is done by calculating the aerosol release rate using the onsite moderate guideline SOF of 1 and then calculating the maximum ventilation flow rate.

The aerosol release rate is calculated by:

$$\begin{aligned} \text{Aerosol release rate} &= (\text{Onsite, moderate SOF}) / (\text{onsite } \chi/Q) (\text{TEEL-2 SOF multiplier}) \\ \text{Aerosol release rate} &= (1) (1,000 \text{ L/m}^3) / (3.28 \times 10^{-2} \text{ sec/m}^3) (5.79 \times 10^8) \\ &= 5.27 \times 10^{-5} \text{ L/sec} \end{aligned}$$

where:

$3.28 \times 10^{-2} \text{ sec/m}^3$ is the bounding onsite χ/Q for a ground level release (RPP-13482)

1,000 L/m³ is a volumetric conversion factor.

5.79×10^8 is the TEEL-2 SOF multiplier for an onsite release assuming 10% SST solids and 90% SST liquids (RPP-13437):

$$(0.90) (5.73 \times 10^8) + (0.10) (6.28 \times 10^8) = 5.79 \times 10^8$$

where:

5.73×10^8 is the bounding liquid TEEL-2 SOF multiplier for 100-series SSTs (RPP-8369)

6.28×10^8 is the bounding solid TEEL-2 SOF multiplier for 100-series SSTs (RPP-8369).

The maximum ventilation flow rate is:

$$\begin{aligned} &= 5.26 \times 10^{-5} \text{ L/sec} / (1 \text{ min}/60 \text{ sec}) (28.3 \text{ L}/\text{ft}^3) (2 \times 10^{-8} \text{ L waste}/\text{L air}) \\ &= 5,600 \text{ ft}^3/\text{min} \end{aligned}$$

where:

$28.3 \text{ L}/\text{ft}^3$ is a conversion factor (Weast 1981)

$2 \times 10^{-8} \text{ L waste}/\text{L air}$ is the partition fraction of waste in the headspace air during air lift circulator operation which is a conservative selection since the measured partition fraction during a waste transfer is $2 \times 10^{-9} \text{ L waste}/\text{L air}$ (RPP-13437).

4.2.1.5 Safety SSCs and TSR Controls

Currently the DSA has no TSR-level controls for HEPA filter failures or unfiltered releases, nor are any additional controls required for SST modified sluicing conditions. Since SST modified sluicing conditions remain Risk Bin III, they do not require the identification of additional controls beyond existing SMPs.

4.2.1.6 Conclusions

Filtration system failure accidents that could be initiated during SST modified sluicing operations are adequately analyzed and bounded by conditions currently identified in the hazards analysis database and the DSA technical basis documents. No additional controls are necessary. Sensitivity cases show that the conclusions are not very sensitive to ventilation flow rate and percent solids.

5.0 CONTROLS

Based on the hazard and accident analysis of modified sluicing operations, no new accidents were identified, and the existing DSA analyses were found to be encompassing and bounding. The DSA controls (i.e., safety SSCs and TSRs) were also found to acceptably prevent or mitigate potential hazardous conditions and postulated accidents for modified sluicing operations. Although the waste transfer spray leak accident caused by the high pressures possible with progressive cavity pumps was determined to be bounded by the DSA analysis and mitigated by the selected DSA controls (e.g., waste transfer-associated covers) and additional defense-in-depth feature was identified for this accident scenario. The defense-in-depth feature is the pressure limiter (e.g., pressure relief valve) for progressive cavity pumps that is designed to prevent pressures exceeding the design pressure of the waste transfer system.

This page intentionally left blank.

6.0 REFERENCES

- 03-TED-029, 2003, "Approval of Interim Authorization Using Alternate Controls Related to the Operation of Active Ventilation on Single-Shell Tank (SST) 241-C-106 During Accelerated Waste Retrieval," Letter dated March 5, to E. S. Aromi, CH2M HILL Hanford Group, Inc., from R. J. Schepens, U.S. Department of Energy, Office of River Protection, Richland, Washington.
- 03-TED-066, 2003, "Safety Evaluation Report (SER) for Approval of Justification for Continued Operation (JCO) for Tank Farms Single-Shell Tank (SST) Retrieval/Closure Modified Sluicing," Letter dated June 2, to E. S. Aromi, CH2M HILL Hanford Group, Inc., from R. J. Schepens, U.S. Department of Energy, Office of River Protection, Richland, Washington.
- Best Basis Inventory, available at: <http://twins.pnl.gov/twins.htm>, Pacific Northwest National Laboratory, Richland, Washington. Queries executed on September 9, 2003.
- CVI #22668 Supplement No. 147, *Quality Documentation Plan*, Purchase Order W-78259-Z4, Lawrence Pumps, Inc., Lawrence Mass [no date].
- CVI #50253, 2003, Section 21, Seepex Quality Inspection Certificates According to DIN 55 350-18-4.2.2, CH2M HILL Hanford Group, Inc., Richland, Washington.
- MG2-2001, 2001, *National Electrical Manufacturer's Association Safety Standard and Guide for Selection, Installation, and Use of Electric Motors and Generators*, Rosslyn, Virginia.
- PNNL-13781, 2003, *Effects of Globally Waste-Disturbing Activities on Gas Generation, Retention, and Release in Hanford Waste Tanks*, Rev. 2, Pacific Northwest National Laboratory, Richland, Washington.
- PNNL-14271, 2003, *Flammable Gas Release Estimates for Modified Sluicing Retrieval of Waste from Selected Hanford Single-Shell Tanks*, Rev. 0, Pacific Northwest National Laboratory, Richland, Washington.
- RPP-CALC-24575, 2005, *Assessment of Maximum Ventilation Flow Rates for VFD Driven Portable Exhausters for SST Ventilation*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-19919, 2004, *Campaign Report for the Retrieval of Waste Heel from Tank 241-C-106*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-5924, 2003, *Radiological Source Terms for Tank Farms Safety Analysis*, Rev. 3, CH2M HILL Hanford Group, Inc., Richland, Washington.

- RPP-5926, 2003, *Steady-State Flammable Gas Release Rate and Lower Flammability Level Evaluation for Hanford Tank Waste*, Rev. 3, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-7475, 2002, *Criticality Safety Evaluation of Hanford Tank Farm Facility*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-7689, 2003, *Hazard Evaluation for Single-Shell Retrieval Via Salt Cake Dissolution Proof of Concept in Tank 241-U-107*, Rev. 0A, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-8369, 2003, *Chemical Source Terms for Tank Farms Safety Analyses*, Rev. 2, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-9014, 2002, *Process Hazard Evaluation for the S-112 Saltcake Waste Retrieval Technology Demonstration Project Preconceptual Design*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-12371, 2003, *Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-13354, 2003, *Technical Basis for the Release from Contaminated Facility Representative Accident and Associated Represented Hazardous Conditions*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-13437, 2003, *Technical Basis Document for Ventilation System Filtration Failures Leading to an Unfiltered Release*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-13482, 2003, *Atmospheric Dispersion Coefficients and Radiological/Toxicological Exposure Methodology for Use in Tank Farms*, Rev. 2, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-13557, 2003, *Safety Evaluation of Phase 1 Retrieval of 241-C-106 for Closure*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-13750, 2003, *Waste Transfer Leaks Technical Basis Document*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-13978, 2003, *Technical Basis for the Transportation-Related Handling Accidents and Associated Representative Hazardous Conditions*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-14499, 2003, *Offsite Radiological Consequence Analysis for the Waste Transfer Leak*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.

SD-WM-TI-302, 1987, *Hanford Waste Tank Sluicing History*, Rev. 0, Westinghouse Hanford Company, Richland, Washington.

Weast, R. C., 1981, *CRC Handbook of Chemistry and Physics*, CRC Press, Inc., Boca Raton, Florida.

This page intentionally left blank.

APPENDIX A
TEAM MEMBER ROSTER

This page intentionally left blank.

Hazards Analysis Team Meeting Attendance Sheet

Meeting Subject: Modified Sluicing Date 8/19/03

Name	Organization	Phone	Mail Stop
MILTON V. SHULTZ	NS&L		
John Schofield	Retrieval Priced	3-2245	57-12
MARC A. DANNA	NS&L	373-4045	
MIKE FLASCH	OPERATIONAL READ.	373-4473	
SCOTT CONRAD	ENVIRONMENTAL	373-5960	
Curt Reichmuth	OPS	6-4796	
John Bares	QA	376-8131	R2-87
CARL HANSON	Retrieval Engr.	376-4810	
Tom Ramirez	Remediation Engr	373-3531	
KEVIN HULL	SST SYS ENGR	376-0445	T4-08
BOB CASH	Closure Proj Engr	373-3132	57-90
Jim HUCKABY	SUPPORT PNLG	375-3623	
Kevin Sandgren	NS&L	372-0374	57-90
Bill Zuckoff	Leaky Engr	372-1003	57-24
Ryan Smith	NS&L	372-1383	57-90
Joseph m Jones	NS&L	308-0723	R2-12

This page intentionally left blank.

APPENDIX B

DEFINITIONS

This page intentionally left blank.

Definitions of information listed in Table 3-X and C-1:

- **ID:** The item identification (ID); used to record a unique identifier for the hazardous condition.
- **Node:** The division of a process or activity into discrete segments is called a node. Each node represents a specific part of the process or activity. This division into nodes is designed to facilitate the hazard identification process.
- **Process Variable:** The characteristics of a process, such as flow, pressure, or temperature, which are used to define proper operation.
- **Deviation:** The deviation is the description of the divergence from the desired value for a given process variable, such as “low temperature” to describe temperature below normal or optimum.
- **Hazardous Condition:** The hardware failures, operational faults, or conditions that could result in undesired consequences. The Hazardous Condition is a concise statement combining the Cause, Consequence, and Mode of radioactive material release.
- **Possible Causes of Deviation:** The causes that lead to the deviation from the process variable and resultant Hazardous Condition.
- **Consequence:** The potential consequences that could result from the postulated deviation.
- **Potential Engineered Features:** Potential SSCs are existing engineered features (hardware items) identified by the hazard and operability study (HAZOP) team that have the potential to mitigate or prevent the hazardous condition of concern. The engineered features are candidates for designation as safety-significant items for hazardous conditions that pose a significant threat to the health of facility workers and onsite personnel or safety class for hazards that pose a significant threat to offsite individuals. These items should not be construed as being the “official” controls that would eventually be credited in the safety basis.
- **Potential Administrative Controls:** Technical safety requirements are existing controls identified by the HAZOP team that have the potential to mitigate or prevent the hazardous condition of concern. These items should not be construed as being the “official” administrative features that would eventually be credited in the safety basis.
- **NC Consequence Category (NC Offsite Rad, NC Offsite Tox, NC Onsite Rad, NC Onsite Tox, NC FW Cons):** The consequence category is a code designator for the level of safety consequence associated with a specific class of receptor, material of concern (radioactive or toxic material), and the hazardous condition. The consequence assignment is a "first cut," qualitative estimate of the safety severity of the consequences assuming no controls are present. The criteria for determining the consequence

designation is unique to the receptor. For the Offsite and Onsite receptor the consequence designators are low (L), moderate (M), and high (H). The facility worker (FW) is assigned a Y or N based on whether the postulated event is estimated to result in severe injury or death. Y indicates there is a potential for significant FW impact and N indicates no potential. Table B-1 summarizes the criteria for Offsite receptors, Onsite receptors, and facility workers:

Table B-1. Consequence Levels and Risk Evaluation Guidelines.

Consequence level	Offsite public	Onsite co-located worker	Site facility worker
High	Considerable offsite impacts on people or the environs. >25 rem TEDE or >ERPG-2/TEEL-2	Considerable onsite impacts on people or the environs. >100 rem TEDE or >ERPG-3/TEEL -3	All facility worker hazards are assessed for prompt death or serious injury or significant radiological or chemical exposure.
Moderate	Only minor offsite impact on people or the environs. ≥1 rem TEDE or >ERPG-1/TEEL-1	Considerable onsite impact on people or the environs. ≥25 rem TEDE or >ERPG-2/TEEL-2	
Low	Negligible offsite impact on people or the environs. <1 rem or <ERPG-1/TEEL-1	Minor onsite impact on people or the environs. <25 rem or <ERPG-2/TEEL-2	

Notes:

ERPG = emergency response planning guideline.
TEDE = total effective dose equivalent.
TEEL = Temporary Emergency Exposure Limit.

- **ENV Cons.** The environmental consequence ranking is a "first cut," qualitative estimate of the environmental severity of the hazardous condition assuming no controls are present. The following system is used:
 - E0 No significant environmental effect outside the facility confinement systems.
 - E1 Limited environmental discharge of hazardous material outside the facility.
 - E2 Large environmental discharge of hazardous material within the plant site boundary.
 - E3 Significant environmental discharges of hazardous material outside the plant site boundary.

- **NC Frequency:** The NC frequency is a “first cut,” qualitative estimate of the likelihood of the hazardous condition assuming no controls are present. The following system is used:
 - A Events that are expected to occur one or more times during the lifetime of the facility, categorized as "anticipated" events. The frequency range associated with this category is $> 1E-02/yr$.
 - U Events that could occur during the lifetime of the facility, but with low probability. Such events are categorized as "unlikely" and fall in the range of $1E-04/yr$ to $1E-02/yr$.
 - EU Events not expected to occur during the lifetime of the facility, categorized as "extremely unlikely." The frequency range associated with this category is $1E-06/yr$ to $1E-04/yr$.
 - BEU Events categorized as "beyond extremely unlikely," with a frequency less than $1E-06/yr$. Events in this category (such as meteor strike) are so unlikely they generally do not require special controls.
- **Remarks:** Miscellaneous observations or clarifying comments for a given item.

This page intentionally left blank.

APPENDIX C
HAZOP TABLE

This page intentionally left blank.

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Risk Bin Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUIC-K-001	01X	Radioactive fission product gases	Release of ionizing radiation and fission product gas from SST to the atmosphere due to criticality in the tank	Excessive solids in slurry flow towards transfer pump	Release of radioactive gases and direct radiation (neutrons)	BEU	L	IV	L	L	IV	L	N	Basis for NC frequency: RPP-7475, Rev. 1, Criticality Safety Evaluation of Hanford Tank Farms Facility, demonstrates that a criticality accident in stored tank waste at the Tank Farms facility is an incredible event due to the form (alkaline chemistry) or distribution (associated with neutron absorbers) of the fissile material in tank wastes.	Basis for NC Offsite Rad and Tox consequence: Consequences are "low" because nuclear criticality event is based on 2.8 E18 fissions which produces very small quantities of aerosols and fission product gases. For evaluation purposes, a scoping calculation for a presumed nuclear criticality accident was performed and documented in RPP-12371, Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions. Basis for NC Onsite Rad and Tox Worker consequence: Consequences are "low" because nuclear criticality event is based on 2.8 E18 fissions which produces very small quantities of aerosols and fission product gases. For evaluation purposes, a scoping calculation for a presumed nuclear criticality accident was performed and documented in RPP-12371, Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions. Basis for NC Facility Worker consequence: Facility worker consequences are judged to be not significant based on the amount of soil providing shielding over the tanks, the shielding provided by the waste since any criticality will occur within the waste, and the fact that although fission product gases are produced as a result of a criticality, the quantity is small in comparison to the radioactive constituents of the waste.	A-1-a	E1
MODSLUIC-K-002	01X	Radioactive fission product gases	Release of ionizing radiation and fission product gas from SST to the atmosphere due to criticality in the tank	Material reaches critical mass/geometry during sluicing activities	Release of radioactive gases and direct radiation (neutrons)	BEU	L	IV	L	L	IV	L	N	Basis for NC frequency: RPP-7475, Rev. 1, Criticality Safety Evaluation of Hanford Tank Farms Facility, demonstrates that a criticality accident in stored tank waste at the Tank Farms facility is an incredible event due to the form (alkaline chemistry) or distribution (associated with neutron absorbers) of the fissile material in tank wastes.	Basis for NC Offsite Rad and Tox consequence: Consequences are "low" because nuclear criticality event is based on 2.8 E18 fissions which produces very small quantities of aerosols and fission product gases. For evaluation purposes, a scoping calculation for a presumed nuclear criticality accident was performed and documented in RPP-12371, Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions. Basis for NC Onsite Rad and Tox Worker consequence: Consequences are "low" because nuclear criticality event is based on 2.8 E18 fissions which produces very small quantities of aerosols and fission product gases. For evaluation purposes, a scoping calculation for a presumed nuclear criticality accident was performed and documented in RPP-12371, Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions. Basis for NC Facility Worker consequence: Facility worker consequences are judged to be not significant based on the amount of soil providing shielding over the tanks, the shielding provided by the waste since any criticality will occur within the waste, and the fact that although fission product gases are produced as a result of a criticality, the quantity is small in comparison to the radioactive constituents of the waste.	A-1-a	E1

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Risk Bin Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUIC-K-003	01X	Radioactive fission product gases	Release of ionizing radiation and fission product gas from SST to the atmosphere due to criticality in the progressive cavity pump	Accumulation of material in the pump until critical mass conditions are met	Radioactive gas release through ventilation system and worker exposure to high energy neutron radiation	BEU	L	IV	IV	L	IV	L	N	Basis for NC frequency: RPP-7475, Rev. 1, Criticality Safety Evaluation of Hanford Tank Farms Facility, demonstrates that a criticality accident in stored tank waste at the Tank Farms facility is an incredible event due to the form (alkaline chemistry) or distribution (associated with neutron absorbers) of the fissile material in tank wastes.	Basis for NC Offsite Rad and Tox consequence: Consequences are "low" because nuclear criticality event is based on 2.8 E18 fissions which produces very small quantities of aerosols and fission product gases. For evaluation purposes, a scoping calculation for a presumed nuclear criticality accident was performed and documented in RPP-12371, Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions. Basis for NC Onsite Rad and Tox Worker consequence: Consequences are "low" because nuclear criticality event is based on 2.8 E18 fissions which produces very small quantities of aerosols and fission product gases. For evaluation purposes, a scoping calculation for a presumed nuclear criticality accident was performed and documented in RPP-12371, Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions. Basis for NC Facility Worker consequence: Facility worker consequences are judged to be not significant based on the amount of soil providing shielding over the tanks, the shielding provided by the waste since any criticality will occur within the waste, and the fact that although fission product gases are produced as a result of a criticality, the quantity is small in comparison to the radioactive constituents of the waste.	A-1-a	E1
MODSLUIC-K-004	01X	SST waste and fission product gases	Release of radioactive and other hazardous materials from SST to atmosphere due to unplanned nuclear criticality	Sluicing selectively removes neutron poisons resulting in criticality, steam generation	Release of neutrons, radiation, radioactive fission gases	BEU	L	IV	IV	L	IV	L	N	Basis for NC frequency: RPP-7475, Rev. 1, Criticality Safety Evaluation of Hanford Tank Farms Facility, demonstrates that a criticality accident in stored tank waste at the Tank Farms facility is an incredible event due to the form (alkaline chemistry) or distribution (associated with neutron absorbers) of the fissile material in tank wastes.	Basis for NC Offsite Rad and Tox consequence: Consequences are "low" because nuclear criticality event is based on 2.8 E18 fissions which produces very small quantities of aerosols and fission product gases. For evaluation purposes, a scoping calculation for a presumed nuclear criticality accident was performed and documented in RPP-12371, Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions. Basis for NC Onsite Rad and Tox Worker consequence: Consequences are "low" because nuclear criticality event is based on 2.8 E18 fissions which produces very small quantities of aerosols and fission product gases. For evaluation purposes, a scoping calculation for a presumed nuclear criticality accident was performed and documented in RPP-12371, Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions. Basis for NC Facility Worker consequence: Facility worker consequences are judged to be not significant based on the amount of soil providing shielding over the tanks, the shielding provided by the waste since any criticality will occur within the waste, and the fact that although fission product gases are produced as a result of a criticality, the quantity is small in comparison to the radioactive constituents of the waste.	A-1-a	E1

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Risk Bin Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Risk Bin Tox	NC FW Conts	Basis for NC Frequency	Basis for NC Consequence	FIN	NC Env Category
MODSLUIC-K-005	01X	Radioactive fission gases	Release of ionizing radiation and radioactive gas from DST receiving tank to the atmosphere due to criticality	Waste distributor or dropping piles or concentrates solids in one place resulting in critical mass	Radioactive and other hazardous materials released to atmosphere	BEU	L	IV	IV	L	IV	L	N	Basis for NC frequency: RPP-7475, Rev. 1, Criticality Safety Evaluation of Hanford Tank Farms Facility, demonstrates that a criticality accident in stored tank waste at the Tank Farms facility is an incredible event due to the form (alkaline chemistry) or distribution (associated with neutron absorbers) of the fissile material in tank wastes.	Basis for NC Offsite Rad and Tox consequence: Consequences are "low" because nuclear criticality event is based on 2.8 E18 fissions which produces very small quantities of aerosols and fission product gases. For evaluation purposes, a scoping calculation for a presumed nuclear criticality accident was performed and documented in RPP-12371, Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions. Basis for NC Onsite Rad and Tox Worker consequence: Consequences are "low" because nuclear criticality event is based on 2.8 E18 fissions which produces very small quantities of aerosols and fission product gases. For evaluation purposes, a scoping calculation for a presumed nuclear criticality accident was performed and documented in RPP-12371, Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions. Basis for NC Facility Worker consequence: Facility worker consequences are judged to be not significant based on the amount of soil providing shielding over the tanks, the shielding provided by the waste since any criticality will occur within the waste, and the fact that although fission product gases are produced as a result of a criticality, the quantity is small in comparison to the radioactive constituents of the waste.	A-1-a	E1
MODSLUIC-K-006	01X	Fission product gases and aerosols produced from criticality	Release of radioactive material due to criticality	Addition of dissolution water to waste causes concentration of fissile material or removal of poisons resulting in criticality	Release of fission product gases and ionizing radiation to the atmosphere	BEU	L	IV	IV	L	IV	L	N	Basis for NC frequency: RPP-7475, Rev. 1, Criticality Safety Evaluation of Hanford Tank Farms Facility, demonstrates that a criticality accident in stored tank waste at the Tank Farms facility is an incredible event due to the form (alkaline chemistry) or distribution (associated with neutron absorbers) of the fissile material in tank wastes.	Basis for NC Offsite Rad and Tox consequence: Consequences are "low" because nuclear criticality event is based on 2.8 E18 fissions which produces very small quantities of aerosols and fission product gases. For evaluation purposes, a scoping calculation for a presumed nuclear criticality accident was performed and documented in RPP-12371, Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions. Basis for NC Onsite Rad and Tox Worker consequence: Consequences are "low" because nuclear criticality event is based on 2.8 E18 fissions which produces very small quantities of aerosols and fission product gases. For evaluation purposes, a scoping calculation for a presumed nuclear criticality accident was performed and documented in RPP-12371, Technical Basis for the Nuclear Criticality Representative Accident and Associated Represented Hazardous Conditions. Basis for NC Facility Worker consequence: Facility worker consequences are judged to be not significant based on the amount of soil providing shielding over the tanks, the shielding provided by the waste since any criticality will occur within the waste, and the fact that although fission product gases are produced as a result of a criticality, the quantity is small in comparison to the radioactive constituents of the waste.	A-1-a	E1

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Tox	NC Offsite Risk Bin Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Tox	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUJC-B-001	05X	SST headspace aerosols, filter loading, and SST waste	Release of radioactive and other hazardous materials from SST to the atmosphere due to flammable gas deflagration resulting from water intrusion (induced GRE)	Gas release event (GRE) induced by large water intrusion (misroute) into tank with ignition of flammable gas (GRE hazard)	Release of radioactive and other hazardous materials to the atmosphere	EU	L	IV	L	IV	M	III	M	III	Y	<p>Basis for NC Frequency:</p> <p>The frequency is qualitatively judged to be "extremely unlikely" based on the likelihood of a water intrusion into an SST that causes sufficient gas to be released to cause the flammable gas concentration in the tank headspace to exceed 100 percent of the LFL.</p>	<p>Basis for NC Offsite Consequence:</p> <p>The "low" offsite radiological consequence is based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident." The "low" offsite toxicological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document."</p> <p>Basis for NC Onsite Consequence:</p> <p>The "moderate" onsite worker radiological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document." The "moderate" onsite worker toxicological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document."</p> <p>Basis for NC Facility Worker Consequence:</p> <p>The "Yes" for potential significant facility worker consequences was qualitatively assigned based on the physical injury that could potentially result from a flammable gas deflagration.</p>	A-1-a	E2
MODSLUJC-C-006	05X	SST headspace aerosols, filter loading, and SST waste	Release of radioactive and other hazardous materials from SST to the atmosphere due to flammable gas deflagration during sluicing (induced GRE)	Sluicer jet impinges on solids releasing a region of retained flammable gas (ignition source assumed) (GRE hazard)	Release of radioactive and other hazardous materials to the atmosphere	A	L	III	L	III	M	I	M	I	Y	<p>Basis for NC Frequency:</p> <p>As discussed in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tanks (SST) Modified Sluicing Waste Retrieval System," the frequency of a flammable gas deflagration due to an induced GRE was qualitatively determined to be "anticipated" because modified sluicing operations are capable of releasing retained gas.</p>	<p>Basis for NC Offsite Consequence:</p> <p>The "low" offsite radiological consequence is based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident." The "low" offsite toxicological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document."</p> <p>Basis for NC Onsite Consequence:</p> <p>The "moderate" onsite worker radiological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document." The "moderate" onsite worker toxicological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document."</p> <p>Basis for NC Facility Worker Consequence:</p> <p>The "Yes" for potential significant facility worker consequences was qualitatively assigned based on the physical injury that could potentially result from a flammable gas deflagration.</p>	A-1-a	E2

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Tox	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUIC-C-007	05X	SST headspace aerosols, filter loading, and SST waste	Release of radioactive and other hazardous materials from SST to the atmosphere due to flammable gas deflagration during sluicing (induced GRE)	Sluicing nozzle strikes object when being indexed causing spark and ignition of flammable gas (GRE hazard)	Release of radioactive and other hazardous materials to the atmosphere	A	L	III	L	M	I	M	I	Y	<p>Basis for NC Frequency:</p> <p>As discussed in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tanks (SST) Modified Sluicing Waste Retrieval System," the frequency of a flammable gas deflagration due to an induced GRE was qualitatively determined to be "anticipated" because modified sluicing operations are capable of releasing retained gas.</p> <p>Basis for NC Onsite Consequence:</p> <p>The "moderate" onsite worker radiological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document." The "moderate" onsite worker toxicological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document."</p> <p>Basis for NC Facility Worker Consequence:</p> <p>The "Yes" for potential significant facility worker consequences was qualitatively assigned based on the physical injury that could potentially result from a flammable gas deflagration.</p>	A-1-a	E2	
MODSLUIC-C-008	05X	SST headspace aerosols, filter loading, and SST waste	Release of radioactive and other hazardous materials from SST to the atmosphere due to flammable gas deflagration during sluicing (induced GRE)	Sluice jet moves debris causing spark and flammable gas ignition (GRE hazard)	Release of radioactive and other hazardous materials to the atmosphere	A	L	III	L	M	I	M	I	Y	<p>Basis for NC Frequency:</p> <p>As discussed in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tanks (SST) Modified Sluicing Waste Retrieval System," the frequency of a flammable gas deflagration due to an induced GRE was qualitatively determined to be "anticipated" because modified sluicing operations are capable of releasing retained gas.</p> <p>Basis for NC Onsite Consequence:</p> <p>The "low" offsite radiological consequence is based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident." The "low" offsite toxicological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document."</p> <p>Basis for NC Onsite Consequence:</p> <p>The "moderate" onsite worker radiological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document." The "moderate" onsite worker toxicological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document."</p> <p>Basis for NC Facility Worker Consequence:</p> <p>The "Yes" for potential significant facility worker consequences was qualitatively assigned based on the physical injury that could potentially result from a flammable gas deflagration.</p>	A-1-a	E2	

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Tox	NC Offsite Risk Bin Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Tox	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUIC-C-009	05X	SST headspace aerosols, filter loading, and SST waste	Release of radioactive and other hazardous materials from SST to the atmosphere due to flammable gas deflagration during sluicing (induced GRE)	Hydraulic reaction force of jet bends sluicing mechanism against riser causing friction when indexing and ignition of flammable gas (GRE hazard)	Release of radioactive and other hazardous materials to the atmosphere	A	L	III	L	III	M	I	M	I	Y	<p>Basis for NC Frequency: As discussed in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tanks (SST) Modified Sluicing Waste Retrieval System," the frequency of a flammable gas deflagration due to an induced GRE was qualitatively determined to be "anticipated" because modified sluicing operations are capable of releasing retained gas.</p> <p>Basis for NC Consequence: The "low" onsite worker radiological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document." The "moderate" onsite worker radiological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document." Basis for NC Facility Worker Consequence: The "Yes" for potential significant facility worker consequences was qualitatively assigned based on the physical injury that could potentially result from a flammable gas deflagration.</p>	A-1-a	E2	
MODSLUIC-C-018	05X	SST headspace aerosols, filter loading, and SST waste	Release of radioactive and other hazardous materials from SST to the atmosphere due to flammable gas deflagration during dissolution water addition (induced GRE)	Spark from impact type spray head causes flammable gas ignition, flammable gas assumed present (GRE hazard)	Release of radioactive and other hazardous materials to the atmosphere	A	L	III	L	III	M	I	M	I	Y	<p>Basis for NC Frequency: As discussed in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tanks (SST) Modified Sluicing Waste Retrieval System," the frequency of a flammable gas deflagration due to an induced GRE was qualitatively determined to be "anticipated" because modified sluicing operations are capable of releasing retained gas.</p> <p>Basis for NC Consequence: The "low" onsite worker radiological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document." The "moderate" onsite worker radiological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document." Basis for NC Facility Worker Consequence: The "Yes" for potential significant facility worker consequences was qualitatively assigned based on the physical injury that could potentially result from a flammable gas deflagration.</p>		E2	

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Rad	NC Offsite Rad	NC Offsite Rad	NC Onsite Risk Bin Rad	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category				
MODSLUIC-F-007	05X	SST headspace aerosols, filter loading, and SST waste	Release of radioactive and other hazardous materials from SST to the atmosphere due to flammable gas deflagration during dissolution water addition (induced GRE)	Additional aerosols cause premature plugging of HEPA filter and buildup of hydrogen concentration in dome space with ignition source resulting in flammable gas deflagration (GRE hazard)	Release of radioactive and other hazardous materials to the atmosphere	A	L	III	M	I	M	I	M	I	I	I	Y	<p>Basis for NC Frequency:</p> <p>As discussed in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tanks (SST) Modified Sluicing Waste Retrieval System," the frequency of a flammable gas deflagration due to an induced GRE was qualitatively determined to be "anticipated" because modified sluicing operations are capable of releasing retained gas.</p> <p>Basis for NC Consequence:</p> <p>The "moderate" onsite worker radiological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document." The "moderate" onsite worker toxicological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document."</p> <p>Basis for NC Facility Worker Consequence:</p> <p>The "Yes" for potential significant facility worker consequences was qualitatively assigned based on the physical injury that could potentially result from a flammable gas deflagration.</p>	A-1-a	E2	
MODSLUIC-F-008	05X	SST headspace aerosols, filter loading, and SST waste	Release of radioactive and other hazardous materials from SST to the atmosphere due to flammable gas deflagration during dissolution water addition (induced GRE)	Aerosols generated during water addition cause plugging of HEPA filter and release of hydrogen pocket with ignition source resulting in flammable gas deflagration (GRE hazard)	Release of radioactive and other hazardous materials to the atmosphere	BEU	L	IV	M	IV	M	IV	M	IV	M	IV	Y	<p>Basis for NC Frequency:</p> <p>The frequency is "beyond extremely unlikely" because pockets of gas in the SST waste are insufficient in size to cause the flammable gas concentration in the tank headspace to exceed 100 percent of the LFL.</p> <p>Basis for NC Consequence:</p> <p>The "low" onsite radiological consequence is based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident." The "low" offsite toxicological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document."</p> <p>Basis for NC Onsite Consequence:</p> <p>The "moderate" onsite worker radiological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document." The "moderate" onsite worker toxicological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document."</p> <p>Basis for NC Facility Worker Consequence:</p> <p>The "Yes" for potential significant facility worker consequences was qualitatively assigned based on the physical injury that could potentially result from a flammable gas deflagration.</p>	A-1-a	E2	

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Risk Bin Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Tox	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUIC-H-001	05X	SST headspace aerosols, filter loading, and SST waste	Release of radioactive and other hazardous materials from SST to the atmosphere due to flammable gas deflagration during waste recovery (induced GRE)	High waste temperature in SST during retrieval causes a steam bump, which induces a flammable gas release/ignition (GRE hazard)	Release of radioactive and other hazardous materials to the atmosphere	BEU	L	IV	L	M	IV	M	IV	Y	<p>Basis for NC Frequency: The frequency is "beyond extremely unlikely" because tank or steam bumps are not credible in SSTs (see RPP-6213, "Hanford Waste Tank Bump Accident & Consequence Analysis").</p> <p>Basis for NC Onsite Consequence: The "moderate" onsite worker radiological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document." The "low" offsite radiological consequence is based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident." The "low" offsite toxicological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document."</p> <p>Basis for NC Facility Worker Consequence: The "Yes" for potential significant facility worker consequences was qualitatively assigned based on the physical injury that could potentially result from a flammable gas deflagration.</p>	A-1-a	E2	
MODSLUIC-H-002	05X	SST headspace aerosols, filter loading, and SST waste	Release of radioactive and other hazardous materials from SST to the atmosphere due to flammable gas deflagration during waste recovery (induced GRE)	Temperature out of specification for waste retrieval causes a steam bump when level is lowered resulting in release of flammable gas (GRE hazard)	Release of radioactive and other hazardous materials to the atmosphere	BEU	L	IV	L	M	IV	M	IV	Y	<p>Basis for NC Frequency: The frequency is "beyond extremely unlikely" because tank or steam bumps are not credible in SSTs (see RPP-6213, "Hanford Waste Tank Bump Accident & Consequence Analysis").</p> <p>Basis for NC Onsite Consequence: The "moderate" onsite worker radiological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document." The "low" offsite radiological consequence is based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident." The "low" offsite toxicological consequence was qualitatively assigned based on scoping calculations contained in RPP-13510, "Flammable Gas Technical Basis Document."</p> <p>Basis for NC Facility Worker Consequence: The "Yes" for potential significant facility worker consequences was qualitatively assigned based on the physical injury that could potentially result from a flammable gas deflagration.</p>	A-1-a	E2	

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Risk Bin Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUIC-C-030	06X	SST headspace aerosols and filter loading	Release of radioactive and other hazardous materials from SST to atmosphere due to water vapor plugging HEPA filter and causing failure from high delta-pressure (active ventilation)	Dissolution water heating system temperature control fails and water temperature reaches point where high temperature dissolution water flashes to steam at sprinkler nozzle causing additional moisture, plugging of the HEPA filter and HEPA filter failure	Release of radioactive and other hazardous materials to the atmosphere	U	L	III	L	L	III	L	N	<p>Basis for NC frequency: Dissolution water heating system is not expected to supply water at temperatures exceeding the boiling point. The event frequency is therefore assumed to be "unlikely."</p> <p>Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident" (i.e., the bounding unmitigated offsite radiological consequences for the flammable gas accident are "low" and bound the consequences for release from contaminated facility). The "low" offsite toxicological consequences are based on calculations documented in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System."</p> <p>Basis for NC Onsite consequence: The "low" onsite radiological and toxicological consequences are based calculations and engineering judgments documented in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System."</p> <p>Basis for NC Facility Worker consequence: The "No" for potential significant facility worker consequences is estimated based on the consequences calculated in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System."</p>	B-1-a	E1	
MODSLUIC-E-002	06X	DST headspace aerosols and HEPA filter loading	Release of radioactive and other hazardous materials from the DST receiver tank ventilation system to the atmosphere due to high pressure failure	Compressed air used to blow down transfer line exceeds the HEPA filter capacity in the receiver tank causing filter failure and release of contaminants	Release of radioactive and other hazardous materials to the atmosphere	EU	L	IV	L	L	IV	L	N	<p>Basis for NC frequency: Compressed air supply provides air at a much lower flow rate than the 1000 CFM HEPA filter capacity. Therefore the frequency was assumed to be "extremely unlikely."</p> <p>Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident" (i.e., the bounding unmitigated offsite radiological consequences for the flammable gas accident are "low" and bound the consequences for release from contaminated facility). The "low" offsite toxicological consequences are based on calculations documented in RPP-13437, "Technical Basis Document for Ventilation System Filtration Failures Leading to Unfiltered Release."</p> <p>Basis for NC Onsite consequence: The "low" onsite radiological and toxicological consequences are based calculations and engineering judgments documented in RPP-13437, "Technical Basis Document for Ventilation System Filtration Failures Leading to Unfiltered Release."</p> <p>Basis for NC Facility Worker consequence: The "No" for potential significant facility worker consequences is estimated based on the consequences calculated in RPP-13437, "Technical Basis Document for Ventilation System Filtration Failures Leading to Unfiltered Release."</p>	B-1-a	E1	

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Bin Rad	NC Offsite Tox	NC Onsite Rad	NC Onsite Bin Rad	NC Onsite Tox	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUIC-F-002	06X	SST headspace aerosols and HEPA filter loading.	Release of radioactive and other hazardous materials from SST to atmosphere due to aerosol generation plugging HEPA filter and causing failure from high delta-pressure	Sluicer malfunctions resulting in excessive aerosol generation in head space and release through failed HEPAs caused by HEPA plugging and high differential pressure	Release of radioactive and other hazardous materials to the atmosphere	A	L	III	L	L	III	L	III	N	Basis for NC frequency: Sluicer malfunction could be due to human error (e.g., improper installation). Human errors are "anticipated" events.	Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident" (i.e., the bounding unmitigated offsite radiological consequences for the flammable gas accident are "low" and bound the consequences for release from contaminated facility). The "low" offsite toxicological consequences are based on calculations documented in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System." Basis for NC Onsite consequence: The "low" onsite radiological and toxicological consequences are based calculations and engineering judgments documented in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System." Basis for NC Facility Worker consequence: The "No" for potential significant facility worker consequences is estimated based on the consequences calculated in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System."	B-1-a	E1
MODSLUIC-G-003	06X	DST HEPA filter loading and headspace aerosols.	Release of radioactive and other hazardous materials from receiving DST to atmosphere due to aerosol generation plugging HEPA filter and causing failure from high delta-pressure	Heat loading from incoming waste causes aerosol generation that results in loading of receiving DST HEPA filters, which fail by high differential pressure	Release of radioactive and other hazardous materials to the atmosphere	BEU	L	IV	L	L	IV	L	IV	N	Basis for NC frequency: Incoming SST waste (even at high solids loading) does not contain sufficient heat load to result in self-boiling, much less cause boiling in the receiving tank. Therefore the frequency assigned was "beyond extremely unlikely."	Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident" (i.e., the bounding unmitigated offsite radiological consequences for the flammable gas accident are "low" and bound the consequences for release from contaminated facility). The "low" offsite toxicological consequences are based on calculations documented in RPP-13437, "Technical Basis Document for Ventilation System Filtration Failures Leading to Unfiltered Release." Basis for NC Onsite consequence: The "low" onsite radiological and toxicological consequences are based calculations and engineering judgments documented in RPP-13437, "Technical Basis Document for Ventilation System Filtration Failures Leading to Unfiltered Release." Basis for NC Facility Worker consequence: The "No" for potential significant facility worker consequences is estimated based on the consequences calculated in RPP-13437, "Technical Basis Document for Ventilation System Filtration Failures Leading to Unfiltered Release."	B-1-a	E1

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Risk Bin Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUJC-C-031	07X	Contamination from pit	Release of radioactive and other hazardous waste from an SST pit to the atmosphere due to hydraulic fluid fire in the pit	Rupture of a hydraulic line to the sluicing articulation actuators leaks into an SST pit and is ignited releasing contamination in the pit	Release of radioactive and other hazardous materials to the atmosphere from the SST heel pit	U	L	III	L	L	III	L	N	<p>Basis for NC frequency:</p> <p>The "unlikely" frequency is based on the postulated accident scenario that requires ignition of high flash point hydraulic oil in a pit. For the oil to ignite, there would have to be a high temperature source in the pit that could raise the bulk temperature of the oil above the flash point. Sparks are not sufficient to ignite the oil.</p> <p>Basis for NC Onsite Worker consequence:</p> <p>The "low" onsite worker radiological and toxicological consequences are based on qualitative comparison of the characteristics of a hydraulic oil fire in a pit with calculations documented in RPP-13354, "Technical Basis for the Release From Contaminated Facility Representative Accident and Associated Represented Hazardous Conditions." Hydraulic oil does not have burn characteristics that are more energetic than what has been evaluated for gasoline or diesel fuel.</p> <p>Basis for NC Facility Worker consequence:</p> <p>The "No" for potential significant facility worker consequences is based on expected worker response (self-evacuation).</p>	A-1-a	E1	
MODSLUJC-D-003a	07X	Contamination in the pit	Release of radioactive other hazardous materials from an SST pit to the atmosphere due to hydraulic fluid fire in the pit	Rupture of a hydraulic line to the sluice nozzle indexer leaks into an SST pit and is ignited releasing contamination in the pit	Release of contamination from the heel pit	U	L	III	L	L	III	L	N	<p>Basis for NC frequency:</p> <p>The "unlikely" frequency is based on the postulated accident scenario that requires ignition of high flash point hydraulic oil in a pit. For the oil to ignite, there would have to be a high temperature source in the pit that could raise the bulk temperature of the oil above the flash point. Sparks are not sufficient to ignite the oil.</p> <p>Basis for NC Onsite Worker consequence:</p> <p>The "low" onsite worker radiological and toxicological consequences are based on qualitative comparison of the characteristics of a hydraulic oil fire in a pit with calculations documented in RPP-13354, "Technical Basis for the Release From Contaminated Facility Representative Accident and Associated Represented Hazardous Conditions." Hydraulic oil does not have burn characteristics that are more energetic than what has been evaluated for gasoline or diesel fuel.</p> <p>Basis for NC Facility Worker consequence:</p> <p>The "No" for potential significant facility worker consequences is based on expected worker response (self-evacuation).</p>	A-1-a	E1	

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Risk Bin Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Tox	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUIC-D-003b	07X	Contamination in the pit	Release of radioactive other hazardous materials from an SST pit to the atmosphere due to hydraulic fluid fire in the pit	Rupture of a hydraulic line to the transfer pump drive motor leaks into an SST pit and is ignited releasing contamination in the pit	Release of contamination from the heel pit	U	L	III	L	L	III	L	III	N	<p>Basis for NC frequency: The "unlikely" frequency is based on the postulated accident scenario that requires ignition of high flash point hydraulic oil in a pit. For the oil to ignite, there would have to be a high temperature source in the pit that could raise the bulk temperature of the oil above the flash point. Sparks are not sufficient to ignite the oil.</p> <p>Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident" (i.e., the bounding unmitigated offsite radiological consequences for the flammable gas accident are "low" and bound the consequences for release from contaminated facility). The "low" offsite toxicological consequences are based on qualitative comparison of the characteristics of a hydraulic oil fire in a pit with calculations documented in RPP-13354, "Technical Basis for the Release From Contaminated Facility Representative Accident and Associated Represented Hazardous Conditions." Hydraulic oil does not have burn characteristics that are more energetic than what has been evaluated for gasoline or diesel fuel.</p> <p>Basis for NC Onsite Worker consequence: The "low" onsite worker radiological and toxicological consequences are based on qualitative comparison of the characteristics of a hydraulic oil fire in a pit with calculations documented in RPP-13354, "Technical Basis for the Release From Contaminated Facility Representative Accident and Associated Represented Hazardous Conditions." Hydraulic oil does not have burn characteristics that are more energetic than what has been evaluated for gasoline or diesel fuel.</p> <p>Basis for NC Facility Worker consequence: The "No" for potential significant facility worker consequences is based on expected worker response (self-evacuation).</p>	A-1-a	E1	

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Risk Bin Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Risk Bin Tox	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUIC-C-013	18AX	Tank waste	Release of radioactive other hazardous materials from tank SST to the soil and aerosol release to the atmosphere due to steam bump in liner gap	High pressure sluice induces movement of debris present in waste which impact and breaches the tank liner resulting in water leakage into liner gap, steam formation and bump breaching tank bottom	Below grade radioactive liquid and hazardous liquid release; large steam bump aerosol release to atmosphere	BEU	L	IV	L	L	IV	M	IV	N	<p>NC Frequency Basis:</p> <p>Tank bump resulting from water intrusion behind an SST liner is judged to have a frequency "beyond extremely unlikely. The frequency is based on the fact that a heat load of > 11.3 kW is required to achieve waste temperatures that exceed the saturation temperature of water (RPP-6213). Only four SSTs (241-A-104, 241-AX-104, 241-C-103, and 241-C-107) have heat loads in excess of 11.3 kW (RPP-5926). Current waste temperature data shows that these tanks are well below the saturation temperature of water. The highest temperature found in these four tanks is 76C (168.8F) (241-A-104). These tanks have been under passive cooling conditions for many years and show no trend of increasing temperature. Since the temperature is substantially below the saturation of water there is no possibility of steam bubble formation behind the tank liner no matter what quantity of water is involved.</p>	<p>Basis for NC Offsite consequence:</p> <p>The "low" offsite radiological consequences are calculated in RPP-12395, "Offsite Radiological Consequence Analysis for the Bounding Tank Failure Due to Excessive Loads Accident," which bounds the tank bump accident. The "low" offsite toxicological consequences are calculated in RPP-13437, "Technical Basis Document for Ventilation System Filtration Failure Leading to an Unfiltered Release."</p> <p>Basis for NC Onsite Worker consequence:</p> <p>The "low" onsite radiological consequences are calculated in RPP-13438, "Technical Basis for the Tank Bump Representative Accident and Associated Hazardous Conditions." The "low" onsite toxicological consequences are calculated in RPP-13437, "Technical Basis Document for Ventilation System Filtration Failure Leading to an Unfiltered Release."</p> <p>Basis for NC Facility Worker consequence:</p> <p>The facility worker consequences are judged to not be significant based on the "low" toxicological consequences of the onsite worker.</p>	C-3-b	E2

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Risk Bin Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUIC-C-001	18BX	SST headspace aerosols	Release of radioactive other hazardous materials from SST to atmosphere due to tank dome breach from impact	During sluicing operations, sluiser moves debris in waste impacting drop leg or in tank equipment, which breaches dome causing unfiltered release (assumes ventilation system failure)	Waste release to atmosphere	EU	L	IV	L	L	IV	L	N	Basis for NC frequency: Even if large pieces of debris are present in the tank, the sluiser will not provide sufficient motive force to cause the debris to impact the drop leg or in tank equipment vigorously enough to cause dome breach. Therefore the frequency was assumed to be "extremely unlikely."	Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident" (i.e., the bounding unmitigated offsite radiological consequences for the flammable gas accident are "low" and bound the consequences for release from contaminated facility). The "low" offsite toxicological consequences are based on calculations documented in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System." Basis for NC Onsite consequence: The "low" onsite radiological and toxicological consequences are based on calculations and engineering judgments documented in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System." Basis for NC Facility Worker consequence: The "No" for potential significant facility worker consequences is estimated based on the consequences calculated in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System."	C-1-a	EI
MODSLUIC-C-014	18BX	HEPA filter loading and tank headspace aerosols	Release of radioactive other hazardous materials from SST to atmosphere through failed filters due to condensation of vapor in head space	Condensation of vapor in head space of SST resulting from the breaking off sluiser head causes large pressure drop in the dome space (sluiser failure, water hammer, thermal shock, corrosion or fatigue) causing reverse airflow and HEPA failure	Waste release to atmosphere	BEU	L	IV	L	L	IV	L	N	Basis for NC frequency: Condensation of water vapor from sluicing operations in the headspace cannot cause pressure drops large enough to cause sufficient reverse airflow to fail a 1000 CFM HEPA filter. Therefore the frequency assigned was "beyond extremely unlikely."	Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident" (i.e., the bounding unmitigated offsite radiological consequences for the flammable gas accident are "low" and bound the consequences for release from contaminated facility). The "low" offsite toxicological consequences are based on calculations documented in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System." Basis for NC Onsite consequence: The "low" onsite radiological and toxicological consequences are based on calculations and engineering judgments documented in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System." Basis for NC Facility Worker consequence: The "No" for potential significant facility worker consequences is estimated based on the consequences calculated in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System."	C-1-a	EI

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Risk Bin Rad	NC Offsite Risk Bin Tox	NC Onsite Rad	NC Onsite Risk Bin Rad	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUIC-C-015	18BX	Tank headspace aerosols	Release of radioactive other hazardous materials from SST to the atmosphere from unfiltered release paths due to a tank pressurization	Sluice water evaporates in relatively dry headspace causing a momentary positive spike in headspace pressure releasing headspace contaminates through unfiltered leak paths	Headspace aerosol release through unfiltered paths	A	L	III	L	L	III	L	N	Basis for NC frequency: Heated sluice water will have a higher partial pressure than waste in the SST. Slight pressure spikes will occur when sluicing is begun. Therefore the frequency was assumed to be "anticipated."	Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident" (i.e., the bounding unmitigated offsite radiological consequences for the flammable gas accident are "low" and bound the consequences for release from contaminated facility). The "low" offsite toxicological consequences are based on calculations documented in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System." Basis for NC Onsite consequence: The "low" onsite radiological and toxicological consequences are based calculations and engineering judgments documented in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System." Basis for NC Facility Worker consequence: The "No" for potential significant facility worker consequences is estimated based on the consequences calculated in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System."	C-1-a	E1
MODSLUIC-C-029	18BX	SST headspace aerosols	Release of radioactive and other hazardous materials from SST to atmosphere due to HEPA filter plugging from water vapor (passive ventilation system)	Dissolution water heating system temperature control fails and water temperature reaches point where high temperature dissolution water flashes to steam at sprinkler nozzle causing additional moisture and plugging of the HEPA filter	Release of radioactive or hazardous material to atmosphere	U	L	III	L	L	III	L	N	Basis for NC frequency: Dissolution water heating system is not expected to supply water at temperatures exceeding the boiling point. The event frequency is therefore assumed to be "unlikely."	Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on RPP-13470, "Offsite Radiological Consequences for the Bounding Flammable Gas Accident" (i.e., the bounding unmitigated offsite radiological consequences for the flammable gas accident are "low" and bound the consequences for release from contaminated facility). The "low" offsite toxicological consequences are based on calculations documented in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System." Basis for NC Onsite consequence: The "low" onsite radiological and toxicological consequences are based calculations and engineering judgments documented in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System." Basis for NC Facility Worker consequence: The "No" for potential significant facility worker consequences is estimated based on the consequences calculated in RPP-17965, "Generic Safety Evaluation of the Single-Shell Tank (SST) Modified Sluicing Waste Retrieval System."	C-1-a	E1

Table C-1. Hazardous Conditions Associated With Modified Sluicing Waste Retrieval From 100-Series Single-Shell Tanks That Require Further Safety Evaluation. (16 sheets)

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Bin Rad	NC Offsite Bin Tox	NC Onsite Rad	NC Onsite Bin Rad	NC Onsite Bin Tox	NC Onsite Risk Bin Tox	NC FW Cons	Basis for NC Frequency	Basis for NC Consequence	BIN	NC Env Category
MODSLUIC-D-005	33AX	SST waste	Release of radioactive other hazardous materials from SST pump pit to atmosphere due to waste leak through the electrical connections into an electrical junction box	Electrical connector seal fault or improper assembly causes a flow of waste through the electrical cable up to the nearest junction box	Release of tank waste to atmosphere	A	L	III	L	L	III	L	III	N	<p>Basis for NC frequency: The "anticipated" frequency is based on operating experience (i.e., small leaks in transfer lines that result in a small amount of waste leakage are expected to occur).</p> <p>Basis for NC Offsite consequence: The onsite worker radiological and toxicological consequences are qualitatively assessed to be "low" based on the low pressure and limited volume of the leaking waste.</p> <p>Basis for NC Facility Worker consequence: No significant facility worker consequences are expected based on qualitative assessment of the expected radiological and toxicological exposure from the material released by the event.</p>	C-1-a	E1	
MODSLUIC-E-005	33CX	SST Waste	Release of radioactive other hazardous materials from hose-in-hose transfer line or recirculation line to the atmosphere due to progressive cavity transfer pump high pressure/slug flow	Hose-in-hose transfer line ruptures due to progressive cavity pump high pressure/flow	Release of radioactive material from hose-in-hose transfer line	EU	L	IV	L	H	II	H	II	Y	<p>Basis for NC frequency: The "extremely unlikely" frequency is based on the combined frequency of no flow path or very high flow rate resulting in hose failure with large leak. The nature of a positive displacement pump is that the flow rate is based on the drive speed, not the amount of flow restriction so that a sudden rupture does not cause a flow increase.</p> <p>Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on calculations presented in RPP-14499, "Offsite Radiological Consequence Analysis for the Waste Transfer Leak." The "low" offsite toxicological consequences are based on calculations presented in RPP-13750, "Waste Transfer Leaks Technical Basis Document."</p> <p>Basis for NC Facility Worker consequence: The "high" onsite worker radiological consequence and the "high" onsite worker toxicological consequence are based on calculations for the large pipe break into a pit scenario documented in RPP-13570, "Waste Transfer Leaks Technical Basis Document."</p> <p>Basis for NC Facility Worker consequence: Significant facility worker consequences are expected based on qualitative assessment of the expected radiological and toxicological exposure from the material released by the event.</p>	B-1-a	E2	
MODSLUIC-C-033	33EX	SST headspace aerosols and HEPA filter loading.	Release of radioactive and other hazardous materials from SST to the atmosphere due to waste leak in headspace generating aerosols that plug HEPA filter and lead to failure (active ventilation)	A leak in the transfer pump caused by a failed component or miss-assembly causes excessive aerosols which plug the HEPA causing failure by high differential pressure	Release of radioactive and other hazardous materials to the atmosphere	A	L	III	L	L	III	L	III	N	<p>Basis for NC frequency: The "anticipated" frequency is based on conservative qualitative estimation. Leaks and HEPA filter failures have occurred in the past. Even though no spray leak caused HEPA failures have occurred in tank farms, the assigned frequency is conservative and bounding.</p> <p>Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on calculations presented in RPP-14499, "Offsite Radiological Consequence Analysis for the Waste Transfer Leak." The "low" offsite toxicological consequences are based on calculations presented in RPP-13750, "Waste Transfer Leaks Technical Basis Document."</p> <p>Basis for NC Facility Worker consequence: The onsite worker radiological consequence is "low" and the onsite toxicological consequence is "low" based on qualitative assessment that only high-pressure fine spray leaks will produce consequences above guidelines for the onsite worker.</p> <p>Basis for NC Facility Worker consequence: No significant facility worker consequences are expected based on a qualitative assessment of the volume and form of the leaking material.</p>	C-1-a	E2	

APPENDIX D

**SAFETY EVALUATION FOR SLUICING IN SINGLE-SHELL TANK 241-S-102 WITH
DOUBLE-SHELL TANK 241-SY-102 SUPERNATANT**

This page intentionally left blank.

CONTENTS

D1.0 PURPOSE AND SCOPE..... D-1
D1.1 PURPOSE..... D-1
D1.2 SCOPE..... D-1
D2.0 DESCRIPTION OF THE SUPERNATANT SLUICING DESIGN AND
PROCESS D-1
D3.0 HAZARD ANALYSIS D-3
D3.1 HAZARD IDENTIFICATION AND EVALUATION D-3
D3.2 METHODOLOGY D-3
D3.3 HAZARDOUS CONDITION SCREENING D-3
D4.0 ACCIDENT ANALYSIS..... D-6
D4.1 EVALUATION OF RISK FROM SLUICING WITH DOUBLE-SHELL
TANK SUPERNATANT FOR DSA REPRESENTATIVE ACCIDENTS..... D-6
D4.1.1 Waste Transfer Leaks D-6
D5.0 CONTROLS D-7
D6.0 REFERENCES D-7

ATTACHMENTS

D1 HAZARD ANALYSIS AND CONTROL DECISION RECORD
TEAM MEMBER ROSTERS Attach D1-i
D2 HAZARD EVALUATION DATABASE TABLES Attach D2-i

This page intentionally left blank.

D1.0 PURPOSE AND SCOPE

D1.1 PURPOSE

The purpose of this appendix is to determine if the potential risk associated with using double-shell tank (DST) supernatant to sluice single-shell tanks (SST) for retrieval of the SSTs in the tank farms is adequately addressed and bounded by the tank farms safety basis (RPP-13033, *Tank Farms Documented Safety Analysis* [DSA], and HNF-SD-WM-TSR-006, *Tank Farms Technical Safety Requirements* [TSR]) and to determine if additional controls may be required.

D1.2 SCOPE

The scope of this appendix is the SST modified sluicing waste retrieval system design that is planned for SST 241-S-102 with use of supernatant from DST 241-SY-102. Note that the general modified sluicing design has been previously evaluated in the main body of this document and this attachment only focuses on the unique aspects of using supernatant from DST 241-SY-102 for sluicing. Although this safety evaluation is based on the specific design for SST 241-S-102 retrieval to DST 241-SY-102, the design for use of supernatant as a sluice medium could be used in future SST retrievals. When the system designs and processes for the retrieval of these subsequent SSTs are established, the analysis contained in this appendix will be reviewed via the unreviewed safety question process to determine whether this analysis satisfactorily bounds the retrievals from these tanks.

D2.0 DESCRIPTION OF THE SUPERNATANT SLUICING DESIGN AND PROCESS

SST modified sluicing waste retrieval systems will retrieve waste from designated tanks to the extent needed for tank closure and transfer. The retrieved waste will be transferred to the DST system. The SST modified sluicing waste retrieval system is designed to dissolve SST crystallized salt and/or to mobilize sludge through the application of high pressure water or supernatant spray to break down the waste salt, sludge, and solids and to direct the waste to the intake of a slurry transfer pump for transfer into the DST system. Various SST waste retrieval system sluicing designs may be used. The designs may use sluice nozzles, DST supernatant pump, SST supernatant pump, waste transfer pump(s), monitoring and control systems, portable exhaust ventilation, and new as well as existing waste transfer systems. Support systems necessary for the sluicing design may include raw water and electrical supply.

The sluicing design attributes unique to using DST 241-SY-102 supernatant as a sluice medium for retrieval of SST 241-S-102 are as follows.

- A supernatant pump is in DST 241-SY-102 that uses an existing underground transfer line to pump to the 241-SY-A valve pit, where it is then routed via a hose-in-hose transfer line (HIHTL) to the common riser extension (i.e., an aboveground waste-transfer associated structure located on top of riser) at riser 14 on SST 241-S-102. The supernatant is then introduced into the SST through electrically controlled sluice nozzles in riser 14 or redirected to sluice nozzle riser extensions in risers 11 and/or 16 via HIHTLs. The DST supernatant pump suction floats on the surface of the waste and the slurry distributor in the DST for returning retrieved SST waste is located in the supernatant to minimize disturbance of the DST settled solids.
- The sluice nozzle riser extensions are equipped with leak detectors and gravity drain directly into the SST. The riser extensions will be designed to be able to withstand a vehicle collision or vehicle barriers will protect them and the elevated abovegrade portions of HIHTLs from vehicle collisions.
- The sluice nozzles are connected to an electrically controlled pan and tilt mechanism and utilize supernatant or raw water for sluicing. The supernatant pump installed in DST 241-SY-102 maximum shutoff head and maximum runout are within the bounds of the DSA which are approximately 800 ft and approximately 790 gal/min, respectively. The sluice nozzles are directed from a control station that can be located inside or outside the tank farms fence area.
- Raw water is provided for flushing the waste transfer lines and sluice nozzles. A backflow prevention system is used to prevent or limit the backflow of waste and ensures that no contamination of the raw water supply can occur.
- The HIHTLs are equipped with leak detection at the DST 241-SY-102 central pump pit, 241-SY-A valve pit, the riser extensions of the SST, and any existing tank farms physically connected waste transfer-associated structures. Material balance will be performed using waste level readings at DST 241-SY-102 and flow meter measurements at the common riser extension (riser 14). Radiation surveys will be relied upon between the common riser extension (riser 14) and the riser extensions on risers 11 and 16 to detect a waste transfer leak due to a common mode failure or misroute because (1) there are no flow metering devices at the riser extensions (risers 11 and 16) on the SST, (2) liquid level monitoring in the SST is not a reliable method of performing material balances in the SST (i.e., installed instrumentation locations and waste solid interference may not allow the instrumentation to extend to the bottom of the SST), and (3) instrument gauges could be damaged during sluicing operations in the SST.

D3.0 HAZARD ANALYSIS

D3.1 HAZARD IDENTIFICATION AND EVALUATION

The graded approach was used to select the hazard identification and evaluation method. The goal of the graded approach is to select a method that does not create a large number of hazardous conditions redundant to those in the DSA hazard evaluation database (RPP-15188, *Hazard Evaluation Database Report*). The “delta” hazard analysis method was chosen. The “delta” hazard analysis method uses the concept of “deviations from a baseline” to identify hazardous conditions that require further evaluation.

D3.2 METHODOLOGY

SST modified sluicing operations using DST supernatant is an activity that has not been approved under the DSA. However, under the previous Basis for Interim Operation/Final Safety Analysis Report, supernatant for sluicing was authorized via the W-320 project. Therefore, as a starting point, the hazardous conditions identified for the W-320 project were reviewed to ensure the completeness of the hazard evaluation. A team composed of Nuclear Safety & Licensing, Engineering, and Operations systematically evaluated sluicing using DST supernatant with the DSA representative and candidate accidents acting as study nodes. The attendance roster is included in Attachment D1 to document the presence of each team member.

D3.3 HAZARDOUS CONDITION SCREENING

Hazardous conditions involving exposure to radioactive and other hazardous materials were assigned a representative accident and/or a candidate accident designator. The representative accident designator allows cross reference to the appropriate analysis in the DSA. Candidate accident designators allow hazardous conditions to be compared with the hazardous conditions contained in the DSA hazard evaluation database.

Hazardous conditions were screened to determine if they potentially (1) are not represented by a DSA representative or candidate accident, (2) are similar to, but not bounded by a DSA representative or candidate accident, or (3) are similar to and bounded by a DSA representative or candidate accident but are unique in regard to phenomena or control applicability. Hazardous conditions meeting one or more of these criteria are further evaluated in Chapter 4.0. Only those hazardous conditions that are found to meet the screening criteria after further evaluation are incorporated into the DSA hazard evaluation database (see Attachment D2).

A general concern was identified with regards to the source term assumptions for all the DSA accident analyses. The specific concern was that the supporting calculations for the accidents postulated in the SSTs may have used SST source term values that may be challenged by the DST source term values due to the introduction of DST supernatant waste. Therefore, the following evaluation was performed.

1. All applicable DSA SST accidents were reviewed to verify they used bounding SST source terms.
2. The SST bounding radiological and toxicological liquid source terms were obtained from RPP-5924, *Radiological Source Terms for Tank Farms Safety Analysis*, Rev. 4, and RPP-8369, *Chemical Source Terms for Tank Farms Safety Analyses*, Rev. 2, as reported in Table D-1.
3. The DST 241-SY-101, 241-SY-102, and 241-SY-103 liquid source terms were obtained from RPP 5924, Rev. 4, and RPP-8369, Rev. 2, as reported in Table D-1.
4. An evaluation was performed for planned operations in DSTs 241-SY-101, 241-SY-102, and 241-SY-103 to confirm that there are no planned waste transfers into these DSTs other than the sluicing retrieval operations for SSTs 241-S-102 and 241-S-112. The sluicing retrieval operations of SSTs 241-S-102 and 241-S-112 will only create more and more dilute supernatant each time the 241-SY DST is filled up and the supernatant is used for sluicing the SST 241-S-102. Additionally it can be assumed that only the most dilute DST supernatant will be used because it will be skimmed off the top of the DST waste via a flex and float supernatant pump. This verifies that the liquid source terms obtained from RPP 5924, Rev. 4, and RPP-8369, Rev. 2, are worst case source terms that could be introduced into 241-S-102.
5. A comparison of the DST liquid source terms with SST bounding source terms was made.

Table D-1. Liquid Unit Liter Doses and Sum of Fractions for 241-S-102 Waste Transfer.

Tank	Liquid ULD Onsite	Liquid ULD Offsite	Liquid SOFs		
			TEEL-1 Offsite Mod	TEEL-2 Onsite Mod/Offsite High	TEEL-3 Onsite High
241-SY-101	6.5E+01	4.7E+01	1.39E+09	1.78E+08	5.89E+06
241-SY-102	6.8E+01	6.2E+01	1.47E+09	1.91E+08	6.44E+06
241-SY-103	1.2E+02	8.8E+01	2.44E+09	3.10E+08	9.41E+06
Bounding SST	4.5E+02 (241-U-106)	6.0E+02 (241-U-106)	3.71E+09 (241-A-106)	5.73E+08 (241-A-106)	1.25E+07 (241-A-106)

Notes:

- SST = single-shell tank.
 TEEL = Temporary Emergency Exposure Limit.
 ULD = unit liter dose.

The conclusion from this evaluation is that all SST accidents associated with modified sluicing in an SST bound the DST 241-SY-101, 241-SY-102, and 241-SY-103 liquid source terms and, therefore, this concern is not evaluated further in this document.

Representative Accident 1, Flammable Gas Accidents (Candidate Accidents 04/05)

Hazardous conditions involving steady-state flammable gas releases and flammable gas release events (spontaneous and induced) were identified for SST sluicing operations using DST supernatant (i.e., the addition of DST waste to an SST). Review of these hazardous conditions determined that they were represented by existing hazardous conditions and bounded by the existing flammable gas accident analysis. The existing controls (safety structures, systems, and components [SSC] and TSR) were also determined to be applicable to prevent the postulated flammable gas accidents. Therefore, this representative accident is not evaluated further in this document.

Representative Accident 2, Nuclear Criticality (Candidate Accident 01)

Hazardous conditions involving nuclear criticality are identified in the DSA and are representative of hazardous conditions for this activity. The nuclear criticality safety management program has been identified in the DSA as the control to ensure that a nuclear criticality event remains “beyond extremely unlikely.” The nuclear criticality safety program will review sluicing with supernatant and, if necessary, establish any required controls in tank farm procedures (e.g., criticality prevention specification). Therefore, this representative accident is not evaluated further in this document.

Representative Accident 13, Waste Transfer Leak (Candidate Accidents 33A, 33C, 33D)

Hazardous conditions involving waste leaks were identified as having characteristics similar to the hazardous conditions in the DSA hazard evaluation database. With respect to controls, however, it was identified that a material balance could not be performed that would detect waste leaks in all waste transfer route sections or detect all potential misroutes. Therefore, material balance controls were identified as needing to be further evaluated (see Section 4.1.1). Additionally, the supernatant waste transfer design was evaluated to verify that the configuration for a siphon event that could overflow a tank is “beyond extremely unlikely.” The siphon event was a concern because the waste transfer slurry distributor is located below the waste surface and the sluice nozzles are located towards the bottom of SST 241-S-102. Based on RPP-CALC-23558, *Tank 241-S-102 Retrieval Overflow Due To Siphoning Calculation*, the siphon event is “beyond extremely unlikely” and, therefore, no further evaluation is required.

Identifiable to a Candidate Accident but DSA Hazardous Conditions Determined to be Risk Bin III or IV (i.e., no Representative Accident identified), Tank Bump (Candidate Accident 18A)

Hazardous conditions involving tank bump are identified in the DSA and are representative of hazardous conditions for this activity. Waste transfer controls have been established in the DSA to ensure that tank bump remains “beyond extremely unlikely.” Therefore this representative accident is not evaluated further in this document.

D4.0 ACCIDENT ANALYSIS

D4.1 EVALUATION OF RISK FROM SLUICING WITH DOUBLE-SHELL TANK SUPERNATANT FOR DSA REPRESENTATIVE ACCIDENTS

D4.1.1 Waste Transfer Leaks

D4.1.1.1 DSA Representative Accidents

The DSA-related representative accident is the “large pipe break into a pit” scenario. The large pipe break into a pit scenario assumes that a large pipe break has occurred, and that waste is leaking into an open pit at the maximum flow rate of the transfer pump. DSA Section 3.3.2.4.13, “Waste Transfer Leak,” addresses this hazardous condition.

D4.1.1.2 Waste Retrieval System Operations Hazardous Condition

Based on the hazard identification and evaluation in Chapter 3.0, the potential waste transfer leak hazards for SST sluicing operations using DST supernatant are represented by existing hazardous conditions and bounded by existing waste transfer leak analysis. However, further evaluation of TSR Administrative Control (AC) 5.11 key element 5.11.2.b.1, “Material Balance,” is needed because the implementation of the material balance controls for SST sluicing operations using DST supernatant is not possible or practicable for some sections of the planned waste transfer route.

For example, material balance monitoring covering all waste transfer route sections may not be possible during SST waste retrieval because of potential damage to SST waste level monitoring instrumentation during sluicing operations or because the location of SST waste level monitoring instrumentation or waste solid interference prevents accurate measurements when the SST waste volume is low. Material balance monitoring may also not be practical when there are significant as low as reasonably achievable (ALARA) concerns involving the installation, maintenance, or repair of instrumentation required for material balance monitoring (e.g., flow instrumentation) in contaminated waste transfer-associated structures. In addition, installing instrumentation required for performing material balance monitoring at the end of all waste transfer route sections may not be practical from an engineering perspective for waste transfer route sections that have no or limited misroute potential and where an alternative control equivalent to material balance monitoring is available. An example is the multiple HIHTL sections of an SST waste retrieval system between the waste transfer-associated structure located on or near the SST and the SST riser extensions or structures containing sluice nozzles. In this example, flow instrumentation would only be provided in the waste transfer-associated structure on or near the SST for performing material balance monitoring between this structure and the DST system, and radiation surveys would be performed in lieu of material balance monitoring to detect waste leaks in the HIHTL sections connecting this structure to the individual SST riser extensions or structures containing sluice nozzles. Therefore, the material balance control was revised to allow alternate means to detect and respond to waste leaks and misroutes.

D4.1.1.3 Conclusions

An amendment for the DSA and TSRs has been developed to revise the material balance control (AC 5.11 key element 5.11.2.b.1). The revision allows for alternate material balance controls to be used for SST retrieval waste transfers when it is not possible or practical for material balance monitoring to detect waste leaks in all waste transfer route sections. Radiation surveys must be performed for sections of the waste transfer route where the material balance cannot detect waste leaks and there must be alternative methods to material balance monitoring for detecting misroutes.

The alternate material balance monitoring controls were selected based on the consensus of the decision team which was composed of Nuclear Safety & Licensing, Engineering, and Operations personnel. The attendance roster and an e-mail from an operations representative are included in Attachment D1 to document the presence of each team member.

D5.0 CONTROLS

Based on the hazard and accident analyses of SST modified sluicing in SST 241-S-102 using DST 241-SY-102 supernatant, no new accidents were identified, and the existing DSA analyses were found to be encompassing and bounding. The DSA controls (i.e., safety SSCs and TSRs) were also found to acceptably prevent or mitigate potential hazardous conditions and postulated accidents with the exception of the TSR AC 5.11, material balance control (see Section 4.1.1). The AC 5.11 material balance control was revised to include alternate methods (radiation surveys) to detect waste leaks and misroutes during SST waste retrieval operations and activities.

D6.0 REFERENCES

- HNF-SD-WM-TSR-006, 2004, *Tank Farms Technical Safety Requirements*, Rev. 4, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-CALC-23558, 2004, *Tank 241-S-102 Retrieval Overfill Due To Siphoning Calculation*, Rev. 0, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-5924, 2003, *Radiological Source Terms for Tank Farms Safety Analysis*, Rev. 4, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-8369, 2003, *Chemical Source Terms for Tank Farms Safety Analyses*, Rev. 2, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-13033, 2004, *Tank Farms Documented Safety Analysis*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-13750, 2004, *Waste Transfer Leaks Technical Basis Document*, Rev. 10, CH2M HILL Hanford Group, Inc., Richland, Washington.

RPP-17965 REV 4

RPP-14499, 2003, *Offsite Radiological Consequence Analysis for the Waste Transfer Leak*, Rev. 2, CH2M HILL Hanford Group, Inc., Richland, Washington.

RPP-15188, 2004, *Hazard Evaluation Database Report*, Rev. 7-B, CH2M HILL Hanford Group, Inc., Richland, Washington.

RPP-17965 REV 4

ATTACHMENT D1

**HAZARD ANALYSIS AND CONTROL DECISION RECORD
TEAM MEMBER ROSTERS**

This page intentionally left blank.

Smith, Ryan D

From: Hopkins, Gary P
Sent: Friday, December 19, 2003 8:07 AM
To: Smith, Ryan D; Saueressig, David J
Cc: Burke, Christopher A; Grigsby, J M (Mike); Reichmuth, Curtis R
Subject: RE: Waste Transfer Controls for Supernatant Re-circulation

Ryan,

The rad survey is the preferred method for ease of operation and the entire route will be surveyed as a matter of normal operations.

-----Original Message-----

From: Smith, Ryan D
Sent: Thursday, December 18, 2003 3:08 PM
To: Saueressig, David J
Cc: Burke, Christopher A; Grigsby, J M (Mike); Hopkins, Gary P
Subject: Waste Transfer Controls for Supernatant Re-circulation

Dave,

Earlier today I conducted a Control Decision meeting to discuss alternate control strategies for sluicing in C-Farm using Supernatant from AN-106 with regards to Waste Transfer Leak Material Balance controls (required to mitigate a common-mode failure of the HIHTL). Based on the proposed engineering design there is no way of verifying that the supernatant from AN-106 reaches the C-Farm SST between the portable pit and the sluice pits on the SST. Control options that were discussed are as follows:

- Radiation Surveys
- Field Walk downs
- Visual inspection of sluice medium in SST by Camera systems
- Pressure Indicators from instrumentation
- Flow meters in sluice pits

Of these options the two that seemed most reasonable to implement were Rad Surveys (able to detect a large pool) or installing Flow meters in the sluice pits. Since the sluice pits tend to be highly contaminated and are difficult to do maintenance work in (ALARA concerns) the control decision team felt the Rad Surveys would be the better option. Additionally the team assumed the operations staff would be performing surveys anyways so there would be minimal impact on resources and cost for implementation. The Rad Surveys would only need to be performed on dedicated portions of the HIHTL that don't have flow meter indicators as long as no other waste transfer lines are physically connected and the frequency would be consistent with the current Material Balance control frequency based on pump flow rates, allowing for time to shut down the waste transfer pumps and evacuate personnel.

Since no one from operations was able to attend the meeting, I would like to obtain your concurrence for Operations on this decision. If you have any questions please let me know so we can discuss in further detail.

Thanks

Ryan D. Smith, NS&L Engineer
Phone: 372-1383
Pager: 85-9030
Location: 2704HV/200E/E215 (Mail Stop: S7-90)
E-mail: Ryan_D_Smith@rl.gov

This page intentionally left blank.

RPP-17965 REV 4

ATTACHMENT D2

HAZARD EVALUATION DATABASE TABLES

This page intentionally left blank.

Table D2-1. Modified Sluicing with Double-Shell Tank Supernatant New Hazardous Conditions (Without Controls).

ID	Candidate Accident	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Offsite Tox	NC Onsite Rad	NC Onsite Tox	NC FW Cons	NC Offsite Risk Bin Rad	NC Offsite Risk Bin Tox	NC Onsite Risk Bin Rad	NC Onsite Risk Bin Tox	Basis for NC Consequence	Basis for NC Frequency	BIN	NC Env Category
SUPERSLUICE-010	33CX	Liquid radioactive waste being transferred during SST waste sluicing/retrieval	Release of radioactive and other hazardous materials or direct radiation exposure from waste leaked to soil surface or into the atmosphere due to waste leaks from large pipe break in exposed transfer lines (includes leaks in hose-in-hose transfer lines)	Hose-in-hose transfer line failures from vehicle impact or operational events during supernatant sluicing of an SST	Release of radioactive and other hazardous materials to the atmosphere	A	L	L	H	H	Y	III	III	I	I	Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on calculations presented in RPP-14499, "Offsite Radiological Consequence Analysis for the Waste Transfer Leak." The "low" offsite toxicological consequences are based on calculations presented in RPP-13750, "Waste Transfer Leaks Technical Basis Document." Basis for NC Onsite Worker consequence: The "high" onsite worker radiological consequence and the "high" onsite worker toxicological consequence are based on calculations for the large pipe break into a pit scenario documented in RPP-13750, "Waste Transfer Leaks Technical Basis Document." Basis for NC Facility Worker consequence: Significant facility worker consequences are expected based on qualitative assessment of the expected radiological and toxicological exposure from the material released by the event.	Basis for NC frequency: The "anticipated" frequency is based on a qualitative assessment that human error leading to damage of a transfer line due to a variety of causes would be expected to occur if no controls were in place.	B-1-b	E2

Notes:

RPP-13750, 2004, *Waste Transfer Leaks Technical Basis Document*, Rev. 9, CH2M HILL Hanford Group, Inc., Richland, Washington.
RPP-14499, 2003, *Offsite Radiological Consequence Analysis for the Waste Transfer Leak*, Rev. 2, CH2M HILL Hanford Group, Inc., Richland, Washington.

- A = anticipated
- FW = facility worker
- H = high
- L = low
- NC = no controls
- SST = single-shell tank
- Y = yes

Table D2-2. Modified Sluicing with Double-Shell Tank Supernatant New Hazardous Conditions (With Controls).

ID	Candidate Accident	Preventive SSC	Preventive TSR	Mitigative SSC	Mitigative TSR	Facility Worker Controls	WC Freq	WC Offsite Rad	WC Offsite Tox	WC Onsite Rad	WC Onsite Tox	WC Offsite Risk Bin Rad	WC Offsite Risk Bin Tox	WC Onsite Risk Bin Rad	WC Onsite Risk Bin Tox	Basis for WC Consequence	Basis for WC Frequency	NC Env Category	Environmental Controls	Remarks
SUPERSLUICE-010	33CX	SS: Hose-in-Line Systems SS: Aboveground Transfer System Vehicle Barriers	AC: Transfer Controls ^ Transfer System Configuration Management - Vehicle access restrictions or aboveground transfer system vehicle barriers	None required	AC: Safety Management Programs ^ Radiological Control ^ Training AC: Emergency Preparedness AC: Transfer Controls ^ Operating Requirements - Material Balance	Preventive SSCs and TSRS and mitigative TSRS are allocated to this hazardous worker risk. The preventive SSCs and TSRS address facility worker risk by reducing the frequency of the event. In addition, the specified Safety Management Programs and Emergency Preparedness address facility worker risk by minimizing the duration of facility worker exposure.	U	L	L	L	L	III	III	III	III	Basis for WC consequence: The controls are qualitatively judged to reduce the consequences to "low" for the various scenarios involved. See RPP-13750, "Waste Transfer Leaks Technical Basis Document, for additional information.	Basis for WC frequency: The controls are qualitatively judged to reduce the frequency by one bin for "anticipated" accident scenarios. Scenarios with lower frequency are generally unchanged.	E2	Preventive and mitigative controls allocated to this hazardous condition to address nuclear safety risk also address environmental risk. See DSA Section 3.3.2.3.4 for additional design and operational features for protecting the environment from this impact.	This hazardous condition is intended to capture the use of alternate material balance controls for modified sluicing with supernatant when the standard material balance controls are not possible or practical due to design configuration.

Notes:

RPP-13750, 2004, *Waste Transfer Leaks Technical Basis Document*, Rev. 9, CH2M HILL Hanford Group, Inc., Richland, Washington.

- AC = administrative control
- DSA = documented safety analysis
- L = low
- SS = safety-significant
- SSC = systems, structures, and components
- TSR = technical safety requirement
- U = unlikely
- WC = with controls

This page intentionally left blank.

APPENDIX E

**SAFETY EVALUATION FOR SLUICING IN SINGLE-SHELL TANK 241-C-103 WITH
DOUBLE-SHELL TANK 241-AN-106 SUPERNATANT**

This page intentionally left blank.

CONTENTS

E1.0 PURPOSE AND SCOPE.....E-1
E1.1 PURPOSE.....E-1
E1.2 SCOPE.....E-1

E2.0 DESCRIPTION OF THE SUPERNATANT SLUICING DESIGN AND
PROCESSE-1

E3.0 HAZARD ANALYSISE-3
E3.1 HAZARD IDENTIFICATION AND EVALUATIONE-3
E3.2 METHODOLOGYE-3
E3.3 HAZARDOUS CONDITION SCREENINGE-3

E4.0 ACCIDENT ANALYSIS.....E-5
E4.1 EVALUATION OF RISK FROM SLUICING WITH DOUBLE-SHELL
TANK SUPERNATANT FOR DSA REPRESENTATIVE ACCIDENTS.....E-5
E4.1.1 Mixing of Incompatible MaterialsE-5
E4.1.2 Waste Transfer LeaksE-6

E5.0 CONTROLSE-8

E6.0 REFERENCESE-8

ATTACHMENT

E1 HAZARD EVALUATION DATABASE TABLES Attach E1-i

This page intentionally left blank.

E1.0 PURPOSE AND SCOPE

E1.1 PURPOSE

The purpose of this appendix is to determine if the potential risk associated with using double-shell tank (DST) supernatant to sluice single-shell tanks (SST) for retrieval of the SSTs in the tank farms is adequately addressed and bounded by the tank farms safety basis (RPP-13033, *Tank Farms Documented Safety Analysis* [DSA], and HNF-SD-WM-TSR-006, *Tank Farms Technical Safety Requirements* [TSR]) and to determine if additional controls may be required.

E1.2 SCOPE

The scope of this appendix is the SST modified sluicing waste retrieval system design that is planned for SST 241-C-103 with use of supernatant from DST 241-AN-106. Note that the general modified sluicing design has been previously evaluated in the main body of this document and the sluicing design with DST supernatant in 241-S-102 has been previously evaluated in Appendix D of this document. This attachment only focuses on the unique aspects of the 241-C-103 design and the use of supernatant from DST 241-AN-106 for sluicing. Although this safety evaluation is based on the specific design for SST 241-C-103 retrieval to DST 241-AN-106, this design could be used in future SST retrievals. When the system designs and processes for the retrieval of these subsequent SSTs are established, the analysis contained in this safety evaluation, including this appendix will be reviewed via the unreviewed safety question process to determine whether this analysis satisfactorily bounds the retrievals from these tanks.

E2.0 DESCRIPTION OF THE SUPERNATANT SLUICING DESIGN AND PROCESS

SST modified sluicing waste retrieval systems will retrieve waste from designated tanks to the extent needed for tank closure and transfer. The retrieved waste will be transferred to the DST system. The SST modified sluicing waste retrieval system is designed to dissolve SST crystallized salt and/or to mobilize sludge through the application of high pressure water or supernatant spray to break down the waste salt, sludge, and solids and to direct the waste to the intake of a slurry transfer pump for transfer into the DST system. Various SST waste retrieval system sluicing designs may be used. The designs may use sluice nozzles, DST supernatant pump, SST supernatant pump, waste transfer pump(s), monitoring and control systems, portable exhaust ventilation, and new as well as existing waste transfer systems. Support systems necessary for the sluicing design may include raw water and electrical supply.

The sluicing design attributes unique to using DST 241-AN-106 supernatant as a sluice medium for retrieval of SST 241-C-103 are as follows.

- Supernatant is pumped from DST 241-AN-106 through a hose-in-hose transfer line (HIHTL) to the 241-C Tank Farm portable valve and instrument pit where it will be routed to the sluicer nozzles in the SSTs through other sections of HIHTL. The supernatant pump is a Floway centrifugal pump. The pumping performance has been evaluated and determined to be bounded by the DSA using the pumping curves in RPP-19618, *AN-106 Supernatant Pump Process Flow for C-103 Sluicing*.
- The portable valve and instrument pit is located in 241-C Tank Farm and is a fully abovegrade assembly that serves the same function as a belowgrade valve pit. The portable valve and instrument pit does not drain directly to an SST, therefore, a sump pump provides the mechanism to pump waste through one of the HIHTLs to the SST in the case of a leak. Leak detectors are located in the pit. Vehicle barriers will protect it and the abovegrade portions of hoses from vehicle collisions.
- The sluice nozzles, located in the SST 241-C-103 sluice and pump pits, are connected to a hydraulically controlled pan and tilt mechanism and utilize supernatant or raw water for sluicing. The SST retrieval pump is a Gorman-Rupp¹ centrifugal pump located in the heel pit. The pumping performance has been evaluated and determined to be bounded by the DSA using the pumping curves in RPP-19621, *C-103 Slurry Pump Process Flow Calculation*.
- The raw water connection for flushing or sluicing is located on a skid outside the portable valve and instrument pit. Two waste transfer system valves will provide physical disconnection of the raw water line where it exits the portable valve and instrument pit.
- Transfer leak detection systems are installed at the DST 241-AN-106 central pump pit, 241-C Tank Farm portable valve and instrument pit, heel pit, sluice pit, and pump pit. The leak detectors located in the sluice and pump pits (where there is potential for hydraulic oil to be present) are TraceTek² leak detector systems that use electrical conductivity probes that remain operable in Mobile, Quaker Quintolubric 8-33-EHC, and Shell Tellus³ Plus 46 hydraulic oil (RPP-19524, *Hydraulic Fluid Compatibility with TraceTek Leak Detection System and Mini-Probe*).
- Material balance will be performed by level readings at DST 241-AN-106 and flow meter measurements at the 241-C Tank Farm portable valve and instrument pit. There are no flow metering devices at the heel pit, sluice pit, or pump pit of the SSTs and liquid level monitoring in the SST is not practical or possible. Therefore, radiation survey controls (as developed in Appendix D for the 241-S-102 design) will be relied upon in addition to material balance controls to detect and mitigate a waste transfer leak or misroute.

¹ Gorman-Rupp is a trademark of Gorman-Rupp Company.

² TraceTek is a trademark of Raychem Corporation.

³ Tellus is a trademark of Shell Company.

- There is a large elevation difference between SST 241-C-103 and DST 241-AN-106 and, therefore, the DST supernatant pump and DST waste discharge drop leg have a siphon break to prevent an overflow of SST 241-C-103.

E3.0 HAZARD ANALYSIS

E3.1 HAZARD IDENTIFICATION AND EVALUATION

The graded approach was used to select the hazard identification and evaluation method. The goal of the graded approach is to select a method that does not create a large number of hazardous conditions redundant to those in the DSA hazard evaluation database (RPP-15188, *Hazard Evaluation Database Report*). The “delta” hazard analysis method was chosen. The “delta” hazard analysis method uses the concept of “deviations from a baseline” to identify hazardous conditions that require further evaluation.

E3.2 METHODOLOGY

The hazard evaluation performed for the SST 241-C-103 design is the same one that is documented in Appendix D and, therefore, only the unique hazardous conditions associated with the SST 241-C-103 to DST 241-AN-106 transfer are included and evaluated in this appendix.

E3.3 HAZARDOUS CONDITION SCREENING

Hazardous conditions involving exposure to radioactive and other hazardous materials were assigned a representative accident and/or a candidate accident designator. The representative accident designator allows cross reference to the appropriate analysis in the DSA. Candidate accident designators allow hazardous conditions to be compared with the hazardous conditions contained in the DSA hazard evaluation database.

Hazardous conditions were screened to determine if they potentially (1) are not represented by a DSA representative or candidate accident, (2) are similar to, but not bounded by a DSA representative or candidate accident, or (3) are similar to and bounded by a DSA representative or candidate accident but are unique in regard to phenomena or control applicability. Hazardous conditions meeting one or more of these criteria are further evaluated in Chapter 4.0. Only those hazardous conditions that are found to meet the screening criteria after further evaluation are incorporated into the DSA hazard evaluation database (see Attachment E1).

The same general concern that was identified for SST 241-S-102 in Appendix D with regards to the source term assumptions for all the DSA accident analyses was also identified for 241-C-103. The specific concern was that the supporting calculations for the accidents postulated in the SSTs may have used SST source term values that may be challenged by the DST source term values due to the introduction of DST supernatant waste. Since there is uncertainty associated with the DST 241-AN-106 supernatant waste inventory that may be present at the start of operations of

SST 241-C-103 retrieval, a TSR control was developed to verify that DST waste additions to SSTs are bounded by the source term assumptions used in the accident analysis that are impacted by the waste addition. The current bounding 100-series SST radiological and toxicological liquid source terms obtained from RPP-5924, *Radiological Source Terms for Tank Farms Safety Analysis*, and RPP-8369, *Chemical Source Terms for Tank Farms Safety Analyses*, are reported in Table E-1.

Table E-1. Unit Liter Dose and Sum of Fractions for the Bounding Single-Shell Tank 100-Series Waste.

Tank	Liquid ULD Onsite	Liquid ULD Offsite	Liquid SOFs		
			TEEL-1	TEEL-2	TEEL-3
Bounding SST	4.5E+02 (241-U-106)	6.0E+02 (241-U-106)	3.71E+09 (241-A-106)	5.73E+08 (241-A-106)	1.25E+07 (241-A-106)

Notes:

- SST = single-shell tank.
- TEEL = Temporary Emergency Exposure Limit.
- ULD = unit liter dose.

Representative Accident 11, Mixing of Incompatible Materials (Candidate Accidents 03/23)

Hazardous conditions involving mixing of incompatible materials for tank pressurization are identified in the DSA and are representative of hazardous conditions for this activity. Hazardous conditions involving mixing of incompatible materials for toxic material release were identified as potentially being unique to the DST supernatant sluicing design and process and, therefore, a further evaluation was determined to be warranted. The specific concerns are due to the organic waste composition in the 241-C Tank Farm tanks potentially containing large amounts of organics and ammonia that could be released due to sluicing using DST supernatant.

Representative Accident 13, Waste Transfer Leak (Candidate Accidents 33A, 33C, 33D)

Hazardous conditions involving waste leaks were identified as having characteristics similar to the hazardous conditions in the DSA hazard evaluation database. However, a siphon event due to the elevation differences between the SST and DST was identified as a credible accident scenario and, therefore, a further evaluation was determined to be warranted. Additionally, the waste transfer controls were identified as needing further evaluation for the operation of the sump pump in the portable aboveground valve and instrument pit and for the operability of electrical conductivity probes in the presence of hydraulic fluid that could leak into the sluice and pump pits where the SST 241-C-103 sluice nozzles are located.

Identifiable to a Candidate Accident but DSA Hazardous Conditions Determined to be Risk Bin III or IV (i.e., no Representative Accident identified), Tank Bump (Candidate Accident 18A)

Hazardous conditions involving tank bump were identified as a potentially credible accident scenario based on the current DSA accident analysis. Based on RPP-6213, *Hanford Waste Tank*

Bump Accident and Consequence Analysis, if at least one of the following criteria is met a tank bump accident is “beyond extremely unlikely.”

1. Total tank heat load is $\leq 38,000$ Btu/h
2. Non-convective layer thickness is ≤ 12 in.
3. Supernatant depth is ≤ 40 in.
4. The non-condensable gas generation rate in the non-convective layer is sufficiently low, such that the ratio of vertical void fraction profile to the neutral buoyant void fraction is < 1.0 .

Preliminary analysis based on 241-C Tank Farm retrieval planning as documented in RPP-21753, *C-Farm 100 Series Tanks, Retrieval Process Flowsheet Description*, has identified that during 241-C Tank Farm SST retrieval operations the heat load will exceed the 38,000 Btu/h in DSTs 241-AN-106 and 241-AY-101 and none of the other criteria will be met. Therefore, the tank bump accident may become credible. Although waste retrieval operations from SST 241-C-103 to DST 241-AN-106 will not challenge the 38,000 Btu/h heat load criteria, the technical supporting documentation (i.e., RPP-6213 and RPP-13438, *Technical Basis for the Tank Bump Accident and Associated Representative Hazardous Conditions*) and TSR page changes that support this change are being submitted with this amendment to raise the DST heat load required for a tank bump in support of future 241-C Tank Farm SST retrieval operations.

E4.0 ACCIDENT ANALYSIS

E4.1 EVALUATION OF RISK FROM SLUICING WITH DOUBLE-SHELL TANK SUPERNATANT FOR DSA REPRESENTATIVE ACCIDENTS

E4.1.1 Mixing of Incompatible Materials

E4.1.1.1 DSA Representative Accidents

The related DSA representative accident is 11 (candidate accidents 03 and 23), Mixing of Incompatible Materials. The technical basis for the mixing of incompatible materials analysis is summarized in DSA Section 3.3.2.4.11, “Mixing of Incompatible Materials.”

E4.1.1.2 Waste Retrieval System Operations Hazardous Conditions

The hazard analysis postulated that the addition of DST 241-AN-106 supernatant into the organic bearing waste in the 241-C Tank Farm tanks could result in organic vapor releases. Tank waste mixing and tank waste conditions were considered in the DSA analysis. Tank waste mixing with other tank waste (i.e., reactions due to a transfer from one tank to another) do not

result in a significant release as discussed in RPP-9689, *Offsite Radiological Consequence Calculation for the Bounding Mixing of Incompatible Materials Accident*. The organic waste remaining in the tank waste consists of either low volatility solvents or water soluble complexants which were shown to be compatible with tank wastes. Therefore, organic vapors would not be released in significant quantities due to the addition of sluicing liquid.

Ammonia releases were also considered in the DSA analysis. Process knowledge and past history of the various waste disturbing activities (e.g., waste transfers, remediation of DST 241-SY-101) has shown the potential to release dissolved ammonia. These releases, while shown to be a potential facility worker concern, result in low consequences to the onsite worker or offsite public even for waste released into the headspace of a ventilated tank. These situations are adequately and appropriately addressed by the industrial hygiene safety management program. The analysis also looked at the potential to generate additional ammonia due to the addition of caustic solutions (such as the sluicing liquid). It was found that the pH in the tank would have to be made extremely basic to reach the saturation point for ammonia release (equivalent to 4 M/L of sodium hydroxide in the waste). Using supernatant from DST 241-AN-106 as a sluicing liquid would not cause the tank waste to be sufficiently basic to result in a saturated solution. Even if these conditions are achieved, the release would be below the evaluation guidelines resulting in low consequences.

E4.1.1.3 Conclusions

The sluicing operations using DST 241-AN-106 supernatant in 241-C Tank Farms are bounded by the current hazard and accident analysis and no additional controls are required.

E4.1.2 Waste Transfer Leaks

E4.1.2.1 DSA Representative Accidents

The DSA representative accidents are the “fine spray into the air” scenario and the “large pipe break into a pit” scenario. The fine spray into the air scenario assumes that a small width crack (the optimal width for producing fine aerosol) has occurred in a waste transfer line, and that waste slurry is spraying into the air under maximum available pump pressure. The large pipe break into a pit scenario assumes that a large pipe break has occurred, and that waste is leaking into an open pit at the maximum flow rate of the transfer pump. DSA Section 3.3.2.4.13, “Waste Transfer Leak,” addresses these hazardous conditions. The DSA section also addresses several other accident scenarios, but the fine spray into the air and the large pipe break into a pit scenario are the limiting scenarios. The DSA estimates the frequency of the fine spray into the air scenario to be “unlikely,” and the large pipe break into a pit scenario to be “anticipated.” The onsite radiological and toxicological guidelines are exceeded for the two representative accident scenarios, and safety SSCs and/or TSR controls are required. The offsite radiological and toxicological guidelines are not exceeded.

E4.1.2.2 Waste Retrieval System Operations Hazardous Conditions

Based on the hazard identification and evaluation in Chapter 3.0, the potential waste transfer leak hazards for SST 241-C-103 sluicing operations are represented by existing hazardous conditions and bounded by existing waste transfer leak analysis. However, further evaluation of waste transfer leak TSR controls for three hazardous conditions was required. For additional details see RPP-13750, *Waste Transfer Leaks Technical Basis Document*.

The first hazardous condition is a pool leak as a result of a back siphon from DST 241-AN-106 to SST 241-C-103. The current DSA assumes a siphoning accident that overflows a waste tank is “beyond extremely unlikely” based on existing planned waste transfer configurations in the tank farms. The planned waste transfer between SST 241-C-103 and DST 241-AN-106 has the potential to siphon supernatant waste from DST 241-AN-106 back to SST 241-C-103, which is much lower in elevation. Therefore, the design of the DST supernatant pump and DST waste discharge drop leg incorporates siphon breaks to prevent this hazardous condition.

The second hazardous condition is the operation of the sump pump in case of a leak in the portable aboveground valve and instrument pit. When a leak is detected in the portable valve and instrument pit, the leak detector is considered inoperable and, therefore, the pump must be under administrative lock. Therefore, an exception from TSR LCO 3.1.1, “Transfer Leak Detection Systems,” was identified for waste transfer-associated structures where the active waste transfer pump physically connected to the structure is a sump pump located in the structure. Performing a material balance for sump pump transfers of waste out of a waste transfer-associated structure are also not possible or practical. Therefore, the following two exceptions to AC 5.11.2.b.1 material balancing monitoring requirement were identified.

1. Transfers of waste present in a waste transfer-associated structure directly back to the underlying tank using a sump pump.
2. Transfer of < 1,000 gal of waste out of a waste transfer-associated structure using a sump pump and connecting waste transfer system to a tank.

Note: For waste transfers of > 1,000 gal using a waste transfer-associated structure sump pump where material balance monitoring is not possible or practical, radiation surveys of the waste transfer route and alternative methods for detecting misroutes are required (see Appendix D).

The third hazardous condition affects the operability of the electrical conductivity probes from hydraulic fluid leaks in the sluice and pump pits where the SST 241-C-103 sluice nozzles are located. For some types of electrical conductivity probes the presence of hydraulic fluid on the electrodes may interfere with the ability to detect a waste leak. However, the TraceTek electrical conductivity leak detection system planned for use in the SST 241-C-103 sluice pits has been tested and shown not to be affected by hydraulic fluid leaks using Mobile, Quaker Quintolubric 8-22-EHC, and Shell Tellus Plus 46 hydraulic fluid (RPP-19524).

E4.1.2.3 Conclusions

An amendment for the DSA and TSRs has been developed to (1) add waste transfer system siphon breaks as a Design Feature, (2) exempt the operability of the leak detection in waste transfer-associated structures where the waste is being pumped out by sump pump, (3) provide limited exceptions to material balance monitoring requirements when using sump pumps to transfer waste from a waste transfer-associated structure, and (4) clarify that electrical conductivity probes may be used in waste transfer-associated structures.

E5.0 CONTROLS

Based on the hazard and accident analyses of SST modified sluicing in SST 241-C-103 using DST 241-AN-106 supernatant, no new accidents were identified, and the existing DSA analyses were found to be encompassing and bounding. The DSA controls (i.e., safety SSCs and TSRs) were also found to acceptably prevent or mitigate potential hazardous conditions and postulated accidents with the exception of the exception to TSR LCO 3.1.1, "Transfer Leak Detection Systems," and AC 5.11.2.b.1 material balance monitoring requirements (see Section D4.1.2) during sump pump operation, and the addition of the Design Feature of the waste transfer system siphon breaks.

E6.0 REFERENCES

- HNF-SD-WM-TSR-006, *Tank Farms Technical Safety Requirements*, as amended, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-5924, 2003, *Radiological Source Terms for Tank Farms Safety Analysis*, Rev. 4, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-6213, 2005, *Hanford Waste Tank Bump Accident and Consequence Analysis*, Rev. 4, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-8369, 2003, *Chemical Source Terms for Tank Farms Safety Analyses*, Rev. 2, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-9689, 2003, *Offsite Radiological Consequence Calculation for the Bounding Mixing of Incompatible Materials Accident*, Rev. 3, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-13033, *Tank Farms Documented Safety Analysis*, as amended, CH2M HILL Hanford Group, Inc., Richland, Washington.
- RPP-13438, 2005, *Technical Basis for the Tank Bump Accident and Associated Representative Hazardous Conditions*, Rev. 2, CH2M HILL Hanford Group, Inc., Richland, Washington.

RPP-13750, 2005, *Waste Transfer Leaks Technical Basis Document*, Rev. 11-A, CH2M HILL Hanford Group, Inc., Richland, Washington.

RPP-15188, 2005, *Hazard Evaluation Database Report*, Rev. 7-C, CH2M HILL Hanford Group, Inc., Richland, Washington.

RPP-19524, 2004, *Hydraulic Fluid Compatibility with TraceTek Leak Detection System and Mini-Probe*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.

RPP-19618, 2004, *AN-106 Supernatant Pump Process Flow for C-103 Sluicing*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.

RPP-19621, 2004, *C-103 Slurry Pump Process Flow Calculation*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.

RPP-21753, 2005, *C-Farm 100 Series Tanks, Retrieval Process Flowsheet Description*, Rev. 1, CH2M HILL Hanford Group, Inc., Richland, Washington.

This page intentionally left blank.

RPP-17965 REV 4

ATTACHMENT E1
HAZARD EVALUATION DATABASE TABLES

This page intentionally left blank.

Table E2-1. Single Shell Tank 241-C-103 Modified Sluicing with Double-Shell Tank 241-AN-106 Supernatant New Hazardous Conditions (Without Controls).

ID	Cand Acc	Material at Risk	Hazardous Condition	Cause	Consequence	NC Freq	NC Offsite Rad	NC Onsite Rad	NC Onsite Tox	NC FW Cons	NC Offsite Risk Bin Rad	NC Offsite Risk Bin Tox	NC Onsite Risk Bin Rad	NC Onsite Risk Bin Tox	Basis for NC Consequence	Basis for NC Frequency	BIN	NC Env Cat
SUPERSLUICE-011	23X	Toxic gases and vapors in tank waste (ammonia vapors)	Release of toxic ammonia vapors from SST 241-C-103 to the atmosphere due to release of toxic gases and vapors in sludge fluid and SST waste	Toxic ammonia vapors in supernatant being used for SST waste retrieval and waste being retrieved are released as a result of SST sluicing using DST supernatant	Exposure to toxic material (ammonia)	A	L	L	L	Y	III	III	III	III	Basis for NC Offsite consequence: Estimated from analysis of acid addition (RPP-9689, "Offsite Radiological Consequence Calculation for the Bounding Mixing of Incompatible Materials Accident," and RPP-12646, "Mixing of Incompatible Materials in Waste Tanks Technical Basis Document"). Basis for NC Onsite Worker consequence: Estimated from analysis of acid addition (RPP-12646, "Mixing of Incompatible Materials in Waste Tanks Technical Basis Document"). Basis for NC Facility Worker consequence: Estimated from analysis of acid addition (RPP-12646, "Mixing of Incompatible Materials in Waste Tanks Technical Basis Document").	Basis for NC frequency: Anticipated based on process history of gas release events during waste disturbing activities.	C-1-a	E0
SUPERSLUICE-012	23X	Toxic gases and vapors in tank waste (organic vapors)	Release of toxic organic vapors from SST 241-C-103 to the atmosphere due to release of toxic gases and vapors in sludge fluid and SST waste	Toxic organic vapors in waste being retrieved are released as a result of SST sluicing using DST supernatant	Exposure to toxic material (organic vapor)	A	L	L	L	Y	III	III	III	III	Basis for NC Offsite consequence: Based on field experience and measurements of similar events. Basis for NC Onsite Worker consequence: Based on field experience and measurements of similar events. Basis for NC Facility Worker consequence: Based on field experience and measurements of similar events.	Basis for NC frequency: Anticipated based on process history and field experience of waste disturbing activities.	C-1-a	E0
SUPERSLUICE-013	33DX	Waste from DST 241-AN-106	Release of radioactive and other hazardous material from overflow of SST 241-C-103 due to siphon effect on DST 241-AN-106	Human Error - failure to close isolation valve (or valve malfunction) following waste transfer which allows flow to continue (siphon) when pump is stopped	Release of radioactive and other hazardous material from overflow of material from vault	U	L	H	M	Y	III	III	I	II	Basis for NC Offsite consequence: The "low" offsite radiological consequences are based on calculations presented in RPP-14499, "Offsite Radiological Consequence Analysis for the Waste Transfer Leak." The "low" offsite toxicological consequences are based on calculations presented in RPP-13750, "Waste Transfer Leaks Technical Basis Document." Basis for NC Onsite Worker consequence: The "high" onsite worker radiological consequence and the "moderate" onsite worker toxicological consequence are based on calculations for the large pipe break into a pit scenario documented in RPP-13570, "Waste Transfer Leaks Technical Basis Document."	Basis for NC frequency: The "unlikely" frequency is based on a qualitative assessment that siphoning from DST 241-AN-106 is likely but to overflow the SST 241-C-103 would take days to a week and therefore would most likely be recognized.	C-2-b	E2

Notes:

RPP-9689, 2003, *Offsite Radiological Consequence Calculation for the Bounding Mixing of Incompatible Materials Accident*, Rev. 3, CH2M HILL, Hanford Group, Inc., Richland, Washington.
 RPP-12646, 2003, *Mixing of Incompatible Materials in Waste Tanks Technical Basis Document*, Rev. 3, CH2M HILL, Hanford Group, Inc., Richland, Washington.
 RPP-13750, 2004, *Waste Transfer Leaks Technical Basis Document*, Rev. 11-A, CH2M HILL, Hanford Group, Inc., Richland, Washington.
 RPP-14499, 2004, *Offsite Radiological Consequence Analysis for the Waste Transfer Leak*, Rev. 3, CH2M HILL, Hanford Group, Inc., Richland, Washington.

- A = anticipated.
- DST = double-shell tank.
- H = high.
- L = low.
- NC = no controls.
- SST = single-shell tank.
- Y = yes.
- U = unlikely.

Table E2-2. Single-Shell Tank 241-C-103 Modified Sluicing with Double-Shell Tank 241-AN-106 Supernatant New Hazardous Conditions (With Controls).

ID	Candidate Accident	Preventive SSC	Preventive TSR	Mitigative SSC	Mitigative TSR	Facility Worker Controls	WC Freq			WC Offsite Rad			WC Offsite Tox			WC Onsite Rad			WC Onsite Tox			WC Offsite Risk Bin			WC Onsite Risk Bin			WC Offsite Consequence			Basis for WC Frequency			NC Env Category	Environmental Controls	Change MEMO
							WC Freq	WC Offsite Rad	WC Offsite Tox	WC Offsite Rad	WC Offsite Tox	WC Onsite Rad	WC Onsite Tox	WC Offsite Rad	WC Offsite Tox	WC Onsite Rad	WC Onsite Tox	WC Offsite Rad	WC Offsite Tox	WC Onsite Rad	WC Onsite Tox	WC Offsite Rad	WC Offsite Tox	WC Onsite Rad	WC Onsite Tox	WC Offsite Rad	WC Offsite Tox	WC Onsite Rad	WC Onsite Tox	WC Offsite Rad	WC Offsite Tox	WC Onsite Rad	WC Onsite Tox			
SUPERSLUICE-011	23X	None required	None required	None required	AC: Safety Management Programs ^ Industrial Hygiene ^ Training	The Mitigative TSR allocated to this hazardous condition is specifically allocated to address facility worker risk. The Hazardous Material Protection program includes requirements for an industrial hygiene program that addresses protection of the worker from exposure to toxic materials and training to respond by self evacuating when a gas release event occurs.																										E0		RDS - 02-04-2004: New hazardous condition added to address adding waste to SST during waste recovery. This change made in support of ECN-722725, R0, "Documented Safety Analysis Amendment Supporting SST Sluicing with DST Supernatant for SST 241-C-103." RPP-15188, "Hazard Evaluation Database Report," is revised under ECN-721450, R5, "Rev Haz Eval DB for SB Change for Recycle Supernatant Sluicing for SST 241-C-103."		
SUPERSLUICE-012	23X	None required	None required	None required	AC: Safety Management Programs ^ Industrial Hygiene ^ Training	The Mitigative TSR allocated to this hazardous condition is specifically allocated to address facility worker risk. The Hazardous Material Protection program includes requirements for an industrial hygiene program that addresses protection of the worker from exposure to toxic materials and training to respond by self evacuating when a gas release event occurs.																										E0		RDS - 02-04-2004: New hazardous condition added to address adding waste to SST during waste recovery. This change made in support of ECN-722725, R0, "Documented Safety Analysis Amendment Supporting SST Sluicing with DST Supernatant for SST 241-C-103." RPP-15188, "Hazard Evaluation Database Report," is revised under ECN-721450, R5, "Rev Haz Eval DB for SB Change for Recycle Supernatant Sluicing for SST 241-C-103."		
SUPERSLUICE-013	33DX	None required	Design Features: ^ Waste Transfer System Siphon Breaks	None required	None required	A preventive TSR is allocated to this hazardous condition to address onsite worker risk. Preventive controls also address facility worker risk.	EU	L	L	M	IV	IV	II	III																		E2		The preventive control allocated to this hazardous condition to address nuclear safety risk also address environmental risk.	RDS - 02-04-2004: New hazardous condition added to address adding waste to SST during waste recovery. This change made in support of ECN-722725, R0, "Documented Safety Analysis Amendment Supporting SST Sluicing with DST Supernatant for SST 241-C-103." RPP-15188, "Hazard Evaluation Database Report," is revised under ECN-721450, R5, "Rev Haz Eval DB for SB Change for Recycle Supernatant Sluicing for SST 241-C-103."	

Notes:
RPP-15188, 2005, Hazard Evaluation Database Report, Rev. 7-C, CH2M HILL Hanford Group, Inc., Richland, Washington.

- AC = administrative control.
- EU = extremely unlikely.
- H = high.
- L = low.
- M = moderate
- SSC = systems, structures, and components.
- TSR = technical safety requirement.
- WC = with controls.

APPENDIX F

PEER REIVEW CHECKLISTS

This page intentionally left blank.

APPENDIX F

PEER REVIEW CHECKLISTS

Effective Date: 2/12/2004

CHECKLIST FOR TECHNICAL PEER REVIEW

Document Reviewed: RPP-17965, *Safety Evaluation of the Single-Shell Tanks Modified Sluicing Waste Retrieval System, Rev. 4*

Scope of Review (e.g., document section or portion of calculation): Changes made for revision 4 of this document.

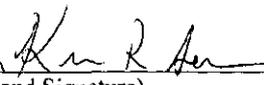
<u>Yes</u>	<u>No</u>	<u>NA*</u>	
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	1. Previous reviews are complete and cover the analysis, up to the scope of this review, with no gaps.
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	2. Problem is completely defined.
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	3. Accident scenarios are developed in a clear and logical manner.
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	4. Analytical and technical approaches and results are reasonable and appropriate. <i>(ORP QAPP criterion 2.8)</i>
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	5. Necessary assumptions are reasonable, explicitly stated, and supported. <i>(ORP QAPP criterion 2.2)</i>
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	6. Computer codes and data files are documented.
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	7. Data used in calculations are explicitly stated.
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	8. Bases for calculations, including assumptions and data, are consistent with the supported safety basis document (e.g., the Tank Farms Final Safety Analysis Report).
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	9. Data were checked for consistency with original source information as applicable. <i>(ORP QAPP criterion 2.9)</i>
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	10. For both qualitative and quantitative data, uncertainties are recognized and discussed, as appropriate. <i>(ORP QAPP criterion 2.17)</i>
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	11. Mathematical derivations were checked including dimensional consistency of results. <i>(ORP QAPP criterion 2.16)</i>
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	12. Models are appropriate and were used within their established range of validity or adequate justification was provided for use outside their established range of validity.
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	13. Spreadsheet results and all hand calculations were verified.
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	14. Calculations are sufficiently detailed such that a technically qualified person can understand the analysis without requiring outside information. <i>(ORP QAPP criterion 2.5)</i>
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	15. Software input is correct and consistent with the document reviewed.
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	16. Software output is consistent with the input and with the results reported in the document reviewed.
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	17. Software verification and validation are addressed adequately. <i>(ORP QAPP criterion 2.6)</i>
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	18. Limits/criteria/guidelines applied to the analysis results are appropriate and referenced. Limits/criteria/guidelines were checked against references. <i>(ORP QAPP criterion 2.9)</i>
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	19. Safety margins are consistent with good engineering practices.
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	20. Conclusions are consistent with analytical results and applicable limits.
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	21. Results and conclusions address all points in the purpose. <i>(ORP QAPP criterion 2.3)</i>

KRA

RPP-17965 REV 4

Effective Date: 2/12/2004

- 22. All references cited in the text, figures, and tables are contained in the reference list.
 - 23. Reference citations (e.g., title and number) are consistent between the text callout and the reference list.
 - 24. Only released (i.e., not draft) references are cited. (ORP QAPP criterion 2.1)
 - 25. Referenced documents are retrievable or otherwise available.
 - 26. The most recent version of each reference is cited, as appropriate. (ORP QAPP criterion 2.1)
 - 27. There are no duplicate citations in the reference list.
 - 28. Referenced documents are spelled out (title and number) the first time they are cited.
 - 29. All acronyms are spelled out the first time they are used.
 - 30. The Table of Contents is correct.
 - 31. All figure, table, and section callouts are correct.
 - 32. Unit conversions are correct and consistent.
 - 33. The number of significant digits is appropriate and consistent.
 - 34. Chemical reactions are correct and balanced.
 - 35. All tables are formatted consistently and are free of blank cells.
 - 36. The document is complete (pages, attachments, and appendices) and in the proper order.
 - 37. The document is free of typographical errors.
 - 38. The tables are internally consistent.
 - 39. The document was prepared in accordance with HNF-2353, Section 4.3, Attachment B, "Calculation Note Format and Preparation Instructions".
 - 40. Impacted documents are appropriately identified in Blocks 7 and 25 of the Engineering Change Notice (form A-6003-563.1).
 - 41. If more than one Technical Peer Reviewer was designated for this document, an overall review of the entire document was performed after resolution of all Technical Peer Review comments and confirmed that the document is self-consistent and complete.
- Concurrence**

K.R. Sandgren  3/16/05
Reviewer (Printed Name and Signature) Date

* If No or NA is chosen, provide an explanation on this form.

CHECKLIST FOR TECHNICAL PEER REVIEW

Document Reviewed: RPP-17965, *Safety Evaluation of the Single-Shell Tanks Modified Sluicing Waste Retrieval System, Rev. 4*

Scope of Review (e.g., document section or portion of calculation): Technical edit

<u>Yes</u>	<u>No</u>	<u>NA*</u>	
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	1. Previous reviews are complete and cover the analysis, up to the scope of this review, with no gaps.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	2. Problem is completely defined.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	3. Accident scenarios are developed in a clear and logical manner.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	4. Analytical and technical approaches and results are reasonable and appropriate. (ORP QAPP criterion 2.8)
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	5. Necessary assumptions are reasonable, explicitly stated, and supported. (ORP QAPP criterion 2.2)
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	6. Computer codes and data files are documented.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	7. Data used in calculations are explicitly stated.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	8. Bases for calculations, including assumptions and data, are consistent with the supported safety basis document (e.g., the Tank Farms Final Safety Analysis Report).
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	9. Data were checked for consistency with original source information as applicable. (ORP QAPP criterion 2.9)
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	10. For both qualitative and quantitative data, uncertainties are recognized and discussed, as appropriate. (ORP QAPP criterion 2.17)
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	11. Mathematical derivations were checked including dimensional consistency of results. (ORP QAPP criterion 2.16)
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	12. Models are appropriate and were used within their established range of validity or adequate justification was provided for use outside their established range of validity.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	13. Spreadsheet results and all hand calculations were verified.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	14. Calculations are sufficiently detailed such that a technically qualified person can understand the analysis without requiring outside information. (ORP QAPP criterion 2.5)
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	15. Software input is correct and consistent with the document reviewed.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	16. Software output is consistent with the input and with the results reported in the document reviewed.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	17. Software verification and validation are addressed adequately. (ORP QAPP criterion 2.6)
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	18. Limits/criteria/guidelines applied to the analysis results are appropriate and referenced. Limits/criteria/guidelines were checked against references. (ORP QAPP criterion 2.9)
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	19. Safety margins are consistent with good engineering practices.
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	20. Conclusions are consistent with analytical results and applicable limits.

LA 03/17/05

CHECKLIST FOR TECHNICAL PEER REVIEW

21. Results and conclusions address all points in the purpose. (ORP QAPP criterion 2.3)
22. All references cited in the text, figures, and tables are contained in the reference list.
23. Reference citations (e.g., title and number) are consistent between the text callout and the reference list.
24. Only released (i.e., not draft) references are cited. (ORP QAPP criterion 2.1)
25. Referenced documents are retrievable or otherwise available.
26. The most recent version of each reference is cited, as appropriate. (ORP QAPP criterion 2.1)
27. There are no duplicate citations in the reference list.
28. Referenced documents are spelled out (title and number) the first time they are cited.
29. All acronyms are spelled out the first time they are used.
30. The Table of Contents is correct.
31. All figure, table, and section callouts are correct.
32. Unit conversions are correct and consistent.
33. The number of significant digits is appropriate and consistent.
34. Chemical reactions are correct and balanced.
35. All tables are formatted consistently and are free of blank cells.
36. The document is complete (pages, attachments, and appendices) and in the proper order.
37. The document is free of typographical errors.
38. The tables are internally consistent.
39. The document was prepared in accordance with HNF-2353, Section 4.3, Attachment B, "Calculation Note Format and Preparation Instructions".
40. Impacted documents are appropriately identified in Blocks 7 and 25 of the Engineering Change Notice (form A-6003-563.1).
41. If more than one Technical Peer Reviewer was designated for this document, an overall review of the entire document was performed after resolution of all Technical Peer Review comments and confirmed that the document is self-consistent and complete.
- Concurrence**

Leona Aamot

Reviewer (Printed Name and Signature)

03/17/05
Date

* If No or NA is chosen, provide an explanation on this form.

Technical Edit